

MACADAM



MERCEDES Vito: 1YQV457

Vinnnumber:	W1V44770313788309	Versionname:	Vito 116 CDI Mixto Perfect Tool L2 120kW/163pk
First Registrationdate:	10/11/2020	Fiscalpower:	5D/P Auto-9
Expertise Mileage:	236216	Power Kw:	
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Steel
Transmission:	Back	Parking lot:	d040
Fueltype:	Diesel		
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Steel		
Certificate of Conformity:	Yes		
Category:	Light Commercial Vehicle		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Dirty		

Options

Number of keys total:	2	Radio	
Number keys remote:	2	Lining leather	
GPS storage:			
GPS storage:	HD		
Windows electric F:			
Cruise Control:			
Steering wheel multifunctional:			
Navigation with screen:			
Airco manual:			

Limited Technical Inspection

Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Transmission:	OK
Exhaust gass:	OK		

Tyres

225/55/17/109 T				
Winter tyres:	Fr.L.	Continental: 2 mm	Fr.R.	Continental: 2 mm
	Re.L.	Continental: 4 mm	Re.R.	Continental: 8 mm
Tyre profile depth FL:				2.0
Tyre profile depth FR:				2.0
Tyre profile depth RL:				4.0
Tyre profile depth RR:				8.0
Tyre size FL:				225/55 R 17 109 T
Tyre size FR:				225/55 R 17 109 T
Tyre size RL:				225/55 R 17 109 T
Tyre size RR:				225/55 R 17 109 T
Tyre type FL:				Winter
Tyre type FR:				Winter
Tyre type RL:				Winter
Tyre type RR:				Winter
Tyre make FL:				256
Tyre make FR:				256
Tyre make RL:				256
Tyre make RR:				256

Assistance equipment

Spare wheel:	Yes	Jack:	Yes
Number of charging cables (normal):	0		
Number of charging cables (rapid charge):	0		

Instrument panel, complete, Repaired, Acceptable




Backrest cover FL, Scratch(es), Acceptable



Interior, Stain, Acceptable



Door panel FR, Scratch(es), Smart repair

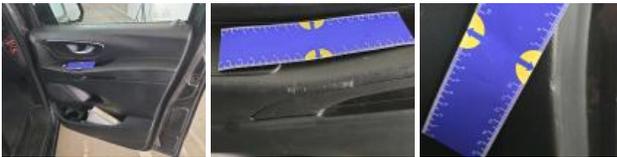

Bonnet, Dent(s) and scratch(es), Repair and paint (complete)



Grille, Broken, Replace



Brand badge F, Broken, Replace



Bumper F, Crack, Replace and paint




Headlight L, Scratch(es), Replace



Windscreen, Stone chip(s), Windscreen repair



Central pillar L, Scratch(es), Acceptable

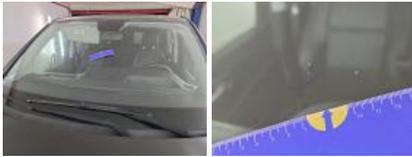

Wheel cover RL, Scratch(es), Replace



Wheel cover FL, Broken, Replace



Tyre FL, Worn, Acceptable




Wing FL, Scratch(es), Polish



Outside rear-view mirror housing L, Scratch(es), Acceptable




Door FL, Dent(s) and scratch(es), Acceptable

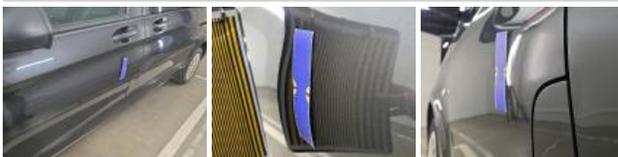



Door RL, Dent(s) and scratch(es), Spot repair

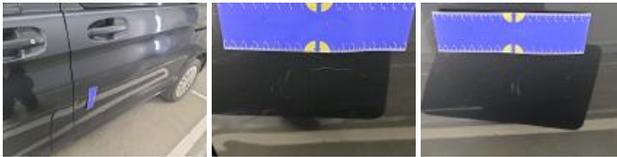

Wing RL, Scratch(es), Acceptable



Shutter / cover R, Deformed / Strained, Acceptable



Rear window, Scratch(es), Replace




Rear light L, Crack, Replace




Wheel cover RR, Scratch(es), Replace




Wing RR, Scratch(es), Repair and paint (complete)

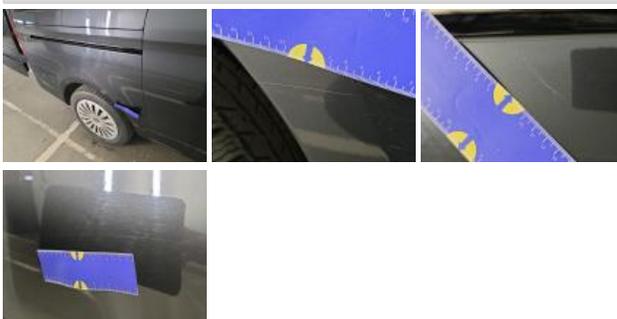

Outer sill R, Scratch(es), Repair and paint (complete)

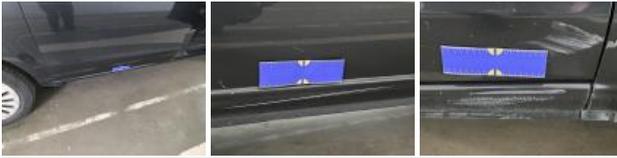


Wing FR, Dent(s) and scratch(es), Repair and paint (complete)

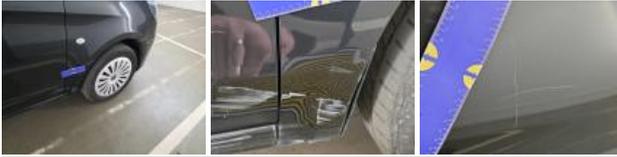

Door FR, Dent(s) and scratch(es), Repair and paint (complete)



Door RR, Dent(s) and scratch(es), Repair and paint (complete)

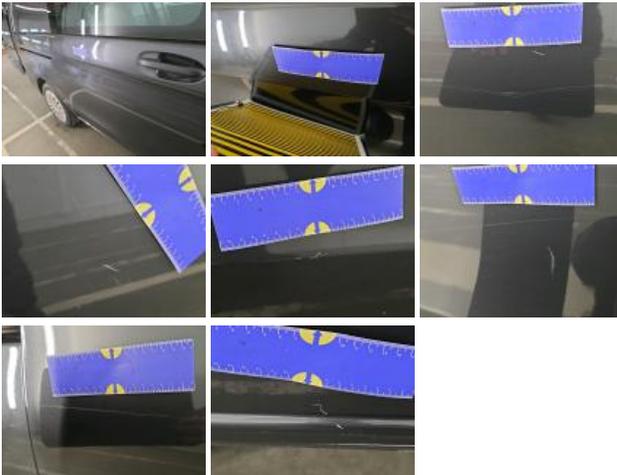

Outside rear-view mirror housing R, Scratch(es), Acceptable



Tyre FR, Worn, Acceptable



Wheel cover FR, Scratch(es), Replace



Bodywork, Inspection +, Photo complémentaire



Bodywork, Accident, Check



Roof, Dent(s), Paintless dent repair



Fuel cap cover, Scratch(es), Acceptable



Bodywork, Scratch(es), Acceptable

