



VOLVO XC60: 2ABR053

Vinnnummer:	YV1UZBFVDM1814622	Versionname:	XC60 T6 Recharge Geartronic R-Design
First Registrationdate:	11/02/2021	Fiscalpower:	251kW/341pk 5D/P Auto-8
Expertise Mileage:	113260	Power Kw:	
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	a111
Fueltype:	Hybrid Petrol		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Dirty		

Options

Number of keys total	2	Radio	
Number keys remote	2	Lining leather	
Windows electric F		Sun Roof electric	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional			
Seats F heated			
Navigation with screen			
Airco electronic			
Rims alloy			

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

235/55/19/105 V				
Winter tyres:	Fr.L.	Fulda: 5 mm	Fr.R.	Fulda: 5 mm
	Re.L.	Semperit: 5 mm	Re.R.	Semperit: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				235/55 R 19 105 V
Tyre size FR				235/55 R 19 105 V
Tyre size RL				235/55 R 19 105 V
Tyre size RR				235/55 R 19 105 V
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				2484
Tyre make FR				2484
Tyre make RL				2477
Tyre make RR				2477

Assistance equipment

Number of charging cables (normal)	1	Compressor	No
Number of charging cables (rapid charge)	0		

Instrument panel, complete, Repaired, Acceptable



Backrest cover FL, Worn, Acceptable




Ignition key, Worn, Replace




Door panel RL, Hole, Smart repair



Door panel FL, Hole, Smart repair

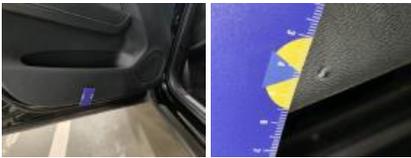

Bonnet, Bad repair, Repair and paint (complete)

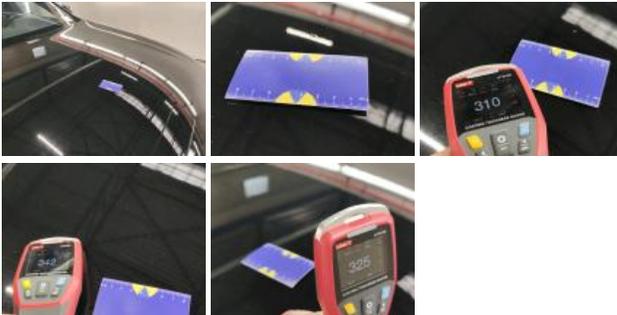

Windscreen, Stone chip(s), Windscreen repair



Wing FL, Dent(s), Acceptable




Alloy rim FL polished, Scratch(es), Repair and paint (complete)





Mirror side repeater L, Scratch(es), Replace




Door FL, Dent(s), Paintless dent repair

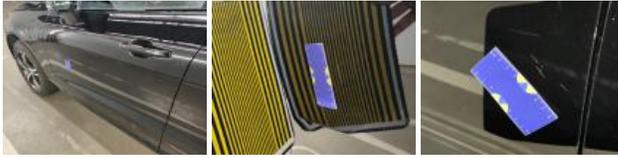

Door trim FL, Scratch(es), Acceptable

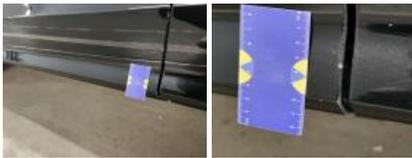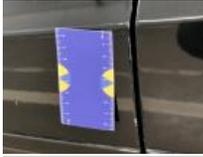

Door RL, Bad repair, Repair and paint (complete)

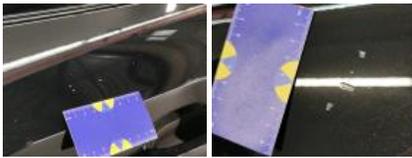

Step L, Scratch(es), Acceptable



Compressor, Missing, Replace




Boot carpet, Damaged, Smart repair



Boot lid covering R, Scratch(es), Acceptable




Bumper R, Dent(s) and scratch(es), Repair and paint (complete)

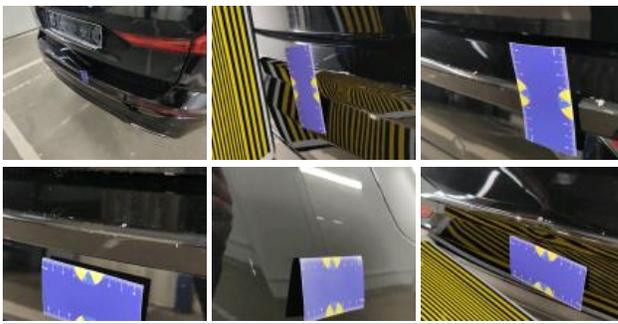

Shutter / cover R, Missing, Replace



Tailgate / Boot, Bad repair, Repair and paint (complete)

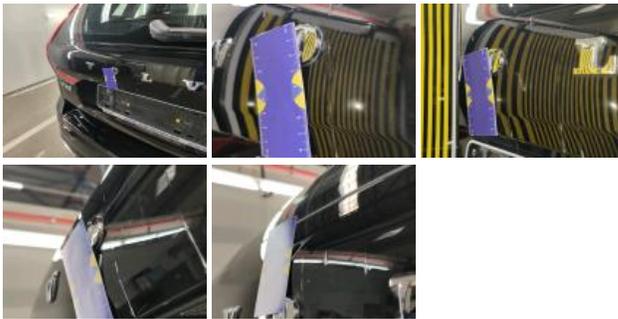

Alloy rim FR polished, Scratch(es), Repair and paint (complete)



Wing FR, Dent(s), Paintless dent repair



Mirror side repeater R, Scratch(es), Replace




Outside rear-view mirror base R, Broken, Replace



Door FR, Dent(s) and scratch(es), Spot repair



Door RR, Scratch(es), Polish

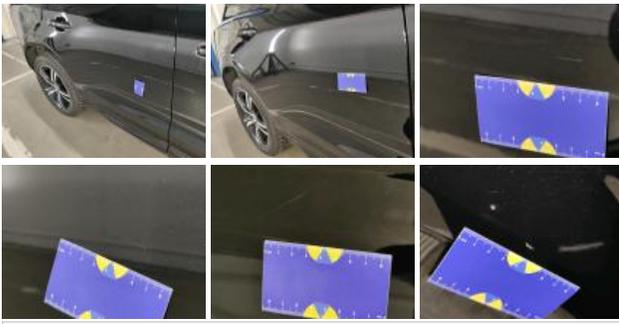

Step R, Dent(s) and scratch(es), Spot repair



Alloy rim RR polished, Scratch(es), Acceptable



Bodywork, No damage, Acceptable



Roof, Chemical polution, Polish

