



SEAT Arona: 2DNZ682

Vinnumber:	VSSZZKJ6PR112295	Versionname:	Arona 1.0 TSI Move Full Link 70kW/95pk 5D/P Man-5 (4 seizoenen Banden) - CO2 indicatief
First Registrationdate:	10/05/2023	Fiscalpower:	
Expertise Mileage:	135752	Power Kw:	70
Bodytype:		Body colour:	Grey
Gearbox:	MAN 6 VIT	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	d249
Fueltype:	Petrol		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total	2	Radio
Number keys remote	2	Rear parking sensors
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Navigation with screen		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

205/60/16/96 V				
Summer tyres:	Fr.L.	Firestone: 5 mm	Fr.R.	Firestone: 5 mm
	Re.L.	Uniroyal: 5 mm	Re.R.	Uniroyal: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				205/60 R 16 96 V
Tyre size FR				205/60 R 16 96 V
Tyre size RL				205/60 R 16 96 V
Tyre size RR				205/60 R 16 96 V
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				258
Tyre make FR				258
Tyre make RL				265
Tyre make RR				265

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Instrument panel, complete, Repaired, Acceptable



Roof liner, Stain, Cleaning



Backrest cover FL, Worn, Acceptable




Backrest cover RR, Worn, Acceptable




Bumper F, Scratch(es), Acceptable



Bonnet, Scratch(es), Polish

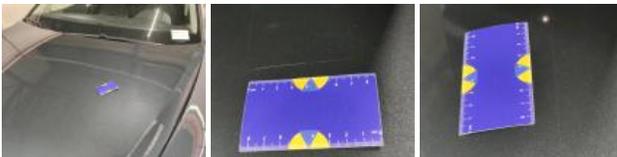

Wing FL, Scratch(es), Polish

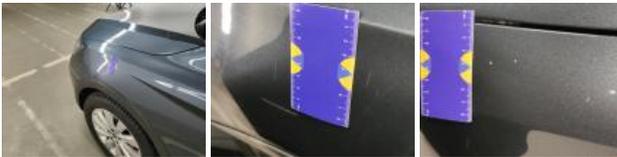


Roof pillar L, Dent(s), Paintless dent repair




Door FL, Scratch(es), Acceptable




Door trim FL, Scratch(es), Acceptable

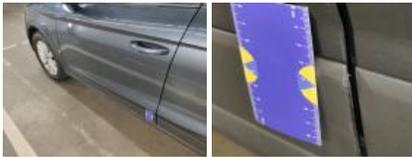

Door RL, Scratch(es), Acceptable

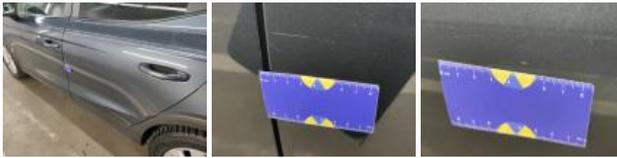

Step L, Dent(s) and scratch(es), Spot repair

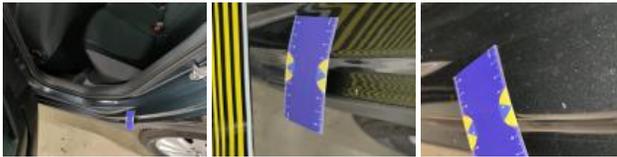

Wing trim RL, Scratch(es), Replace




Sill trim L, Scratch(es), Acceptable



Boot cover, Missing, Replace




Boot lid covering R, Scratch(es), Smart repair

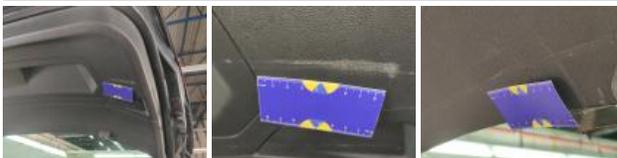

Tailgate / Boot, Dent(s), Acceptable




Rear spoiler, Scratch(es), Polish

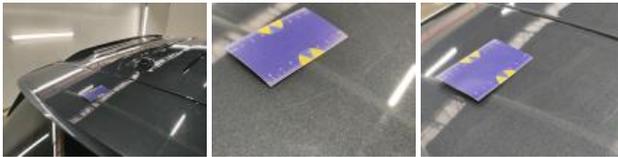


Bumper R, Scratch(es), Acceptable




Bumper trim R, Scratch(es), Smart repair

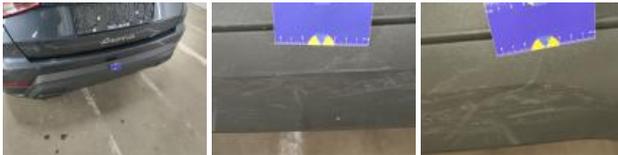


Door FR, Dent(s), Acceptable

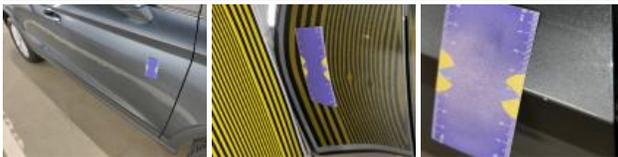

Outer door handle FR, Scratch(es), Acceptable

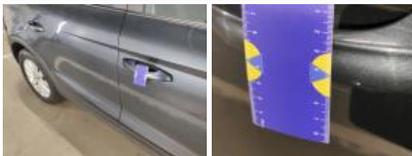

Door RR, Dent(s) and scratch(es), Repair and paint (complete)

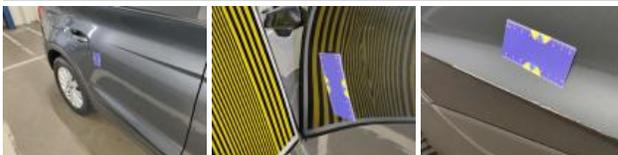

Step R, Scratch(es), Acceptable



Wing RR, Dent(s), Acceptable



Wing trim RR, Scratch(es), Replace



Roof, Scratch(es), Polish



Bodywork, No damage, Acceptable

