



#### OPEL Corsa: 2DEW789

Vinnumber:	<b>VXKUPHNSSN4437035</b>	Versionname:	<b>Corsa 1.2 Turbo S/S Auto GS Line 96kW/131pk 5D/P Auto-8</b>
First Registrationdate:	<b>27/02/2023</b>	Fiscalpower:	
Expertise Mileage:	<b>22544</b>	Power Kw:	
Bodytype:		Body colour	
Gearbox:	<b>Automatic</b>	Type of rims (mounted)	<b>Black</b>
Transmission:	<b>Front</b>	Parking lot	
Fueltype:	<b>Petrol</b>		
Number of doors	<b>5</b>		
Number of seats	<b>5</b>		
Number head rests	<b>5</b>		
Type of rims (mounted)	<b>Aluminium</b>		
Certificate of Conformity	<b>Yes</b>		
Category	<b>Passenger Car</b>		
Registration Certificate Car (BE)	<b>Yes</b>		
Bodywork	<b>Clean</b>		
Interior	<b>Clean</b>		

#### Options

Number of keys total	<b>2</b>	Front parking sensors
Number keys remote	<b>2</b>	Rear parking sensors
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Airco manual		
Rims alloy		

#### Limited Technical Inspection

Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Transmission	<b>OK</b>

#### Tyres

<b>195/55/16/91 H</b>					
Summer tyres:	Fr.L.	Goodyear: 6 mm	Fr.R.	Goodyear: 6 mm	6.0
	Re.L.	Goodyear: 7 mm	Re.R.	Goodyear: 7 mm	
Tyre profile depth FL					6.0
Tyre profile depth FR					6.0
Tyre profile depth RL					7.0
Tyre profile depth RR					7.0
Tyre size FL					195/55 R 16 91 H
Tyre size FR					195/55 R 16 91 H
Tyre size RL					195/55 R 16 91 H
Tyre size RR					195/55 R 16 91 H
Tyre type FL					All seasons
Tyre type FR					All Seasons
Tyre type RL					All seasons
Tyre type RR					All Seasons
Tyre make FL					259
Tyre make FR					259
Tyre make RL					259
Tyre make RR					259


#### Assistance equipment

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		


Seat cover FL, Stain, Cleaning



Seat cover R, Stain, Cleaning

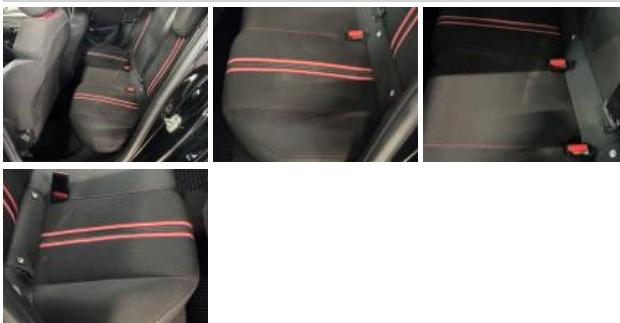


Bonnet, Dent(s) and scratch(es), Spot repair

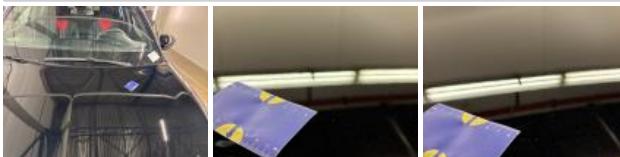


Central pillar L, Bad repair, Spot repair




Door FL, Bad repair, Spot repair

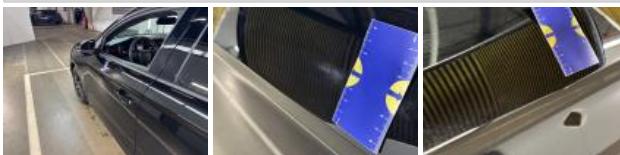

Boot lid covering R, Scratch(es), Acceptable

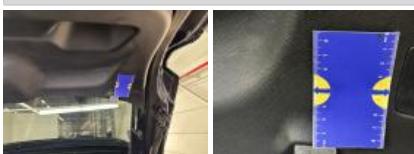


Rear window, Scratch(es), Polish

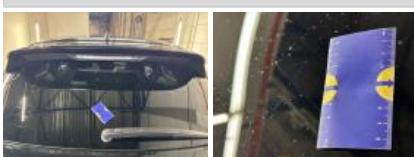

Rear spoiler, Bad repair, Spot repair



Wing RR, Bad repair, Spot repair

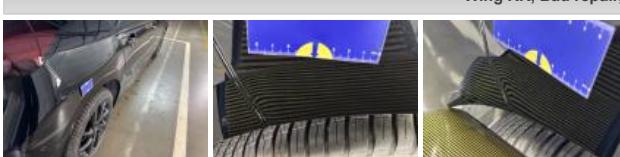

Door FR, Bad repair, Spot repair

