



## VOLVO V40: 1XTC865

Vinnnumber:	<b>YV1MV36V1K2586016</b>	Versionname:	<b>V40 T2 Black Edition 90kW/122pk 5D/P Man-6</b>
First Registrationdate:	<b>9/04/2019</b>	Fiscalpower:	
Expertise Mileage:	<b>106009</b>	Power Kw:	
Bodytype:		Body colour:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Type of rims (mounted):	<b>Aluminium</b>
Transmission:	<b>Front</b>	Parking lot:	<b>d301</b>
Fueltype:	<b>Petrol</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Type of rims (mounted):	<b>Aluminium</b>		
Certificate of Conformity:	<b>Yes</b>		
Category:	<b>Passenger Car</b>		
Registration Certificate Car (BE):	<b>Yes</b>		
Bodywork:	<b>Dirty</b>		
Interior:	<b>Dirty</b>		

## Options

Number of keys total:	<b>2</b>	Radio:	
Number keys remote:	<b>2</b>	Rear parking sensors:	
Windows electric F:			
Windows electric R:			
Cruise Control:			
Steering wheel multifunctional:			
Navigation with screen:			
Airco electronic:			
Rims alloy:			

## Limited Technical Inspection

Idle position:	<b>OK</b>	Sound engine:	<b>OK</b>
Engine startingtime:	<b>OK</b>	Clutch test:	<b>OK</b>
Exhaust gass:	<b>OK</b>	Transmission:	<b>OK</b>

## Tyres

205/55/16/91 H				
Winter tyres:	Fr.L.	<b>Continental: 2 mm</b>	Fr.R.	<b>Continental: 2 mm</b>
	Re.L.	<b>Michelin: 4 mm</b>	Re.R.	<b>Continental: 5 mm</b>
Tyre profile depth FL				<b>2.0</b>
Tyre profile depth FR				<b>2.0</b>
Tyre profile depth RL				<b>4.0</b>
Tyre profile depth RR				<b>5.0</b>
Tyre size FL				<b>205/55 R 16 91 H</b>
Tyre size FR				<b>205/55 R 16 91 H</b>
Tyre size RL				<b>205/55 R 16 91 H</b>
Tyre size RR				<b>205/55 R 16 91 H</b>
Tyre type FL				<b>Winter</b>
Tyre type FR				<b>Winter</b>
Tyre type RL				<b>All seasons</b>
Tyre type RR				<b>Winter</b>
Tyre make FL				<b>256</b>
Tyre make FR				<b>256</b>
Tyre make RL				<b>261</b>
Tyre make RR				<b>256</b>

## Assistance equipment

Repair kit:	<b>Yes</b>	Compressor:	<b>Yes</b>
Number of charging cables (normal):	<b>0</b>		
Number of charging cables (rapid charge):	<b>0</b>		

Instrument panel, complete, Repaired, Acceptable



Interior, Dirty, Cleaning



Interior, Smell, Ozone treatment




Bumper F, Scratch(es), Spot repair



Tyre RL, Out of tolerance, Check




Alloy rim FL polished, Scratch(es), Repair and paint (complete)

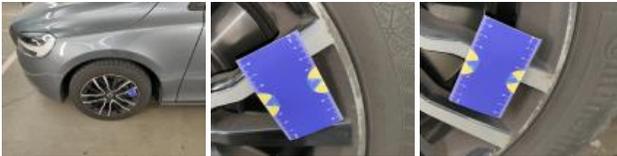


Outer door handle FL, Scratch(es), Repair and paint (complete)



Door FL, Scratch(es), Polish

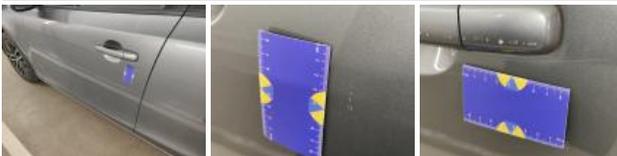

Wing RL, Dent(s), Paintless dent repair

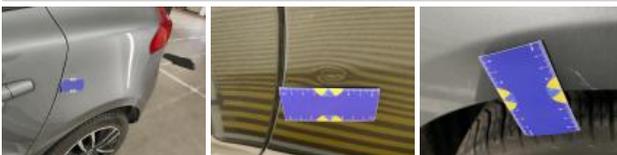

Bumper R, Dent(s), Spot repair



Bumper trim R, Scratch(es), Acceptable




Alloy rim FR polished, Scratch(es), Repair and paint (complete)



Wing FR, Scratch(es), Acceptable



Door FR, Dent(s), Paintless dent repair

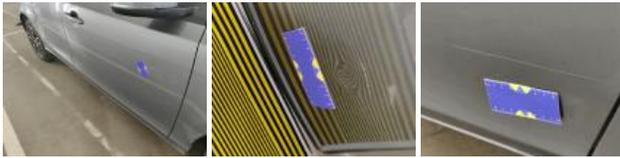

Door RR, Scratch(es), Spot repair



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)



Alloy rim RR polished, Scratch(es), Repair and paint (complete)



Sill trim R, Scratch(es), Spot repair



Bodywork, No damage, Acceptable



Roof, Chemical polution, Polish

