



PEUGEOT 2008: 2BLS532				
Vinnumber:	VR3USHNKKMJ918614	Versionname:	2008 1.2 Puretech S/S Active Pack 74kW/100pk 5D/P Man-6	
First Registrationdate:	6/01/2022	Fiscalpower:		
Expertise Mileage:	54461	Power Kw:		
Bodytype:		Body colour	Black	
Gearbox:	MAN 6 VIT	Type of rims (mounted)	Aluminium	
Transmission:	Front	Parking lot	b420	
Fueltype:	Petrol			
Number of doors	5			
Number of seats	5			
Number head rests	5			
Type of rims (mounted)	Aluminium			
Certificate of Conformity	Yes			
Category	Passenger Car			
Registration Certificate Car (BE)	Yes			
Bodywork	Clean			
Interior	Clean			
Options				
Number of keys total	2	Radio		
Number keys remote	1	Front parking sensors		
Windows electric F		Rear parking sensors		
Windows electric R				
Cruise Control				
Steering wheel multifunctional				
Airco electronic				
Rims alloy				
Limited Technical Inspection				
Idle position	OK	Sound engine	OK	
Engine startingtime	OK	Clutch test	OK	
Exhaust gass	OK	Transmission	OK	
Tyres				
Summer tyres:	215/65/16/98 H			
	Fr.L.	Bridgestone: 5 mm	Fr.R.	Bridgestone: 5 mm
	Re.L.	Continental: 4 mm	Re.R.	Continental: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				4.0
Tyre profile depth RR				5.0
Tyre size FL				215/65 R 16 98 H
Tyre size FR				215/65 R 16 98 H
Tyre size RL				215/65 R 16 98 H
Tyre size RR				215/65 R 16 98 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				255
Tyre make FR				255
Tyre make RL				256
Tyre make RR				256
Assistance equipment				
Repair kit	Yes	Compressor		Yes
Number of charging cables (normal)	0			
Number of charging cables (rapid charge)	0			
Instrument panel, complete, Not functioning (well), Acceptable				



Seat cover FL, Stain, Cleaning



Windscreen, Scratch(es), Polish



Bonnet, Scratch(es), Polish



Bumper spoiler F, Scratch(es), Replace



Bumper moulding F, Scratch(es), Replace



Door RL, Repaired, Acceptable



Door FL, Repaired, Acceptable



Outside rear-view mirror housing L, Scratch(es), Acceptable



Wing FL, Repaired, Acceptable



Boot lid covering R, Scratch(es), Acceptable



Bumper R, Scratch(es), Polish




Bumper trim R, Scratch(es), Acceptable




Boot moulding, Dent(s), Replace



Wing FR, Repaired, Acceptable

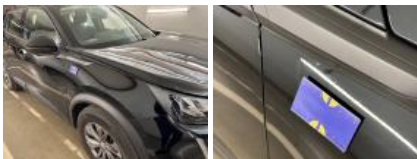

Door RR, Bad repair, Spot repair

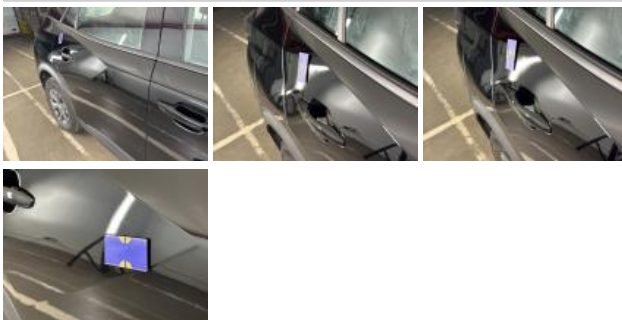


Wing RR, Scratch(es), Polish



Wing trim RR, Scratch(es), Acceptable



Roof, Hail damage, Paintless dent repair (hail)

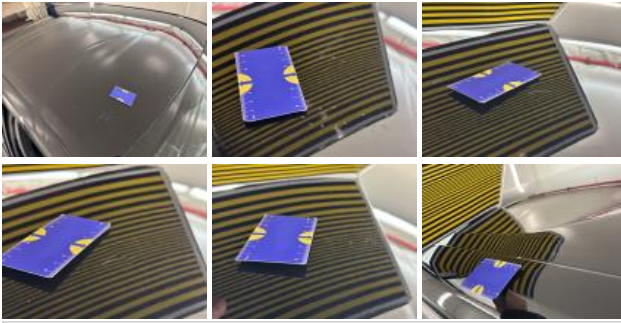

Bodywork, No damage, Acceptable

