
**MERCEDES CLA Shooting Brake: 2AMV508**

Vinnumber:	<b>W1K1186101N224287</b>	Versionname:	<b>CLA Shooting Brake CLA 180 d DCT Business Solution 85kW/116pk 5D/P Auto-8</b>
First Registrationdate:	<b>18/05/2021</b>	Fiscalpower:	<b>85</b>
Expertise Mileage:	<b>168041</b>	Power Kw:	<b>Black</b>
Bodytype:		Body colour	<b>Aluminium</b>
Gearbox:	<b>Automatic</b>	Type of rims (mounted)	<b>c316</b>
Transmission:	<b>Front</b>	Parking lot	
Fueltype:	<b>Diesel</b>		
Number of doors	<b>5</b>		
Number of seats	<b>5</b>		
Number head rests	<b>5</b>		
Type of rims (mounted)	<b>Aluminium</b>		
Certificate of Conformity	<b>Yes</b>		
Category	<b>Passenger Car</b>		
Registration Certificate Car (BE)	<b>Yes</b>		
Bodywork	<b>Clean</b>		
Interior	<b>Clean</b>		

**Options**

Number of keys total	<b>2</b>	Radio
Number keys remote		
Windows electric F	<b>2</b>	Front parking sensors
Windows electric R		Rear parking sensors
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Alarm		
Navigation with screen		
Airco electronic		
Rims alloy		

**Limited Technical Inspection**

Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Transmission	<b>OK</b>

**Tyres**

<b>205/60/16/96 H</b>			
Winter tyres:	Fr.L. <b>Uniroyal: 4 mm</b>	Fr.R. <b>Uniroyal: 4 mm</b>	
	Re.L. <b>Fulda: 5 mm</b>	Re.R. <b>Fulda: 5 mm</b>	
Tyre profile depth FL			<b>4.0</b>
Tyre profile depth FR			<b>4.0</b>
Tyre profile depth RL			<b>5.0</b>
Tyre profile depth RR			<b>5.0</b>
Tyre size FL			<b>205/60 R 16 96 H</b>
Tyre size FR			<b>205/60 R 16 96 H</b>
Tyre size RL			<b>205/60 R 16 96 H</b>
Tyre size RR			<b>205/60 R 16 96 H</b>
Tyre type FL			<b>Winter</b>
Tyre type FR			<b>Winter</b>
Tyre type RL			<b>Winter</b>
Tyre type RR			<b>Winter</b>
Tyre make FL			<b>265</b>
Tyre make FR			<b>265</b>
Tyre make RL			<b>2484</b>
Tyre make RR			<b>2484</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		

Number of charging cables (rapid charge)

0


Instrument panel, complete, Not functioning (well), Acceptable



Steering wheel, Worn, Acceptable



Bonnet, Stone chip(s), Acceptable

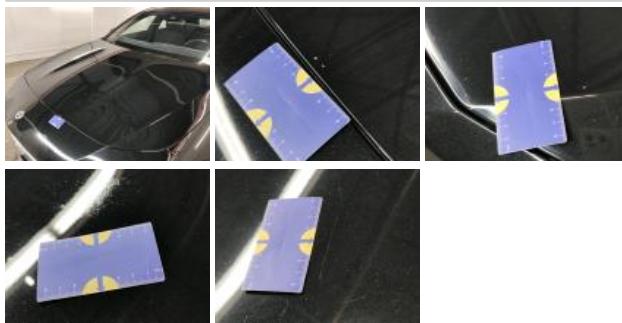

Bumper F, Scratch(es), Acceptable




Wing RL, Dent(s), Acceptable



Wing FL, Scratch(es), Acceptable



Mirror side repeater L, Scratch(es), Polish

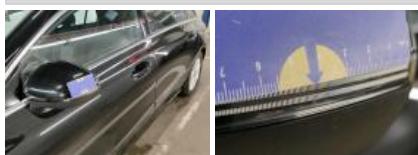

Tailgate / Boot, Scratch(es), Acceptable







Rear light L tailgate, Scratch(es), Polish



Rear light R tailgate, Scratch(es), Polish



Internal boot lining L, Scratch(es), Acceptable

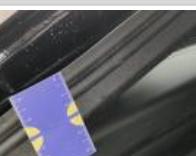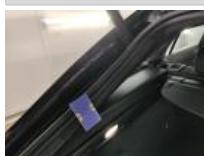


Rear light L, Scratch(es), Polish




Alloy rim FR, Scratch(es), Acceptable




Wing FR, Scratch(es), Acceptable

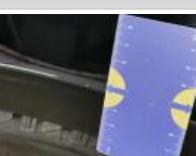


Door RR, Scratch(es), Polish

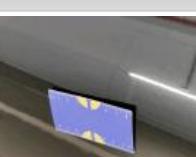

Wing RR, Scratch(es), Polish

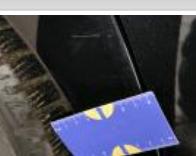

Roof pillar R, Dent(s), Paintless dent repair

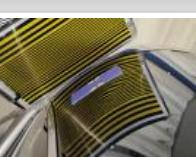

Bodywork, Not original part, Remove lettering



Bodywork, No damage, Acceptable



Roof, Chemical polution, Polish

