



SKODA Kodiaq: 2BQL873

Vinnnumber:	TMBJJ7NS0N8026191	Versionname:	Kodiaq 2.0 CRTDI DSG7 Sportline II 110kW/150pk
First Registrationdate:	15/02/2022	Fiscalpower:	5D/P Auto-7
Expertise Mileage:	199335	Power Kw:	
Bodytype:		Body colour:	Blue
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	a204
Fueltype:	Diesel		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Dirty		

Options

Number of keys total	1	Radio
Number keys remote	1	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		Fog lights (front)
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Alarm		
Navigation with screen		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

235/50/19/99 V				
Summer tyres:	Fr.L.	Firestone: 2 mm	Fr.R.	Firestone: 2 mm
	Re.L.	Hankook: 3 mm	Re.R.	Hankook: 3 mm
Tyre profile depth FL				2.0
Tyre profile depth FR				2.0
Tyre profile depth RL				3.0
Tyre profile depth RR				3.0
Tyre size FL				235/50 R 19 99 V
Tyre size FR				235/50 R 19 99 V
Tyre size RL				235/50 R 19 99 V
Tyre size RR				235/50 R 19 99 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				258
Tyre make FR				258
Tyre make RL				260
Tyre make RR				260

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		

Number of charging cables (rapid charge)

0

Ignition key, Missing, Replace



Instrument panel, complete, Repaired, Acceptable



Interior, Smell, Ozone treatment




Interior, Dirty, Cleaning



Backrest cover FL, Stain, Cleaning



Door panel RR, Scratch(es), Acceptable

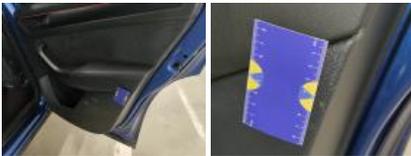

Backrest cover RM, Worn, Acceptable



Bumper F, Stone chip(s), Repair and paint (complete)




Bumper grille, Broken, Replace




Bonnet, Scratch(es), Repair and paint (complete)




Wing FL, Scratch(es), Spot repair

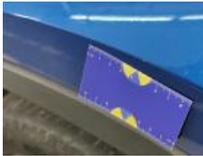


Door FL, Scratch(es), Acceptable

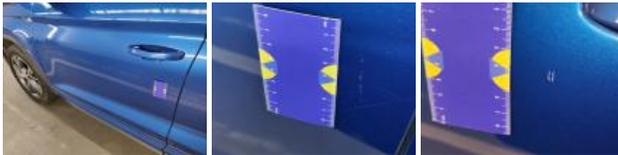


Outer door handle FL, Scratch(es), Acceptable

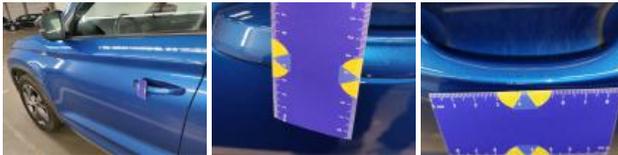

Roof pillar L, Dent(s), Spot repair

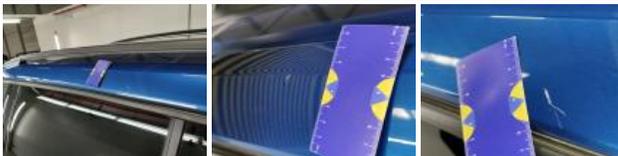

Door RL, Scratch(es), Spot repair

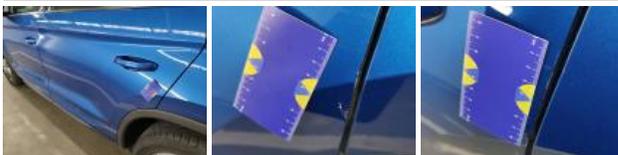


Wing RL, Dent(s) and scratch(es), Repair and paint (complete)




Internal boot lining R, Scratch(es), Smart repair




Internal boot lining L, Scratch(es), Smart repair

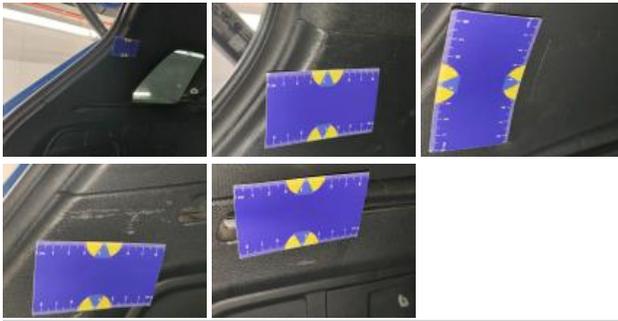

Boot lid covering R, Scratch(es), Replace

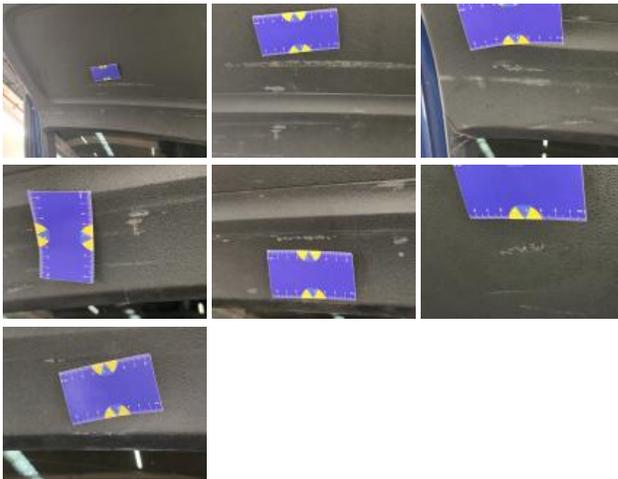

Bumper R, Scratch(es), Repair and paint (complete)

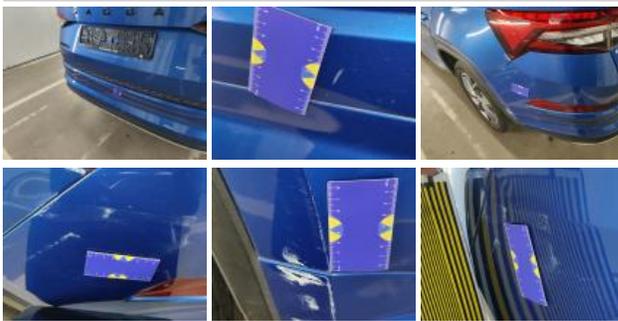

Bumper moulding R, Scratch(es), Replace




Rear light L, Scratch(es), Replace



Tailgate / Boot, Scratch(es), Acceptable



Door FR, Dent(s) and scratch(es), Spot repair

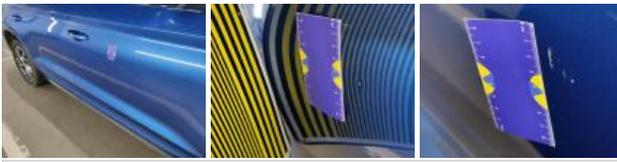

Outside rear-view mirror housing R, Scratch(es), Repair and paint (complete)



Step R, Dent(s) and scratch(es), Spot repair



Door RR, Scratch(es), Spot repair



Wing RR, Bad repair, Repair and paint (complete)



Bodywork, No damage, Acceptable



Roof, Chemical pollution, Polish

