



PEUGEOT 508 SW: 2BHA545

Vinnumber:	VR3F4DGZTMY538172	Versionname:	508 SW 1.6 Hybrid 225 e-EAT8 Allure Pack (PHEV)
First Registrationdate:	23/11/2021	Fiscalpower:	165kW/225pk 5D/P Auto-8
Expertise Mileage:	65620	Power Kw:	
Bodytype:		Body colour:	Dark Blue
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	PP09
Fueltype:	Hybrid Petrol		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total:	2	Radio	
Number keys remote:	2	Front parking sensors	
Windows electric F:		Rear parking sensors	
Windows electric R:			
Cruise Control:			
Steering wheel multifunctional:			
Navigation with screen:			
Airco electronic:			
Rims alloy:			

Limited Technical Inspection

Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Clutch test:	OK
Exhaust gass:	OK	Transmission:	OK

Tyres

215/55/17/98 W			
Summer tyres:	Fr.L.	Vredestein: 2 mm	Fr.R. Vredestein: 2 mm
	Re.L.	Vredestein: 3 mm	Re.R. Vredestein: 3 mm
Tyre profile depth FL			2.0
Tyre profile depth FR			2.0
Tyre profile depth RL			3.0
Tyre profile depth RR			3.0
Tyre size FL			215/55 R 17 98 W
Tyre size FR			215/55 R 17 98 W
Tyre size RL			215/55 R 17 98 W
Tyre size RR			215/55 R 17 98 W
Tyre type FL			All seasons
Tyre type FR			All Seasons
Tyre type RL			All seasons
Tyre type RR			All Seasons
Tyre make FL			2480
Tyre make FR			2480
Tyre make RL			2480
Tyre make RR			2480

Assistance equipment

Repair kit:	Yes	Compressor:	Yes
Number of charging cables (normal):	1		
Number of charging cables (rapid charge):	1		


Instrument panel, complete, Not functioning (well), Acceptable




Interior, Stain, Acceptable



Bumper F, Scratch(es), Acceptable

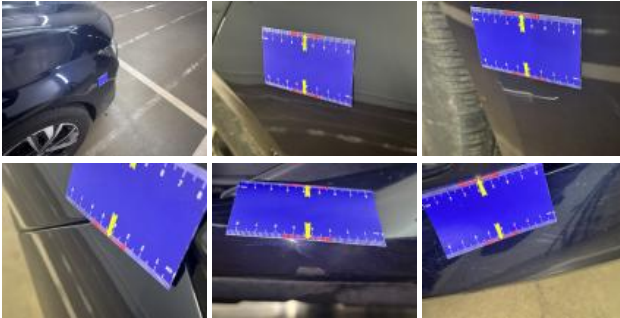


Bonnet, Dent(s) and scratch(es), Spot repair

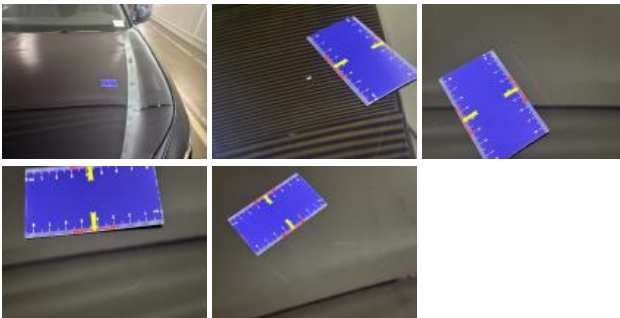

Wing FL, Scratch(es), Acceptable




Door FL, Scratch(es), Acceptable

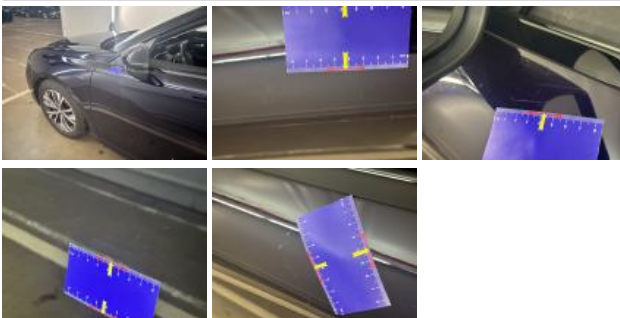


Door RL, Dent(s) and scratch(es), Spot repair



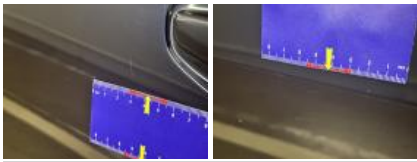

Wing RL, Scratch(es), Acceptable

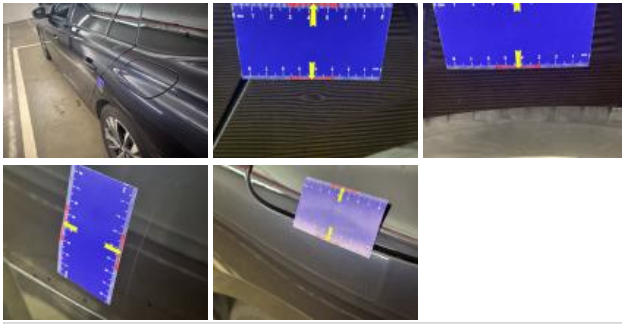


Alloy rim RL polished, Scratch(es), Acceptable




Alloy rim FL polished, Scratch(es), Acceptable



Roof pillar L, Scratch(es), Polish

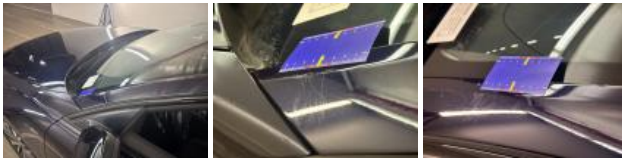


Sill trim L, Scratch(es), Spot repair

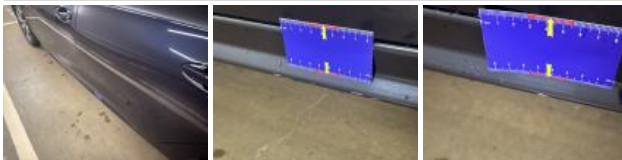


Boot lid covering R, Scratch(es), Replace




Bumper R, Scratch(es), Spot repair

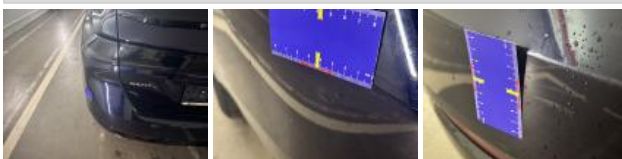


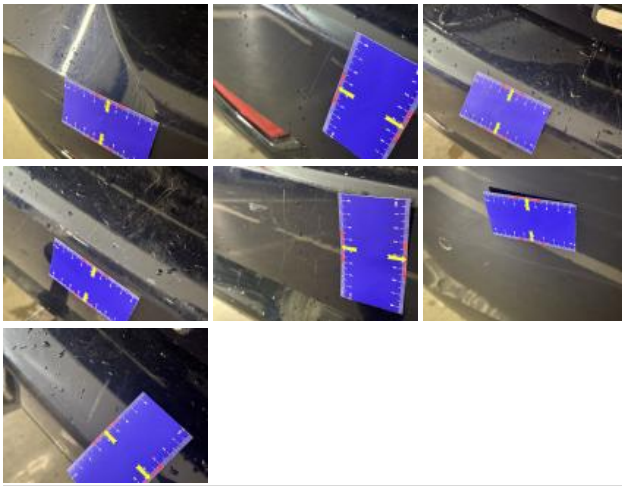


Boot moulding, Scratch(es), Acceptable

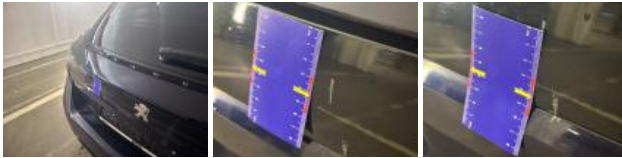


Tailgate / Boot, Scratch(es), Polish

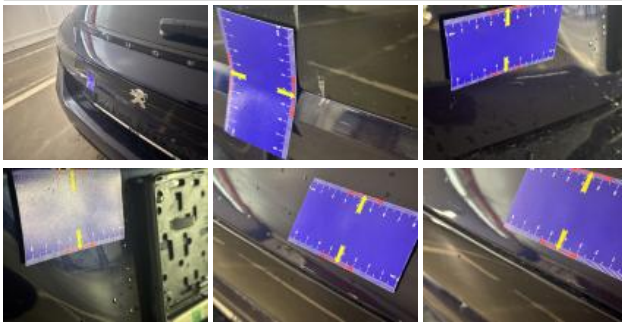

Rear window, Scratch(es), Polish

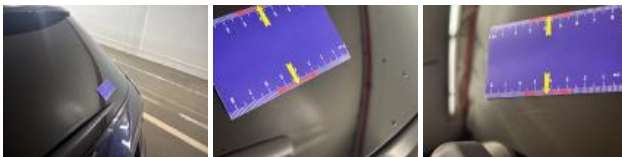


Rear spoiler, Dent(s), Paintless dent repair

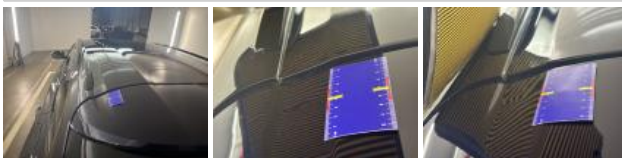


Internal boot lining L, Scratch(es), Acceptable




Wing RR, Scratch(es), Polish


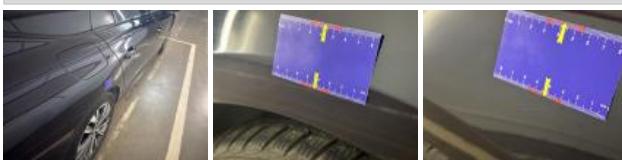


Door FR, Dent(s) and scratch(es), Spot repair

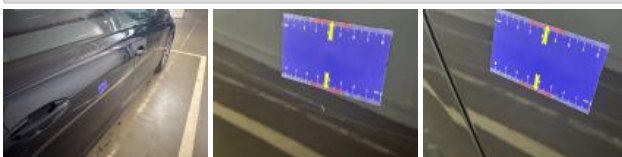

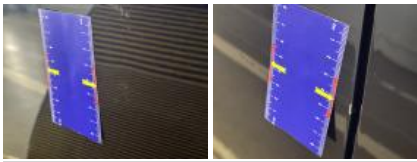



Door FR, Dent(s) and scratch(es), Spot repair

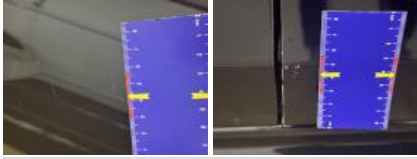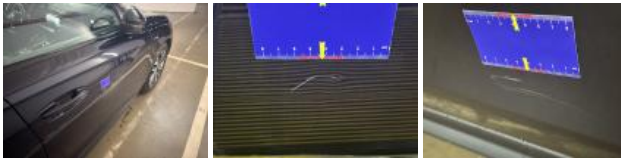


Outside rear-view mirror housing R, Scratch(es), Acceptable




Wing FR, Scratch(es), Polish

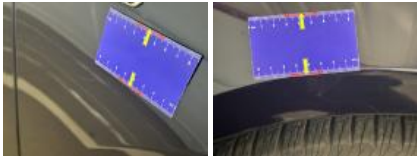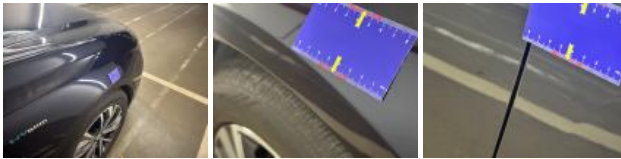

Alloy rim FR polished, Scratch(es), Acceptable

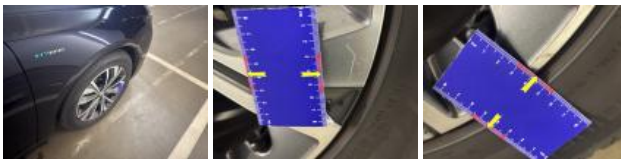

Roof pillar R, Scratch(es), Polish

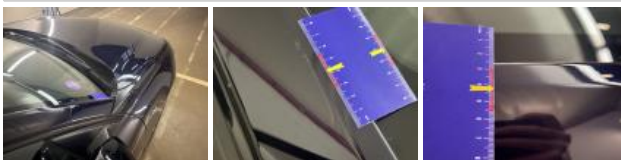

Roof, Hail damage, Paintless dent repair



Bodywork, No damage, Acceptable

