


JEEP Compass: 2AWA859

Vinnnumber:	ZACPJFEW0MPR62341	Versionname:	Compass 1.3 Turbo T4 240 4xe ATX S (PHEV)
First Registrationdate:	11/08/2021	Fiscalpower:	177kW/241pk 5D/P Auto-6
Expertise Mileage:	91142	Power Kw:	
Bodytype:		Body colour:	Blue
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	c222
Fueltype:	Hybrid Petrol		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total	2	Radio	
Number keys remote	2	Lining leather	
Windows electric F		Sun Roof electric	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Fog lights (front)	
Seats F heated			
Navigation with screen			
Airco electronic			
Rims alloy			

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

235/45/18/99 H				
Summer tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 3 mm	Re.R.	Goodyear: 3 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				3.0
Tyre profile depth RR				3.0
Tyre size FL				235/45 R 18 99 H
Tyre size FR				235/45 R 18 99 H
Tyre size RL				235/45 R 18 99 H
Tyre size RR				235/45 R 18 99 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				259
Tyre make FR				259
Tyre make RL				259
Tyre make RR				259

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	1		
Number of charging cables (rapid charge)	1		

Instrument panel, complete, Repaired, Acceptable




Interior covering A pillar L, Bad repair, Check



Engine insulation, Damaged, Replace




Bonnet, Chemical polution, Polish

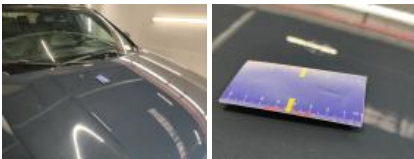


Alloy rim FL, Scratch(es), Acceptable



Door RL, Dent(s) and scratch(es), Spot repair

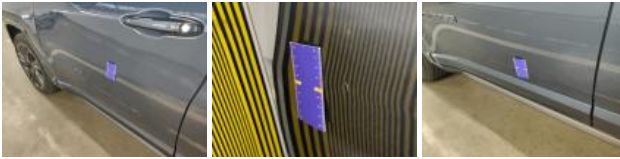

Sill trim L, Scratch(es), Acceptable

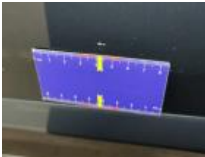

Door RL, Scratch(es), Polish




Step L, Dent(s), Acceptable



Wing RL, Dent(s), Spot repair



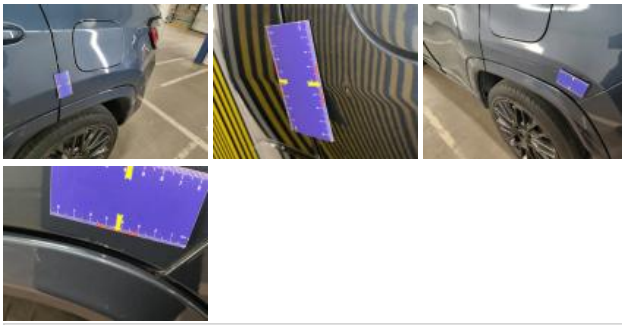

Alloy rim RL, Scratch(es), Repair and paint (complete)



Wing trim RL, Scratch(es), Acceptable



Side window trim RL, Scratch(es), Replace



Rear light R, Scratch(es), Polish



Bumper R, Scratch(es), Acceptable




Alloy rim FR, Scratch(es), Repair and paint (complete)



Door FR, Dent(s) and scratch(es), Spot repair



Door RR, Dent(s) and scratch(es), Spot repair

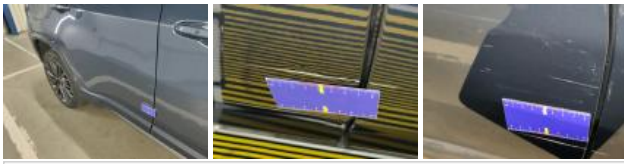

Step R, Dent(s), Acceptable



Wing RR, Scratch(es), Polish



Alloy rim RR, Scratch(es), Repair and paint (complete)



Side window trim RR, Scratch(es), Replace



Bodywork, No damage, Acceptable



Panoramic roof, Chemical pollution, Acceptable

