



FIAT 500e: 2DAY464

Vinnumber:	ZFAEFAJ40NX107731	Versionname:	500e 500e 42 kWh Icon 87kW/118pk 2D/P Auto-1 - WLTP onvolledig
First Registrationdate:	19/01/2023	Fiscalpower:	
Expertise Mileage:	22833	Power Kw:	
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	a117
Fueltype:	Electric		
Number of doors:	2		
Number of seats:	4		
Number head rests:	4		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Dirty		

Options

Number of keys total	2	Radio
Number keys remote	2	Sun Roof electric
Windows electric F		Front parking sensors
Cruise Control		Rear parking sensors
Steering wheel multifunctional		
Seats F heated		
Navigation with screen		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

195/55/16/87 H			
Winter tyres:	Fr.L. Dunlop: 4 mm	Fr.R. Dunlop: 4 mm	
	Re.L. Dunlop: 4 mm	Re.R. Dunlop: 4 mm	
Tyre profile depth FL			4.0
Tyre profile depth FR			4.0
Tyre profile depth RL			4.0
Tyre profile depth RR			4.0
Tyre size FL			195/55 R 16 87 H
Tyre size FR			195/55 R 16 87 H
Tyre size RL			195/55 R 16 87 H
Tyre size RR			195/55 R 16 87 H
Tyre type FL			Winter
Tyre type FR			Winter
Tyre type RL			Winter
Tyre type RR			Winter
Tyre make FL			257
Tyre make FR			257
Tyre make RL			257
Tyre make RR			257

Assistance equipment


Number of charging cables (normal)	1	Compressor	No
Number of charging cables (rapid charge)	1		



Interior, Dirty, Cleaning



Bumper F, Scratch(es), Repair and paint (complete)

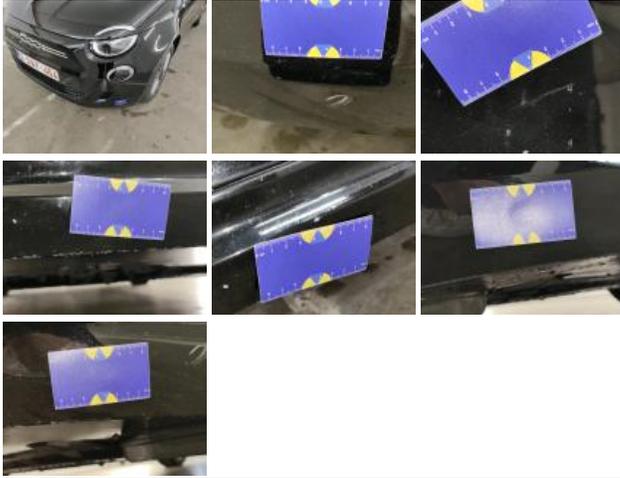

Outside rear-view mirror housing L, Scratch(es), Repair and paint (complete)



Door FL, Dent(s), Acceptable



Sill trim L, Crack, Replace and paint




Wing RL, Dent(s) and scratch(es), Repair and paint (complete)



Compressor, Missing, Replace



Tailgate / Boot, Scratch(es), Polish

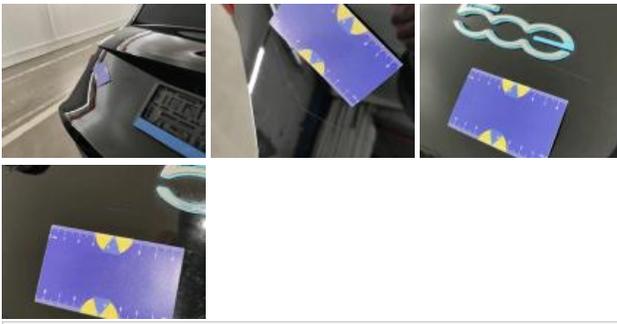

Rear light R, Scratch(es), Polish




Bumper R, Broken, Replace and paint



Alloy rim RR, Scratch(es), Acceptable



Wing RR, Bad repair, Repair and paint (complete)

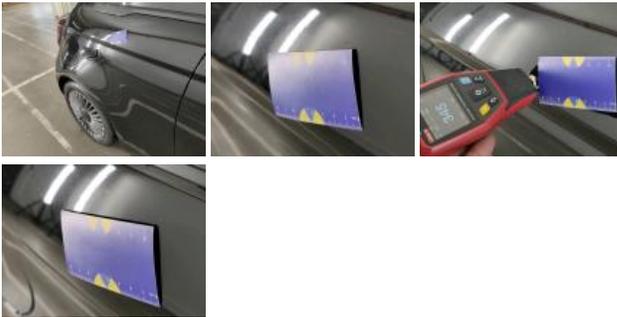

Bodywork, No damage, Acceptable

