

MACADAM



MERCEDES A-Klasse Limousine: 2BND587

Vinnnumber:	W1K1771101J343473	Versionname:	Classe A Limousine A 180d Business Solution
First Registrationdate:	21/01/2022	Fiscalpower:	85kW/116pk 4D/P Auto-8
Expertise Mileage:	143100	Power Kw:	
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	a419
Fueltype:	Diesel		
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total:	2	Radio
Number keys remote:	2	Front parking sensors
Windows electric F:		Rear parking sensors
Windows electric R:		
Cruise Control:		
Steering wheel multifunctional:		
Seats F heated:		
Alarm:		
Navigation with screen:		
Airco electronic:		
Rims alloy:		

Limited Technical Inspection

Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Clutch test:	OK
Exhaust gass:	OK	Transmission:	OK

Tyres

205/60/16/92 H				
Winter tyres:	Fr.L.	Bridgestone: 2 mm	Fr.R.	Bridgestone: 2 mm
	Re.L.	Bridgestone: 3 mm	Re.R.	Bridgestone: 3 mm
Tyre profile depth FL				2.0
Tyre profile depth FR				2.0
Tyre profile depth RL				3.0
Tyre profile depth RR				3.0
Tyre size FL				205/60 R 16 92 H
Tyre size FR				205/60 R 16 92 H
Tyre size RL				205/60 R 16 92 H
Tyre size RR				205/60 R 16 92 H
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				255
Tyre make FR				255
Tyre make RL				255
Tyre make RR				255

Assistance equipment

Repair kit:	Yes	Compressor:	Yes
Number of charging cables (normal):	0		

Seat cover RL, Stain, Cleaning




Instrument panel, complete, Repaired, Acceptable




Door panel FR, Scratch(es), Acceptable



Bonnet, Dent(s) and scratch(es), Repair and paint (complete)

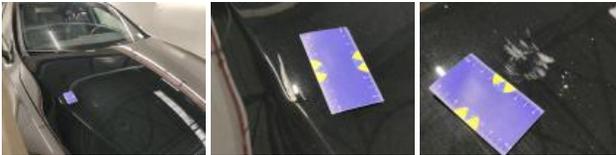

Windscreen, Scratch(es), Replace

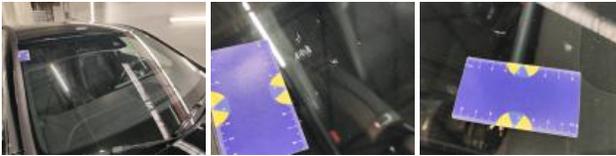

Headlight R, Scratch(es), Replace



Brand badge F, Deformed / Strained, Replace



Bumper F, Scratch(es), Spot repair




Door RL, Dent(s) and scratch(es), Acceptable




Door FL, Scratch(es), Spot repair



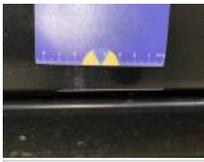

Wing FL, Scratch(es), Polish

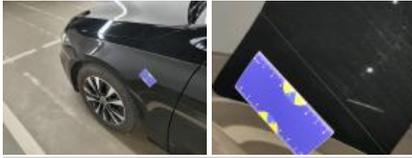

Tyre FL, Worn, Acceptable




Central pillar L, Dent(s), Acceptable



Outer door handle RL, Scratch(es), Acceptable



Roof pillar L, Scratch(es), Polish

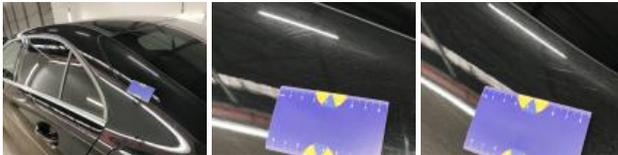


Wheel aperture RL, Dent(s) and scratch(es), Acceptable



Bumper R, Dent(s) and scratch(es), Repair and paint (complete)



Wheel aperture RR, Dent(s) and scratch(es), Acceptable

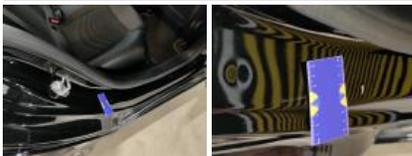


Tailgate / Boot, Scratch(es), Polish




Outside rear-view mirror housing R, Scratch(es), Repair and paint (complete)



Wing RR, Dent(s) and scratch(es), Acceptable

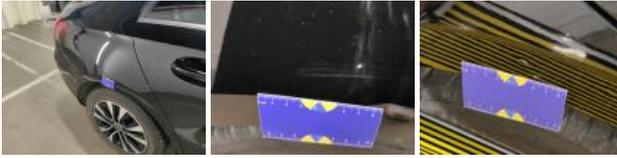

Door RR, Scratch(es), Acceptable

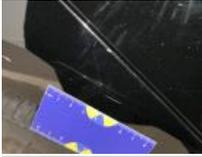

Door FR, Scratch(es), Acceptable



Outer door handle RR, Scratch(es), Acceptable



Roof pillar R, Dent(s), Paintless dent repair



Outer door handle FR, Scratch(es), Acceptable



Tyre FR, Worn, Acceptable



Bodywork, No damage, Acceptable



Roof, Scratch(es), Polish



