



MERCEDES A-Klasse: 2CQG559			
Vinnumber:	W1K3F8GB1PV152616	Versionname:	A-Klasse A 250 e Luxury Line (PHEV) 160kW/218pk
First Registrationdate:	17/10/2022	Fiscalpower:	5D/P Auto-7
Expertise Mileage:	161618	Power Kw:	
Bodytype:		Body colour	Black
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:	Front	Parking lot	c403
Fueltype:	Hybrid Petrol		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Clean		

Options	
Number of keys total	2
Number keys remote	2
Windows electric F	Radio
Windows electric R	Lining leather
Cruise Control	Sun Roof electric
Steering wheel multifunctional	Front parking sensors
Seats F heated	Rear parking sensors
Alarm	
Navigation with screen	
Airco electronic	
Rims alloy	

Limited Technical Inspection			
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres			
205/55/17/91 V			
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.
	Re.L.	Continental: 4 mm	Re.R.
Tyre profile depth FL			4.0
Tyre profile depth FR			4.0
Tyre profile depth RL			4.0
Tyre profile depth RR			4.0
Tyre size FL			205/55 R 17 91 V
Tyre size FR			205/55 R 17 91 V
Tyre size RL			205/55 R 17 91 V
Tyre size RR			205/55 R 17 91 V
Tyre type FL			Summer
Tyre type FR			Summer
Tyre type RL			Summer
Tyre type RR			Summer
Tyre make FL			256
Tyre make FR			260
Tyre make RL			256
Tyre make RR			260

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	1		

Instrument panel, complete, Repaired, Acceptable



Backrest cover FL, Worn, Acceptable



Interior, Not original part, Check



Bumper F, Dent(s) and scratch(es), Repair and paint (complete)



Wing FL, Bad repair, Repair and paint (complete)



Door FL, Dent(s), Paintless dent repair



Central pillar L, Dent(s), Spot repair



Outer door handle RL, Scratch(es), Polish



Step L, Dent(s), Acceptable




Wing RL, Scratch(es), Polish



Alloy rim RL polished, Scratch(es), Polish



Tailgate / Boot, Dent(s), Paintless dent repair

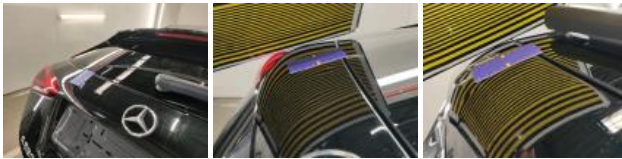


Rear light R, Crack, Replace




Bumper R, Scratch(es), Spot repair




Sill trim R, Dent(s) and scratch(es), Repair and paint (complete)

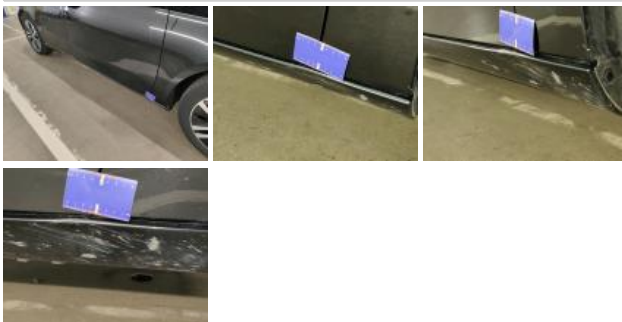

Roof pillar R, Dent(s), Acceptable

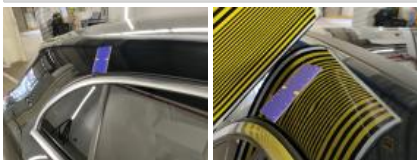

Step R, Dent(s), Acceptable

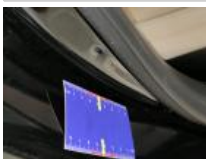

Wing RR, Dent(s), Acceptable



Bodywork, No damage, Check

