



SEAT Leon: 2CDX918

Vinnumber:	VSSZZKLZNR056059	Versionname:	Leon 1.0 eTSI 110 Move! DSG (Mild Hybrid)
First Registrationdate:	17/06/2022	Fiscalpower:	81kW/110pk 5D/P Auto-7
Expertise Mileage:	82416	Power Kw:	81
Bodytype:	Automatic	Body colour:	Black
Gearbox:	Front	Type of rims (mounted):	Aluminium
Transmission:	Petrol	Parking lot:	c404
Fueltype:	Aluminium		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total	2	Radio
Number keys remote	2	Front parking sensors
GPS storage		Rear parking sensors
GPS storage	HD	Fog lights (front)
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Navigation with screen		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Transmission	OK
Exhaust gass	OK		

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	205 / 55 / 16 / 91 / W / Aluminium	5,0 mm	Bridgestone	Summer
	Right	205 / 55 / 16 / 91 / W / Aluminium	5,0 mm	Bridgestone	Summer
Rear	Left	205 / 55 / 16 / 91 / W / Aluminium	5,0 mm	Bridgestone	Summer
	Right	205 / 55 / 16 / 91 / W / Aluminium	5,0 mm	Bridgestone	Summer

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Instrument panel, complete, Repaired, Acceptable



Ignition key, Not functioning (well), Acceptable



Bumper spoiler F, Scratch(es), Acceptable



Grille, Scratch(es), Acceptable




Bumper F, Scratch(es), Polish



Central pillar L, Dent(s) and scratch(es), Acceptable




Alloy rim FL, Scratch(es), Acceptable

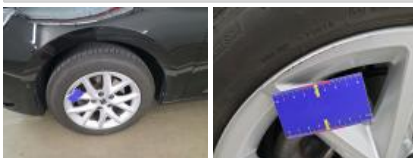


Door FL, Dent(s), Paintless dent repair



Door RL, Dent(s) and scratch(es), Spot repair

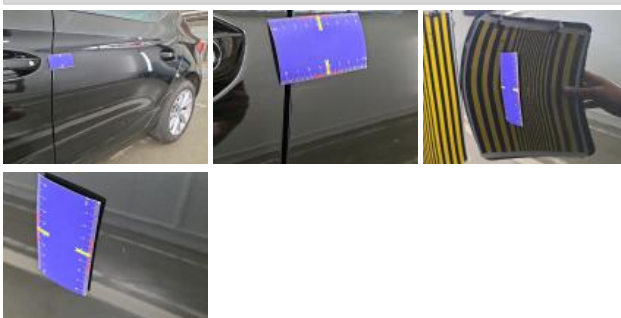


Wing RL, Dent(s), Spot repair

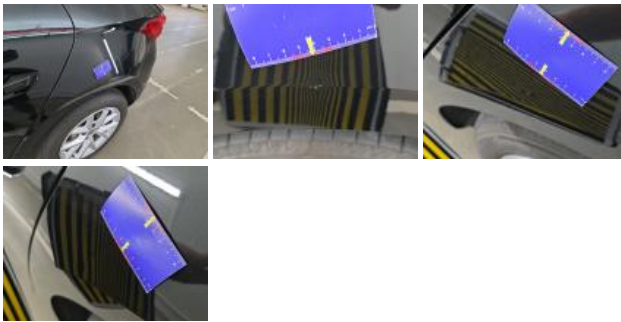

Alloy rim FL, Scratch(es), Repair and paint (complete)



Boot lid covering R, Scratch(es), Smart repair

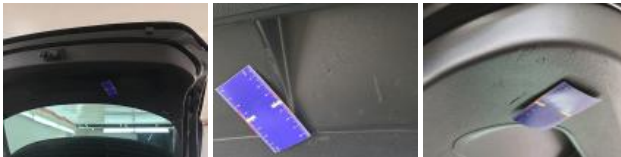


Tailgate / Boot, Dent(s), Spot repair



Bumper R, Scratch(es), Acceptable



Wing RR, Dent(s), Spot repair

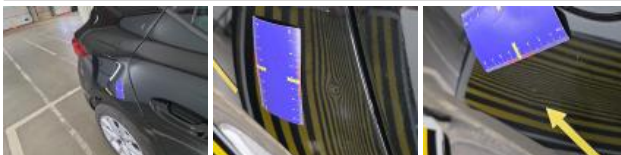


Alloy rim RR, Scratch(es), Repair and paint (complete)




Door RR, Scratch(es), Polish



Outside rear-view mirror housing R, Bad repair, Repair and paint (complete)

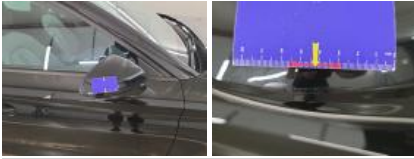

Alloy rim FR, Scratch(es), Acceptable

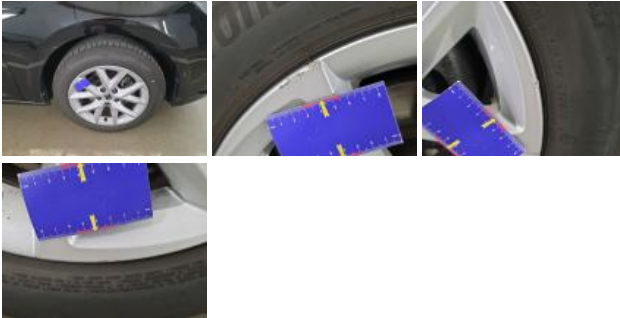

Bodywork, No damage, Acceptable

