


**SKODA Karoq: 2DTJ227**

Vinnnumber:	<b>TMBJR7NU9PC225167</b>	Versionname:	<b>Karoq 1.5 TSI DSG7 Clever 110kW/150pk 5D/P Auto-7 (4 seizoenen Banden) - CO2 indicatief</b>
First Registrationdate:	<b>20/06/2023</b>	Fiscalpower:	
Expertise Mileage:	<b>70262</b>	Power Kw:	
Bodytype:		Body colour:	<b>Black</b>
Gearbox:	<b>Automatic</b>	Type of rims (mounted):	<b>Aluminium</b>
Transmission:	<b>Front</b>	Parking lot:	<b>c403</b>
Fueltype:	<b>Petrol</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Type of rims (mounted):	<b>Aluminium</b>		
Certificate of Conformity:	<b>Yes</b>		
Category:	<b>Passenger Car</b>		
Registration Certificate Car (BE):	<b>Yes</b>		
Bodywork:	<b>Clean</b>		
Interior:	<b>Clean</b>		

**Options**

Number of keys total:	<b>2</b>	Radio
Number keys remote:	<b>2</b>	Rear parking sensors
GPS storage:		Fog lights (front)
GPS storage:	<b>HD</b>	
Windows electric F:		
Windows electric R:		
Cruise Control:		
Steering wheel multifunctional:		
Navigation with screen:		
Airco electronic:		
Rims alloy:		

**Limited Technical Inspection**

Idle position:	<b>OK</b>	Sound engine:	<b>OK</b>
Engine startingtime:	<b>OK</b>	Transmission:	<b>OK</b>
Exhaust gass:	<b>OK</b>		

**Tyres**

<b>215/60/16/99 V</b>				
Summer tyres:	Fr.L.	<b>Vredestein: 5 mm</b>	Fr.R.	<b>Vredestein: 5 mm</b>
	Re.L.	<b>Hankook: 4 mm</b>	Re.R.	<b>Hankook: 4 mm</b>
Tyre profile depth FL:				<b>5.0</b>
Tyre profile depth FR:				<b>5.0</b>
Tyre profile depth RL:				<b>4.0</b>
Tyre profile depth RR:				<b>4.0</b>
Tyre size FL:				<b>215/60 R 16 99 V</b>
Tyre size FR:				<b>215/60 R 16 99 V</b>
Tyre size RL:				<b>215/60 R 16 99 V</b>
Tyre size RR:				<b>215/60 R 16 99 V</b>
Tyre type FL:				<b>All seasons</b>
Tyre type FR:				<b>All Seasons</b>
Tyre type RL:				<b>All seasons</b>
Tyre type RR:				<b>All Seasons</b>
Tyre make FL:				<b>2480</b>
Tyre make FR:				<b>2480</b>
Tyre make RL:				<b>260</b>
Tyre make RR:				<b>260</b>

**Assistance equipment**

Repair kit:	<b>Yes</b>	Compressor:	<b>Yes</b>
Number of charging cables (normal):	<b>0</b>		

Instrument panel, complete, Repaired, Acceptable




Door panel RL, Scratch(es), Smart repair



Bumper F, Dent(s) and scratch(es), Spot repair



Bonnet, Scratch(es), Repair and paint (complete)

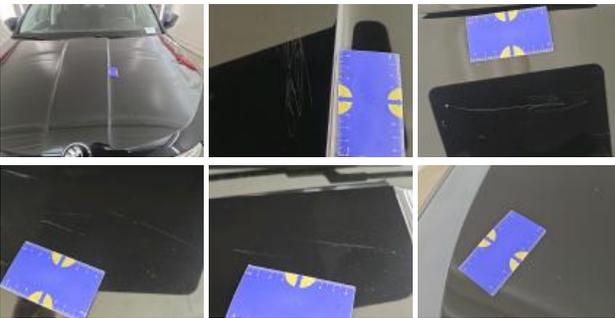

Windscreen, Repaired, Acceptable




Bumper moulding F, Scratch(es), Replace




Door FL, Scratch(es), Acceptable



Door RL, Dent(s) and scratch(es), Spot repair

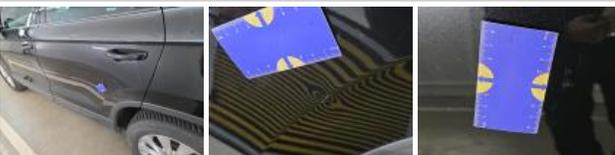


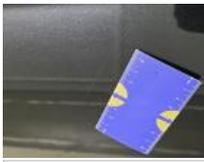

Wing RL, Scratch(es), Polish



Bumper R, Scratch(es), Polish

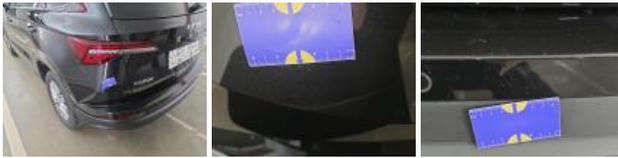


Bumper trim R, Scratch(es), Smart repair



Wing RR, Scratch(es), Polish



Door RR, Dent(s) and scratch(es), Spot repair

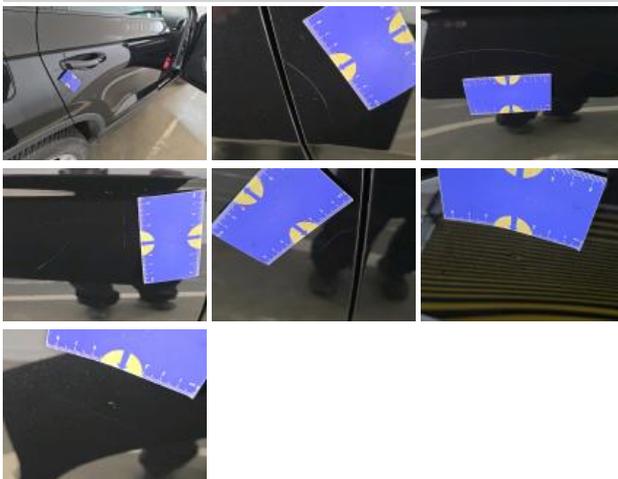

Bodywork, No damage, Acceptable



Roof, Dent(s), Acceptable

