



TOYOTA Yaris Cross: 2CWA433

Vinnnummer:	JTDKBABB40A091811	Versionname:	Yaris Cross 1.5 VVT-ie Hybrid Elegant CVT (Active Hybrid) 85kW/116pk 5D/P Auto-V - CO2 onvolledig
First Registrationdate:	16/12/2022	Fiscalpower:	
Expertise Mileage:	54035	Power Kw:	68
Bodytype:		Body colour:	Blue
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	d306
Fueltype:	Hybrid Petrol		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Dirty		

Options

Number of keys total:	2	Radio:	
Number keys remote:	2	Front parking sensors:	
GPS storage:	HD	Rear parking sensors:	
Windows electric F:		Fog lights (front):	
Windows electric R:			
Cruise Control:			
Steering wheel multifunctional:			
Seats F heated:			
Navigation with screen:			
Airco electronic:			
Rims alloy:			

Limited Technical Inspection

Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Clutch test:	OK
Exhaust gass:	OK	Transmission:	OK

Tyres

215/50/18/92 V				
Winter tyres:	Fr.L.	BF Goodrich: 5 mm	Fr.R.	BF Goodrich: 5 mm
	Re.L.	Firestone: 6 mm	Re.R.	Firestone: 6 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				6.0
Tyre profile depth RR				6.0
Tyre size FL				215/50 R 18 92 V
Tyre size FR				215/50 R 18 92 V
Tyre size RL				215/50 R 18 92 V
Tyre size RR				215/50 R 18 92 V
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				2485
Tyre make FR				2485
Tyre make RL				258
Tyre make RR				258

Assistance equipment

Repair kit:	Yes	Compressor:	No
Number of charging cables (normal):	0		

Interior, Dirty, Cleaning



Instrument panel, complete, Repaired, Acceptable




Seat cover R, Deformed / Strained, Check



Bumper F, Dent(s) and scratch(es), Spot repair



Bonnet, Dent(s), Acceptable

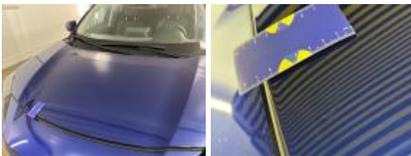

Alloy rim RL polished, Scratch(es), Polish



Step L, Dent(s), Acceptable



Door FL, Dent(s), Acceptable



Compressor, Missing, Replace



Bumper R, Dent(s) and scratch(es), Spot repair



Bumper trim R, Scratch(es), Smart repair



Bumper moulding R, Bad repair, Replace




Boot moulding, Dent(s), Replace



Boot moulding, Dent(s), Replace



Rear spoiler, Dent(s), Acceptable

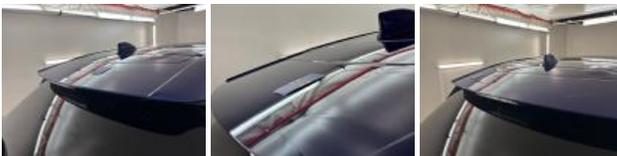


Alloy rim FR polished, Scratch(es), Acceptable



Outside rear-view mirror housing R, Scratch(es), Acceptable



Door FR, Scratch(es), Acceptable

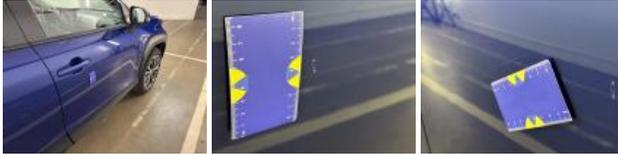

Wing trim RR, Scratch(es), Replace



Roof, Dent(s), Acceptable



Bodywork, No damage, Acceptable

