


MERCEDES A-Klasse Limousine: 2BRM165

Vinnnumber:	W1K1770861N277416	Versionname:	A-Klasse Limousine A 250e Business Solution (PHEV) 160kW/218pk 4D/P Auto-8
First Registrationdate:	24/02/2022	Fiscalpower:	
Expertise Mileage:	11938	Power Kw:	
Bodytype:		Body colour:	Blue
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	c212
Fueltype:	Hybrid Petrol		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total:	2	Radio
Number keys remote:	2	Front parking sensors
GPS storage:		Rear parking sensors
GPS storage:	HD	
Windows electric F:		
Windows electric R:		
Cruise Control:		
Steering wheel multifunctional:		
Seats F heated:		
Navigation with screen:		
Airco electronic:		
Rims alloy:		

Limited Technical Inspection

Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Transmission:	OK
Exhaust gass:	OK		

Tyres

205/55/17/95 V				
Winter tyres:	Fr.L.	Dunlop: 6 mm	Fr.R.	Dunlop: 6 mm
	Re.L.	Firestone: 6 mm	Re.R.	Firestone: 6 mm
Tyre profile depth FL:				6.0
Tyre profile depth FR:				6.0
Tyre profile depth RL:				6.0
Tyre profile depth RR:				6.0
Tyre size FL:				205/55 R 17 95 V
Tyre size FR:				205/55 R 17 95 V
Tyre size RL:				205/55 R 17 95 V
Tyre size RR:				205/55 R 17 95 V
Tyre type FL:				Winter
Tyre type FR:				Winter
Tyre type RL:				Winter
Tyre type RR:				Winter
Tyre make FL:				257
Tyre make FR:				257
Tyre make RL:				258
Tyre make RR:				258


Assistance equipment

Emergency spare wheel:	Yes
------------------------	------------

Repair kit
Number of charging cables (normal)
Number of charging cables (rapid charge)

Yes
1
1

Instrument panel, complete, Repaired, Acceptable

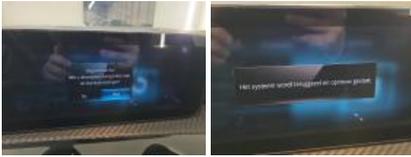

Bumper F, Dent(s) and scratch(es), Repair and paint (complete)




Wing RL, Scratch(es), Acceptable



Door RL, Scratch(es), Polish



Door FL, Dent(s), Paintless dent repair

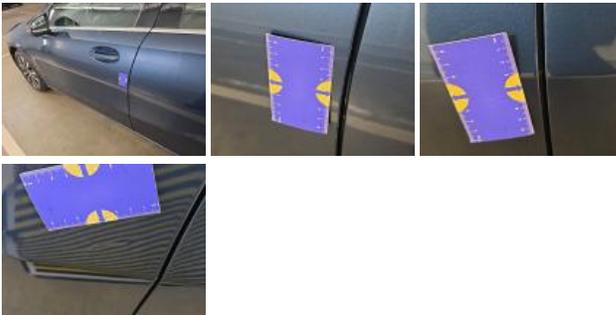


Alloy rim FL polished, Chemical polution, Polish




Bumper R, Dent(s) and scratch(es), Repair and paint (complete)




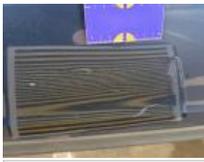

Tailgate / Boot, Scratch(es), Acceptable

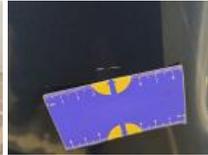

Wing RR, Scratch(es), Polish

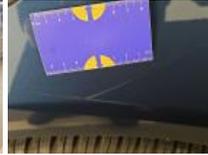


Door RR, Scratch(es), Acceptable



Outside rear-view mirror housing R, Scratch(es), Repair and paint (complete)



Door FR, Scratch(es), Acceptable

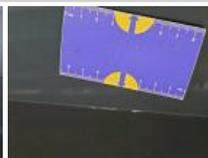

Alloy rim FR polished, Scratch(es), Repair and paint (complete)



Bodywork, No damage, Acceptable



Fuel cap cover, Broken, Replace

