



MERCEDES A-Klasse Limousine: 1YAR590

Vinnnumber:	W1K1771031J236331	Versionname:	A-Klasse Limousine A 180 d DCT Business Solution
First Registrationdate:	1/07/2020	Fiscalpower:	85kW/116pk 4D/P Auto-7
Expertise Mileage:	66265	Power Kw:	
Bodytype:		Body colour:	Grey
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	d005
Fueltype:	Diesel		
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Dirty		

Options

Number of keys total	2	Radio	
Number keys remote	2	Sun Roof electric	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control			
Steering wheel multifunctional			
Alarm			
Navigation with screen			
Airco electronic			
Rims alloy			

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

205/60/16/92 H				
Winter tyres:	Fr.L.	Michelin: 2 mm	Fr.R.	Michelin: 2 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm
Tyre profile depth FL				2.0
Tyre profile depth FR				2.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				205/60 R 16 92 H
Tyre size FR				205/60 R 16 92 H
Tyre size RL				205/60 R 16 92 H
Tyre size RR				205/60 R 16 92 H
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Instrument panel, complete, Repaired, Acceptable



Interior, Stain, Cleaning




Steering wheel, Worn, Acceptable



Bumper F, Crack, Replace and paint



Bonnet, Dent(s), Acceptable

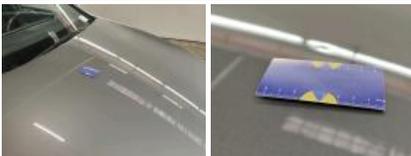

Windscreen moulding, Damaged, Acceptable



Brand badge F, Broken, Replace



Wing FL, Scratch(es), Acceptable




Alloy rim FL polished, Chemical polution, Repair and paint (complete)



Outside rear-view mirror housing L, Scratch(es), Acceptable



Door FL, Scratch(es), Acceptable

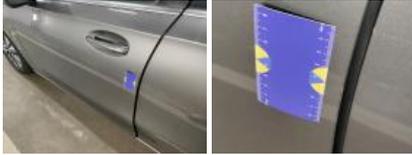

Central pillar L, Dent(s) and scratch(es), Spot repair





Door RL, Dent(s) and scratch(es), Spot repair




Step L, Dent(s) and scratch(es), Spot repair



Wing RL, Scratch(es), Polish

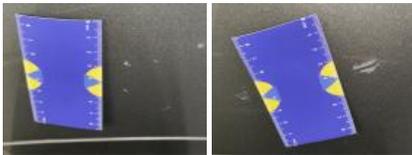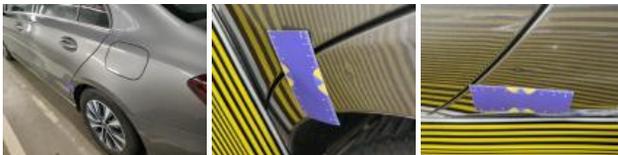

Roof pillar L, Dent(s), Paintless dent repair

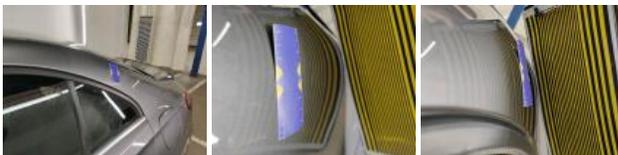

Alloy rim RL polished, Chemical polution, Repair and paint (complete)



Sill trim L, Scratch(es), Spot repair



Bumper R, Scratch(es), Polish



Bumper trim R, Scratch(es), Smart repair



Rear light R, Scratch(es), Polish



Alloy rim FR polished, Scratch(es), Repair and paint (complete)



Wing FR, Dent(s), Repair and paint (complete)




Door FR, Dent(s), Repair and paint (complete)



Mirror side repeater R, Scratch(es), Polish



Door RR, Dent(s), Repair and paint (complete)

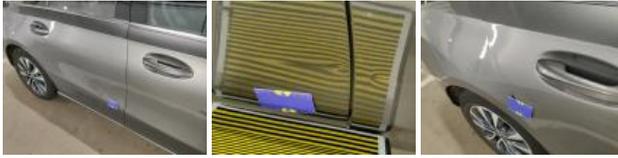

Wing RR, Dent(s), Acceptable




Roof pillar R, Dent(s), Acceptable



Central pillar R, Dent(s) and scratch(es), Spot repair



Step R, Dent(s) and scratch(es), Spot repair

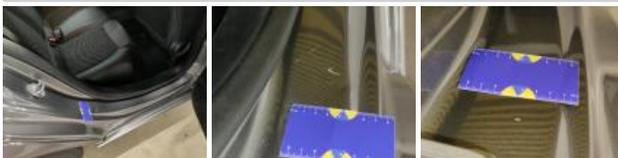

Alloy rim RR polished, Chemical polution, Repair and paint (complete)



Bodywork, No damage, Acceptable

