


MERCEDES CLA Shooting Brake: 2CCW671				
Vinnnumber:	W1K1186121N309421	Versionname:	CLA Shooting Brake CLA 200 d 110kW/150pk 5D/P	
First Registrationdate:	8/06/2022	Fiscalpower:	Auto-8	
Expertise Mileage:	128731	Power Kw:		
Bodytype:		Body colour:	Grey	
Gearbox:	Automatic	Type of rims (mounted):	Aluminium	
Transmission:	Front	Parking lot:	d370	
Fueltype:	Diesel			
Number of doors:	5			
Number of seats:	5			
Number head rests:	5			
Type of rims (mounted):	Aluminium			
Certificate of Conformity:	Yes			
Category:	Passenger Car			
Registration Certificate Car (BE):	Yes			
Bodywork:	Clean			
Interior:	Clean			
Options				
Number of keys total:	2	Radio:		
Number keys remote:	2	Front parking sensors:		
Windows electric F:		Rear parking sensors:		
Windows electric R:				
Cruise Control:				
Steering wheel multifunctional:				
Seats F heated:				
Alarm:				
Navigation with screen:				
Airco electronic:				
Rims alloy:				
Limited Technical Inspection				
Idle position:	OK	Sound engine:	OK	
Engine startingtime:	OK	Clutch test:	OK	
Exhaust gass:	OK	Transmission:	OK	
Tyres				
	225/45/18/95 V			
Winter tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Michelin: 3 mm	Re.R.	Michelin: 3 mm
Tyre profile depth FL:				3.0
Tyre profile depth FR:				3.0
Tyre profile depth RL:				3.0
Tyre profile depth RR:				3.0
Tyre size FL:				225/45 R 18 95 V
Tyre size FR:				225/45 R 18 95 V
Tyre size RL:				225/45 R 18 95 V
Tyre size RR:				225/45 R 18 95 V
Tyre type FL:				Winter
Tyre type FR:				Winter
Tyre type RL:				Winter
Tyre type RR:				Winter
Tyre make FL:				261
Tyre make FR:				261
Tyre make RL:				261
Tyre make RR:				261
Assistance equipment				
Repair kit:	Yes	Compressor:		Yes
Number of charging cables (normal):	0			


Interior covering A pillar L, Burned, Replace




Roof liner, Burned, Replace

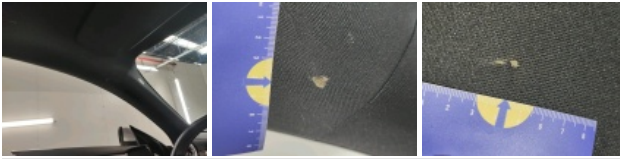

Interior, Smell, Ozone treatment

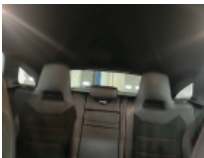

Floor covering FL, Burned, Replace

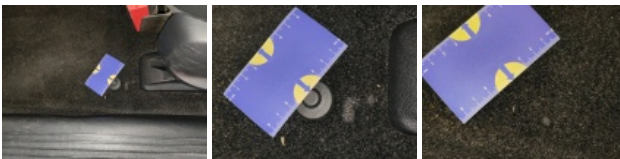

Seat cover FL, Burned, Replace




Backrest cover FR, Scratch(es), Acceptable



Floor covering FR, Burned, Smart repair



Windscreen, Stone chip(s), Windscreen repair

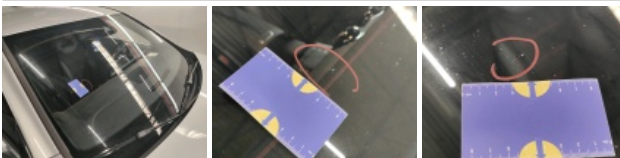

Bumper F, Scratch(es), Repair and paint (complete)






Bumper moulding F, Missing, Replace




Alloy rim RL polished, Scratch(es), Repair and paint (complete)

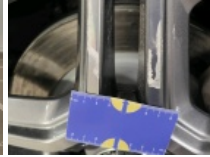

Tyre RL, Tear, Replace



Step L, Dent(s), Acceptable

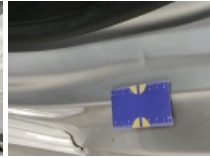

Outer sill L, Scratch(es), Repair and paint (complete)



Step L, Dent(s) and scratch(es), Spot repair



Door FL, Dent(s), Spot repair



Alloy rim FL polished, Scratch(es), Repair and paint (complete)




Luggage compartment cover, Scratch(es), Acceptable



Bumper R, Scratch(es), Repair and paint (complete)



Rear light L, Broken, Replace

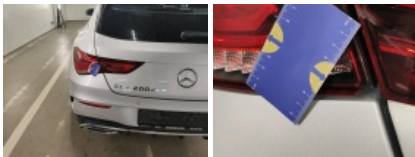

Bumper moulding R, Dent(s), Replace



Alloy rim RR polished, Scratch(es), Repair and paint (complete)



Alloy rim FR polished, Scratch(es), Repair and paint (complete)

