



MERCEDES GLA: 2ASV175

Vinnumber:	W1N2477101J307024	Versionname:	GLA GLA 180 d Business Solution 85kW/116pk 5D/P Auto-8
First Registrationdate:	2/07/2021	Fiscalpower:	
Expertise Mileage:	199529	Power Kw:	
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	b323
Fueltype:	Diesel		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total	2	Radio	
Number keys remote	2	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Alarm			
Navigation with screen			
Airco electronic			
Rims alloy			

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	215 / 65 / 17 / 99 / V / Aluminium	4,0 mm	Vredestein	Summer
	Right	215 / 65 / 17 / 99 / V / Aluminium	4,0 mm	Vredestein	Summer
Rear	Left	215 / 65 / 17 / 99 / V / Aluminium	4,0 mm	Uniroyal	Summer
	Right	215 / 65 / 17 / 99 / V / Aluminium	4,0 mm	Uniroyal	Summer

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		


Roof liner, Stain, Cleaning



Instrument panel, complete, Repaired, Acceptable



Door panel FL, Scratch(es), Acceptable

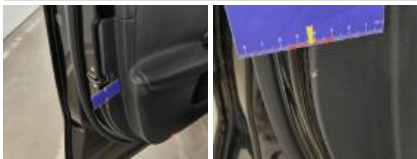

Steering wheel, Worn, Acceptable



Bumper F, Scratch(es), Repair and paint (complete)



Bumper moulding F, Scratch(es), Replace



Bumper moulding F, Scratch(es), Replace




Bumper moulding F, Dent(s) and scratch(es), Replace



Wing RL, Dent(s), Paintless dent repair



Roof pillar L, Dent(s), Acceptable

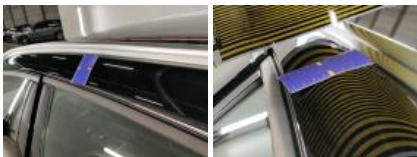

Central pillar L, Dent(s) and scratch(es), Spot repair



Door FL, Scratch(es), Acceptable



Door trim FL, Deformed / Strained, Acceptable



Boot lid covering R, Scratch(es), Replace




Bumper R, Scratch(es), Repair and paint (complete)



Bumper R, Broken, Replace



Tailgate / Boot, Dent(s), Paintless dent repair

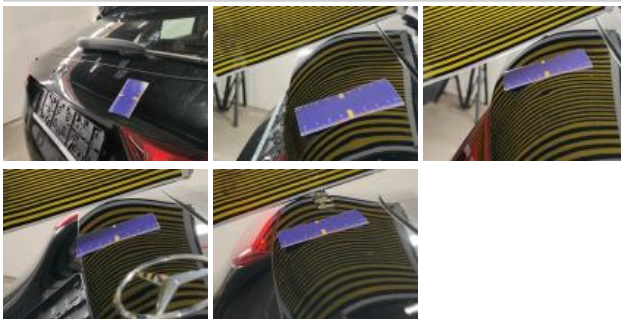

Bumper trim R, Scratch(es), Smart repair




Wing trim RR, Scratch(es), Replace



Door trim RR, Scratch(es), Replace



Alloy rim RR, Scratch(es), Repair and paint (complete)

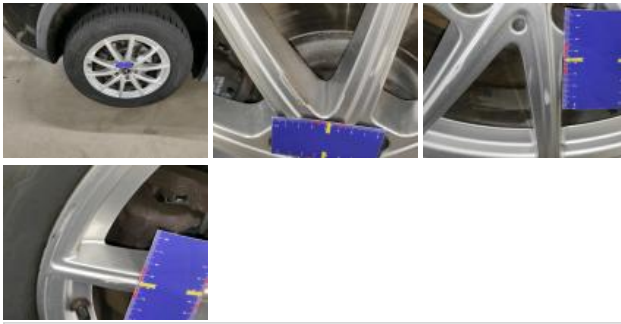


Door RR, Scratch(es), Repair and paint (complete)




Door FR, Scratch(es), Spot repair



Mirror side repeater R, Broken, Replace

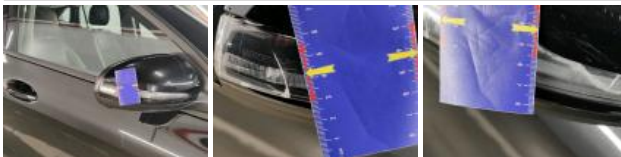


Outside rear-view mirror base R, Broken, Replace

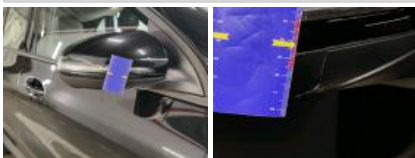

Alloy rim FR, Scratch(es), Repair and paint (complete)



Wing trim FR, Scratch(es), Replace

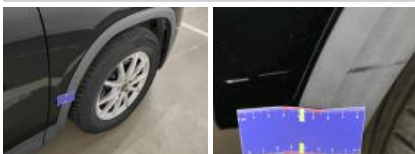

Wing FR, Scratch(es), Polish



Bodywork, Not original part, Remove lettering



Bodywork, No damage, Acceptable

