



MERCEDES CLA: 2BRS105

| | | | |
|------------------------------------|--------------------------|-------------------------|---|
| Vinnnumber: | W1K1183101N285631 | Versionname: | CLA CLA 180 d Business Solution 85kW/116pk 4D/P Auto-8 |
| First Registrationdate: | 28/02/2022 | Fiscalpower: | |
| Expertise Mileage: | 69726 | Power Kw: | |
| Bodytype: | | Body colour: | Black |
| Gearbox: | Automatic | Type of rims (mounted): | Aluminium |
| Transmission: | Front | Parking lot: | a422 |
| Fueltype: | Diesel | | |
| Number of doors: | 4 | | |
| Number of seats: | 5 | | |
| Number head rests: | 5 | | |
| Type of rims (mounted): | Aluminium | | |
| Certificate of Conformity: | Yes | | |
| Category: | Passenger Car | | |
| Registration Certificate Car (BE): | Yes | | |
| Bodywork: | Clean | | |
| Interior: | Clean | | |

Options

| | | | |
|--------------------------------|----------|-----------------------|--|
| Number of keys total | 2 | Radio | |
| Number keys remote | 2 | Lining leather | |
| Windows electric F | | Front parking sensors | |
| Windows electric R | | Rear parking sensors | |
| Cruise Control | | | |
| Steering wheel multifunctional | | | |
| Seats F heated | | | |
| Alarm | | | |
| Navigation with screen | | | |
| Airco electronic | | | |
| Rims alloy | | | |

Limited Technical Inspection

| | | | |
|---------------------|-----------|--------------|-----------|
| Idle position | OK | Sound engine | OK |
| Engine startingtime | OK | Clutch test | OK |
| Exhaust gass | OK | Transmission | OK |

Tyres

| 225/45/17/95 V | | | | |
|-----------------------|-------|-----------------------|-------|-------------------------|
| Winter tyres: | Fr.L. | Michelin: 4 mm | Fr.R. | Michelin: 4 mm |
| | Re.L. | Michelin: 4 mm | Re.R. | Michelin: 4 mm |
| Tyre profile depth FL | | | | 4.0 |
| Tyre profile depth FR | | | | 4.0 |
| Tyre profile depth RL | | | | 4.0 |
| Tyre profile depth RR | | | | 4.0 |
| Tyre size FL | | | | 225/45 R 17 95 V |
| Tyre size FR | | | | 225/45 R 17 95 V |
| Tyre size RL | | | | 225/45 R 17 95 V |
| Tyre size RR | | | | 225/45 R 17 95 V |
| Tyre type FL | | | | Winter |
| Tyre type FR | | | | Winter |
| Tyre type RL | | | | Winter |
| Tyre type RR | | | | Winter |
| Tyre make FL | | | | 261 |
| Tyre make FR | | | | 261 |
| Tyre make RL | | | | 261 |
| Tyre make RR | | | | 261 |

Assistance equipment

| | | | |
|------------------------------------|------------|------------|------------|
| Repair kit | Yes | Compressor | Yes |
| Number of charging cables (normal) | 0 | | |

Instrument panel, complete, Repaired, Acceptable



Instrument panel, complete, Not functioning (well), Check



Door panel RL, Scratch(es), Acceptable




Interior, Smell, Ozone treatment




Bumper F, Scratch(es), Spot repair




Bumper moulding F, Deformed / Strained, Replace

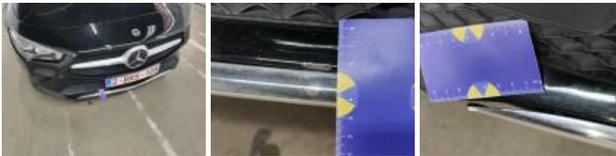

Wing FL, Scratch(es), Polish

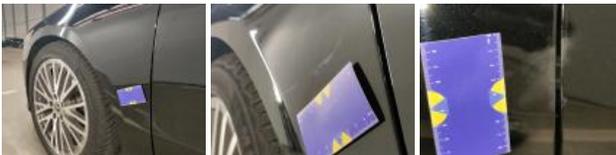


Door FL, Scratch(es), Acceptable

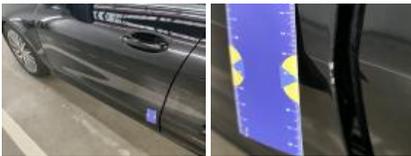

Central pillar L, Dent(s) and scratch(es), Spot repair




Door RL, Dent(s) and scratch(es), Repair and paint (complete)

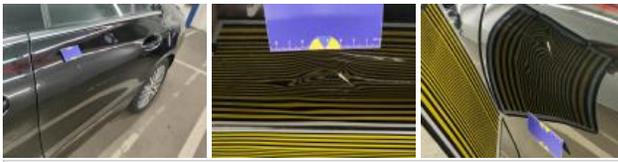


Step L, Dent(s) and scratch(es), Spot repair




Wing RL, Dent(s), Repair and paint (complete)

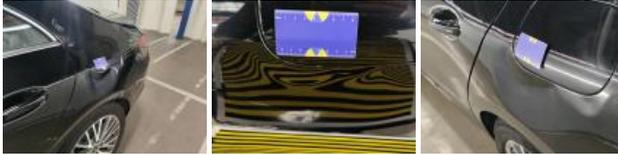

Tailgate / Boot, Scratch(es), Polish

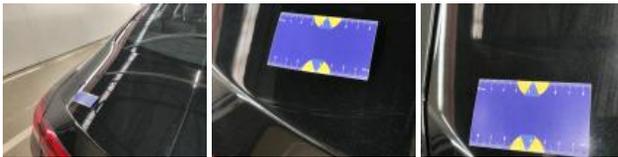

Bumper R, Hole, Replace and paint

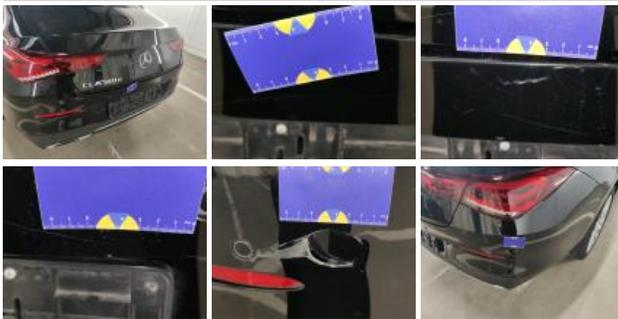

Alloy rim FR polished, Scratch(es), Repair and paint (complete)



Door FR, Scratch(es), Polish



Outside rear-view mirror housing R, Scratch(es), Acceptable



Central pillar R, Dent(s), Acceptable




Door RR, Scratch(es), Spot repair




Step R, Scratch(es), Acceptable



Alloy rim RR polished, Scratch(es), Repair and paint (complete)

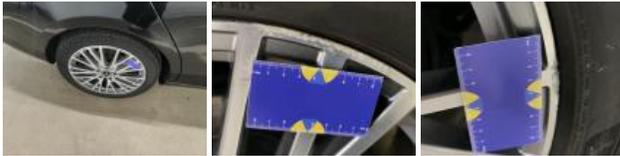

Wing RR, Bad repair, Repair and paint (complete)

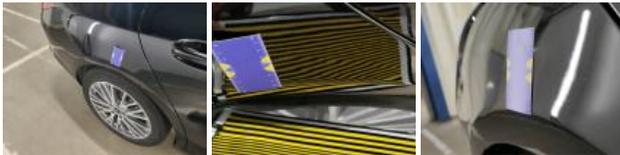

Outer sill R, Scratch(es), Spot repair



Side window trim RR, Deformed / Strained, Replace



Bodywork, No damage, Acceptable



Roof, Chemical polution, Polish

