



OPEL Corsa: 2BGG647

Vinnumber:	VXKUPHNEKM4311327	Versionname:	Corsa 1.2 Turbo S/S Elegance 74kW/100pk 5D/P Man-6
First Registrationdate:	15/11/2021	Fiscalpower:	
Expertise Mileage:	32568	Power Kw:	
Bodytype:		Body colour	Grey
Gearbox:	MAN 6 VIT	Type of rims (mounted)	Aluminium
Transmission:	Front	Parking lot	b208
Fueltype:	Petrol		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Clean		

Options

Number of keys total	2	Radio
Number keys remote	1	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

195/55/16/87 H					
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm	
	Re.L.	Continental: 4 mm	Re.R.	Continental: 4 mm	
Tyre profile depth FL					4.0
Tyre profile depth FR					4.0
Tyre profile depth RL					4.0
Tyre profile depth RR					4.0
Tyre size FL					195/55 R 16 87 H
Tyre size FR					195/55 R 16 87 H
Tyre size RL					195/55 R 16 87 H
Tyre size RR					195/55 R 16 87 H
Tyre type FL					Summer
Tyre type FR					Summer
Tyre type RL					Summer
Tyre type RR					Summer
Tyre make FL					256
Tyre make FR					256
Tyre make RL					256
Tyre make RR					256

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Instrument panel, complete, Not functioning (well), Acceptable



Engine insulation, Missing, Replace




Alloy rim RL, Scratch(es), Repair and paint (complete)



Roof pillar L, Scratch(es), Acceptable




Door RL, Repaired, Acceptable

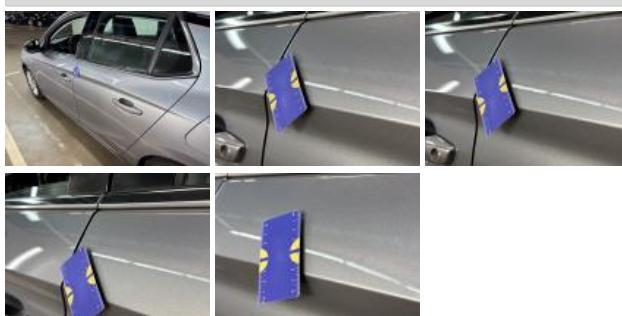

Wing RL, Bad repair, Repair and paint (complete)



Door FL, Repaired, Acceptable

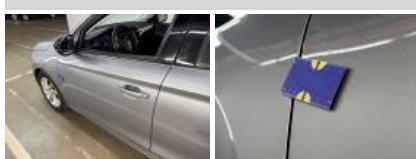

Alloy rim FL, Scratch(es), Acceptable



Tyre FL, Tear, Acceptable



Rear light R, Scratch(es), Polish



Rear light L, Scratch(es), Polish





Alloy rim FR, Scratch(es), Acceptable



Door FR, Scratch(es), Polish



Alloy rim RR, Scratch(es), Acceptable

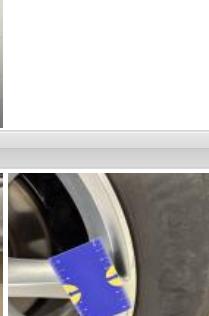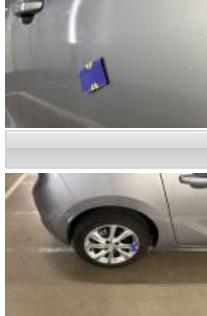

Roof, Scratch(es), Acceptable



Bodywork, No damage, Acceptable

