


OPEL Zafira Life: 2ACZ346

Vinnnumber:	VXEYAYHVMZ026377	Versionname:	Zafira Life 1.5 TD BI 120 S/S L2H1 Edition Std
First Registrationdate:	24/02/2021	Fiscalpower:	88kW/120pk 4D/P Man-6
Expertise Mileage:	162498	Power Kw:	
Bodytype:		Body colour:	Beige
Gearbox:	MAN 6 VIT	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	d150
Fueltype:	Diesel		
Number of doors:	4		
Number of seats:	8		
Number head rests:	8		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Dirty		

Options

Number of keys total	2	Radio
Number keys remote	1	Front parking sensors
GPS storage		Rear parking sensors
GPS storage	HD	Fog lights (front)
Windows electric F		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Navigation with screen		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

	225/55/17/97 H			
Winter tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Uniroyal: 6 mm	Re.R.	Uniroyal: 6 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				6.0
Tyre profile depth RR				6.0
Tyre size FL				225/55 R 17 97 H
Tyre size FR				225/55 R 17 97 H
Tyre size RL				225/55 R 17 97 H
Tyre size RR				225/55 R 17 97 H
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				256
Tyre make FR				256
Tyre make RL				265
Tyre make RR				265

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		

Instrument panel, complete, Repaired, Acceptable



Interior, Stain, Cleaning



Backrest cover FL, Scratch(es), Acceptable



Seat cover RR, Missing, Acceptable



Backrest cover FR, Scratch(es), Acceptable



Seat cover RL, Scratch(es), Acceptable



Bumper F, Scratch(es), Spot repair



Bumper moulding F, Scratch(es), Replace



Alloy rim FL polished, Scratch(es), Acceptable




Outer sill L, Dent(s) and scratch(es), Spot repair



Door FL, Scratch(es), Acceptable



Door trim FL, Scratch(es), Acceptable

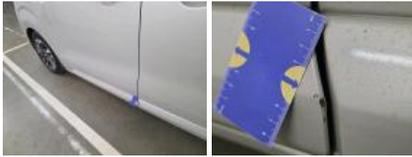

Door RL, Scratch(es), Polish



Alloy rim RL polished, Scratch(es), Acceptable



Internal boot lining L, Scratch(es), Acceptable



Internal boot lining R, Scratch(es), Acceptable




Boot lid covering R, Scratch(es), Acceptable



Tailgate / Boot, Dent(s), Spot repair



Bumper R, Dent(s) and scratch(es), Spot repair

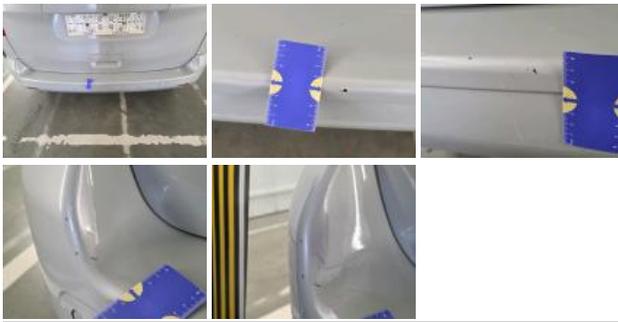


Step R, Dent(s), Acceptable



Door RR, Scratch(es), Acceptable



Alloy rim RR polished, Scratch(es), Repair and paint (complete)

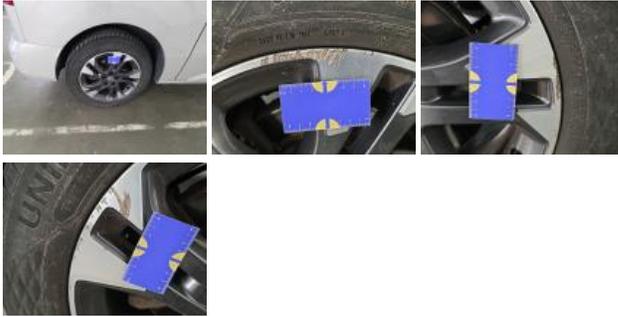


Outside rear-view mirror housing R, Scratch(es), Polish



Wing FR, Dent(s), Acceptable



Wheel arch cover FR, Deformed / Strained, Acceptable

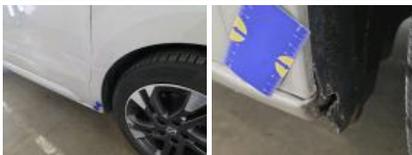

Outer sill R, Dent(s) and scratch(es), Spot repair



Bodywork, Inspection +, Photo complémentaire



Bodywork, No damage, Acceptable



Roof, Scratch(es), Polish

