



**MERCEDES CLA: 2ARN174**

Vinnnumber:	<b>W1K1183841N236281</b>	Versionname:	<b>CLA CLA 180 Business Solution 100kW/136pk 4D/P Man-6</b>
First Registrationdate:	<b>22/06/2021</b>	Fiscalpower:	
Expertise Mileage:	<b>88125</b>	Power Kw:	
Bodytype:		Body colour:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Type of rims (mounted):	<b>Aluminium</b>
Transmission:	<b>Front</b>	Parking lot:	<b>b621</b>
Fueltype:	<b>Petrol</b>		
Number of doors:	<b>4</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Type of rims (mounted):	<b>Aluminium</b>		
Certificate of Conformity:	<b>Yes</b>		
Category:	<b>Passenger Car</b>		
Registration Certificate Car (BE):	<b>Yes</b>		
Bodywork:	<b>Clean</b>		
Interior:	<b>Clean</b>		

**Options**

Number of keys total:	<b>1</b>	Radio
Number keys remote:	<b>1</b>	Lining leather
GPS storage:	<b>HD</b>	Sun Roof electric
Windows electric F:		Front parking sensors
Windows electric R:		Rear parking sensors
Cruise Control:		
Steering wheel multifunctional:		
Seats F heated:		
Alarm:		
Navigation with screen:		
Airco electronic:		
Rims alloy:		

**Limited Technical Inspection**

Idle position:	<b>OK</b>	Sound engine:	<b>OK</b>
Engine startingtime:	<b>OK</b>	Clutch test:	<b>OK</b>
Exhaust gass:	<b>OK</b>	Transmission:	<b>OK</b>

**Tyres**

<b>225/45/18/95 V</b>				
Winter tyres:	Fr.L.	<b>Michelin: 5 mm</b>	Fr.R.	<b>Michelin: 5 mm</b>
	Re.L.	<b>Michelin: 5 mm</b>	Re.R.	<b>Michelin: 5 mm</b>
Tyre profile depth FL:				<b>5.0</b>
Tyre profile depth FR:				<b>5.0</b>
Tyre profile depth RL:				<b>5.0</b>
Tyre profile depth RR:				<b>5.0</b>
Tyre size FL:				<b>225/45 R 18 95 V</b>
Tyre size FR:				<b>225/45 R 18 95 V</b>
Tyre size RL:				<b>225/45 R 18 95 V</b>
Tyre size RR:				<b>225/45 R 18 95 V</b>
Tyre type FL:				<b>Winter</b>
Tyre type FR:				<b>Winter</b>
Tyre type RL:				<b>Winter</b>
Tyre type RR:				<b>Winter</b>
Tyre make FL:				<b>261</b>
Tyre make FR:				<b>261</b>
Tyre make RL:				<b>261</b>
Tyre make RR:				<b>261</b>

**Assistance equipment**

Repair kit:	<b>Yes</b>	Compressor:	<b>Yes</b>
-------------	------------	-------------	------------

Number of charging cables (normal)  
Number of charging cables (rapid charge)

0  
0

Ignition key, Missing, Replace




Instrument panel, complete, Repaired, Acceptable




Steering wheel, Worn, Acceptable




Backrest cover FL, Scratch(es), Smart repair

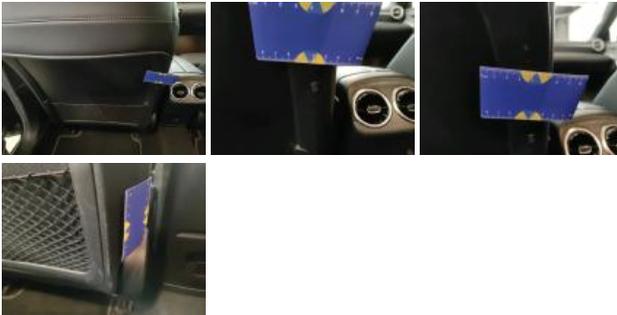

Centre console, Scratch(es), Acceptable

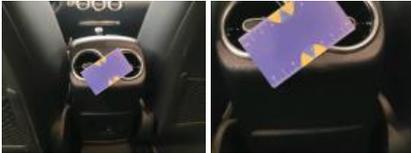

Backrest cover FR, Scratch(es), Acceptable

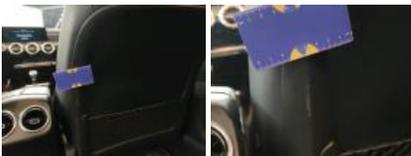

Door panel RR, Scratch(es), Acceptable



Bonnet, Stone chip(s), Repair and paint (complete)



Bumper F, Scratch(es), Spot repair





Alloy rim RL polished, Scratch(es), Repair and paint (complete)



Wing RL, Scratch(es), Polish



Step L, Dent(s) and scratch(es), Spot repair



Door window FL, Scratch(es), Polish



Door RL, Scratch(es), Polish



Outer door handle RL, Scratch(es), Acceptable



Door FL, Scratch(es), Acceptable



Wing FL, Scratch(es), Spot repair



Alloy rim FL polished, Scratch(es), Repair and paint (complete)



Rear light R, Scratch(es), Polish




Rear light L, Scratch(es), Polish



Tailgate / Boot, Scratch(es), Polish




Bumper R, Scratch(es), Repair and paint (complete)

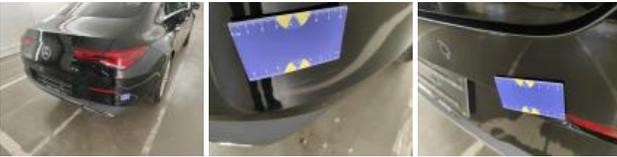

Alloy rim FR polished, Scratch(es), Repair and paint (complete)



Door FR, Dent(s), Acceptable

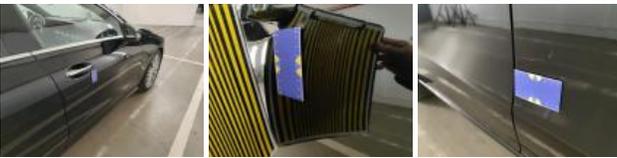


Outer door handle FR, Scratch(es), Acceptable



Step R, Scratch(es), Acceptable



Wing RR, Bad repair, Repair and paint (complete)

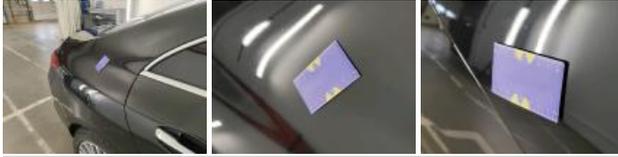

Alloy rim RR polished, Scratch(es), Repair and paint (complete)



Bodywork, No damage, Acceptable

