

SEAT Ibiza 5D: 2DRW177

Vinnnumber:	VSSZZKJ5PR125927	Versionname:	Ibiza 5D 1.0 MPI S/S Move Full Link 59kW/80pk
First Registrationdate:	7/06/2023	Fiscalpower:	5D/P Man-5 (4 seizoenen Banden) - CO2 indicatief
Expertise Mileage:	92731	Power Kw:	59
Bodytype:	MAN 6 VIT	Body colour:	Silver
Gearbox:	Front	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	b112
Fueltype:	Petrol		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total	2	Radio
Number keys remote	2	Rear parking sensors
Windows electric F		Fog lights (front)
Cruise Control		
Steering wheel multifunctional		
Navigation with screen		
Airco manual		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

	185/65/15/88 T			
Summer tyres:	Fr.L.	Barum: 4 mm	Fr.R.	Barum: 4 mm
	Re.L.	Barum: 4 mm	Re.R.	Barum: 4 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				185/65 R 15 88 T
Tyre size FR				185/65 R 15 88 T
Tyre size RL				185/65 R 15 88 T
Tyre size RR				185/65 R 15 88 T
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				2478
Tyre make FR				2478
Tyre make RL				2478
Tyre make RR				2478

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		



Bumper F, Scratch(es), Spot repair



Bumper moulding F, Scratch(es), Acceptable



Bonnet, Stone chip(s), Repair and paint (complete)



Engine insulation, Missing, Replace




Door FL, Dent(s) and scratch(es), Spot repair



Outer door handle FL, Scratch(es), Acceptable



Roof pillar L, Dent(s), Acceptable

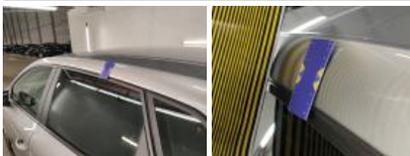


Wing RL, Dent(s), Acceptable



Door RL, Dent(s) and scratch(es), Spot repair



Boot lid covering R, Scratch(es), Acceptable

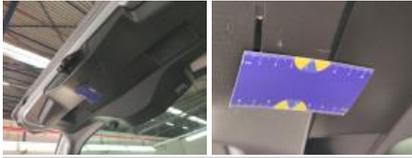

Wing FR, Dent(s) and scratch(es), Repair and paint (complete)




Door RR, Dent(s), Acceptable



Outer door handle FR, Scratch(es), Acceptable



Bodywork, No damage, Acceptable

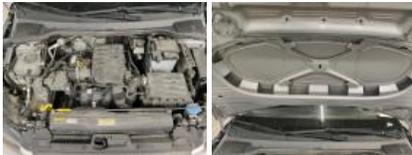

Roof, Chemical pollution, Polish

