



PEUGEOT 2008: 1YXX208

Vinnnumber:	VR3UDYHSMJ533538	Versionname:	2008 1.5 BlueHDi S/S GT 81kW/110pk 5D/P Man-6
First Registrationdate:	26/01/2021	Fiscalpower:	
Expertise Mileage:	65001	Power Kw:	
Bodytype:		Body colour	Grey
Gearbox:	MAN 6 VIT	Type of rims (mounted)	Aluminium
Transmission:	Front	Parking lot	b105
Fueltype:	Diesel		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Clean		

Options

Number of keys total	2	Radio
Number keys remote	2	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		Fog lights (front)
Cruise Control		
Steering wheel multifunctional		
Navigation with screen		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	215 / 60 / 17 / 96 / H / Aluminium	5,0 mm	Michelin	Summer
	Right	215 / 60 / 17 / 96 / H / Aluminium	5,0 mm	Michelin	Summer
Rear	Left	215 / 60 / 17 / 96 / H / Aluminium	5,0 mm	Michelin	Summer
	Right	215 / 60 / 17 / 96 / H / Aluminium	5,0 mm	Michelin	Summer

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Instrument panel, complete, Repaired, Acceptable



Seat cover FL, Worn, Acceptable



Bumper F, Scratch(es), Spot repair



Bumper moulding F, Scratch(es), Replace




Bonnet, Chemical polution, Polish



Wing trim FL, Scratch(es), Replace



Alloy rim FL polished, Chemical polution, Polish

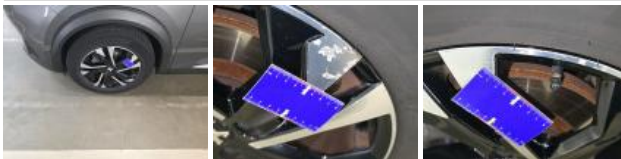

Central pillar L, Dent(s) and scratch(es), Spot repair



Door FL, Scratch(es), Spot repair



Door RL, Scratch(es), Polish



Alloy rim RL polished, Chemical polution, Polish



Internal boot lining L, Scratch(es), Acceptable




Tailgate / Boot, Scratch(es), Acceptable



Bumper R, Scratch(es), Acceptable



Alloy rim FR polished, Scratch(es), Acceptable

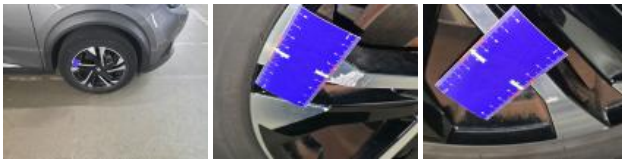

Wing RR, Dent(s), Paintless dent repair



Bodywork, No damage, Acceptable



Roof, Scratch(es), Touch up

