



OPEL Astra Sports Tourer: 2AQN684

Vinnnumber:	W0VBE8EV8M8020541	Versionname:	Astra Sports Tourer 1.5 Turbo D S/S Ultimate
First Registrationdate:	11/06/2021	Fiscalpower:	90kW/122pk 5D/P Man-6
Expertise Mileage:	105343	Power Kw:	
Bodytype:		Body colour:	Grey
Gearbox:	MAN 6 VIT	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	d353
Fueltype:	Diesel		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total:	2	Radio:	
Number keys remote:	2	Lining leather:	
Windows electric F:		Front parking sensors:	
Windows electric R:		Rear parking sensors:	
Cruise Control:			
Steering wheel multifunctional:			
Seats F heated:			
Navigation with screen:			
Airco electronic:			
Rims alloy:			

Limited Technical Inspection

Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Clutch test:	OK
Exhaust gass:	OK	Transmission:	OK

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	225 / 45 / 17 / 91 / V / Aluminium	5,0 mm	Michelin	Summer
	Right	225 / 45 / 17 / 91 / V / Aluminium	5,0 mm	Michelin	Summer
Rear	Left	225 / 45 / 17 / 91 / V / Aluminium	3,0 mm	Continental	Summer
	Right	225 / 45 / 17 / 91 / V / Aluminium	3,0 mm	Continental	Summer

Assistance equipment

Repair kit:	Yes	Compressor:	Yes
Number of charging cables (normal):	0		
Number of charging cables (rapid charge):	0		

Instrument panel, complete, Repaired, Acceptable




Door panel RR, Scratch(es), Acceptable



Bumper F, Bad repair, Check



Bonnet, Repaired, Acceptable

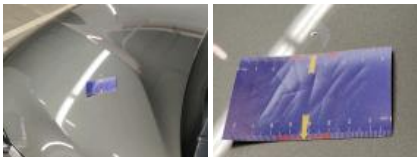

Door FL, Scratch(es), Touch up



Door RL, Scratch(es), Spot repair



Wing RL, Scratch(es), Polish




Alloy rim RL, Scratch(es), Repair and paint (complete)



Tyre RL, Tear, Acceptable




Internal boot lining R, Scratch(es), Acceptable

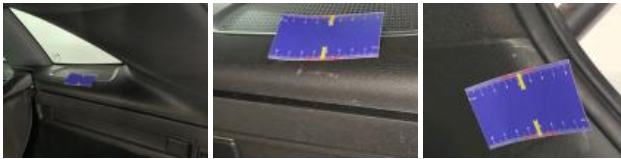


Internal boot lining L, Scratch(es), Smart repair



Boot lid covering R, Scratch(es), Acceptable

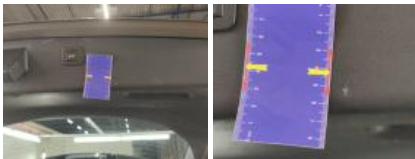

Bumper R, Scratch(es), Spot repair

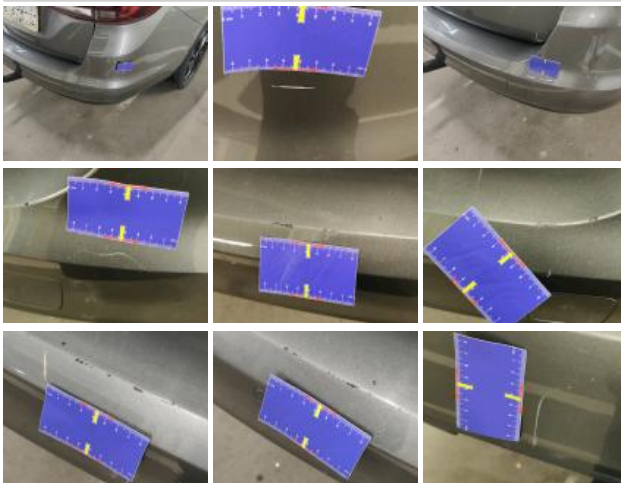

Rear light L, Scratch(es), Polish




Rear wiper blade, Damaged, Replace



Alloy rim FR, Scratch(es), Repair and paint (complete)




Outside rear-view mirror housing R, Scratch(es), Polish

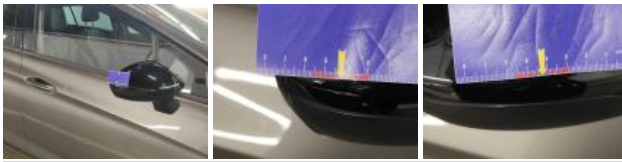

Door FR, Scratch(es), Acceptable



Step R, Dent(s), Acceptable

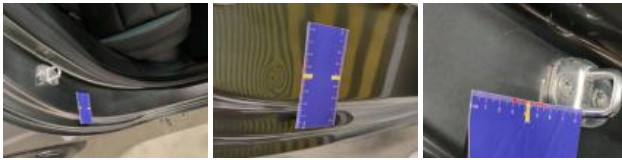

Alloy rim RR, Scratch(es), Acceptable



Door RR, Scratch(es), Acceptable



Bodywork, No damage, Acceptable



Roof, Scratch(es), Polish

