


PEUGEOT Expert: 2BMG434

Vinnumber:	VF3VFEHTMM7854144	Versionname:	Expert Long Premium L3 2.0 BlueHDi 145 S/S
First Registrationdate:	12/01/2022	Fiscalpower:	107kW/145pk 4D/P Man-6
Expertise Mileage:	162118	Power Kw:	
Bodytype:		Body colour:	White
Gearbox:	MAN 6 VIT	Type of rims (mounted):	Steel
Transmission:	Front	Parking lot:	d006
Fueltype:	Diesel		
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Type of rims (mounted):	Steel		
Certificate of Conformity:	Yes		
Category:	Light Commercial Vehicle		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total:	2	Radio:	
Number keys remote:	2	Front parking sensors:	
Windows electric F:		Rear parking sensors:	
Cruise Control:		Fog lights (front):	
Navigation with screen:			
Airco manual:			

Limited Technical Inspection

Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Clutch test:	OK
Exhaust gass:	OK	Transmission:	OK

Tyres

215/65/16/107 R				
Winter tyres:	Fr.L.	Uniroyal: 4 mm	Fr.R.	Uniroyal: 4 mm
	Re.L.	Uniroyal: 5 mm	Re.R.	Uniroyal: 5 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				215/65 R 16 107 R
Tyre size FR				215/65 R 16 107 R
Tyre size RL				215/65 R 16 107 R
Tyre size RR				215/65 R 16 107 R
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				265
Tyre make FR				265
Tyre make RL				265
Tyre make RR				265

Assistance equipment

Spare wheel:	Yes	Jack:	Yes
Number of charging cables (normal):	0		
Number of charging cables (rapid charge):	0		

Instrument panel, complete, Repaired, Acceptable



Dashboard, Hole, Smart repair



Windscreen, Stone chip(s), Acceptable



Wing FL, Scratch(es), Polish



Wing RL, Dent(s), Acceptable



Door FL, Scratch(es), Acceptable



Boot door panel RL, Dent(s) and scratch(es), Spot repair



Boot door panel RR, Deformed / Strained, Replace and paint



Bumper moulding R, Scratch(es), Acceptable




Bumper R, Scratch(es), Smart repair



Bumper moulding R, Scratch(es), Smart repair




Door FR, Dent(s) and scratch(es), Spot repair

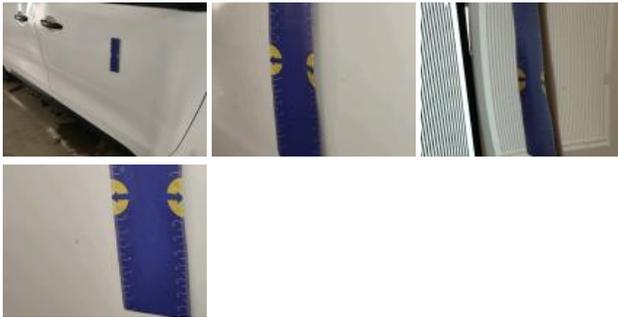

Sliding door R, Bad repair, Repair and paint (complete)



Wing RR, Bad repair, Repair and paint (complete)

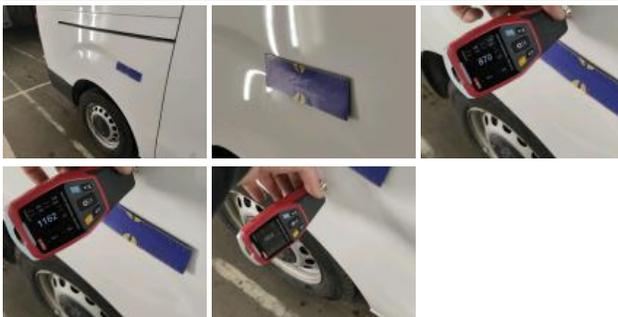

Bodywork, No damage, Acceptable



Bodywork, No damage, Acceptable



Bodywork, Glue residues, Acceptable

