



MERCEDES A-Klasse Limousine: 1YJR602

Vinnumber:	W1K1771031J255241	Versionname:	A-Klasse Limousine A 180d Business Solution
First Registrationdate:	14/09/2020	Fiscalpower:	85kW/116pk 4D/P Auto-7
Expertise Mileage:	147629	Power Kw:	
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	d352
Fueltype:	Diesel		
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total	1	Radio
Number keys remote	1	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Alarm		
Navigation with screen		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

205/60/16/96 H				
Winter tyres:	Fr.L.	Hankook: 3 mm	Fr.R.	Hankook: 3 mm
	Re.L.	Hankook: 4 mm	Re.R.	Hankook: 4 mm
Tyre profile depth FL				3.0
Tyre profile depth FR				3.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				205/60 R 16 96 H
Tyre size FR				205/60 R 16 96 H
Tyre size RL				205/60 R 16 96 H
Tyre size RR				205/60 R 16 96 H
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				260
Tyre make FR				260
Tyre make RL				260
Tyre make RR				260

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		

Ignition key, Missing, Replace



Instrument panel, complete, Repaired, Acceptable




Interior, Stain, Cleaning



Steering wheel, Worn, Acceptable




Bonnet, Stone chip(s), Acceptable

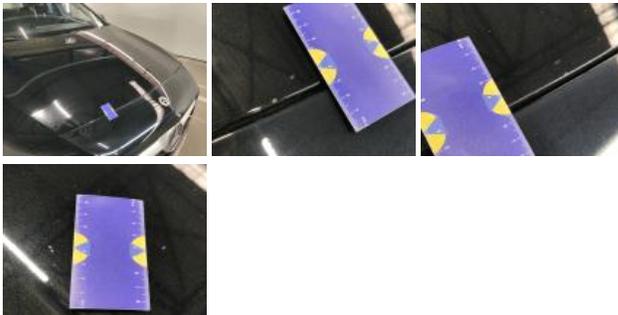

Windscreen, Stone chip(s), Windscreen repair



Wing FL, Scratch(es), Acceptable

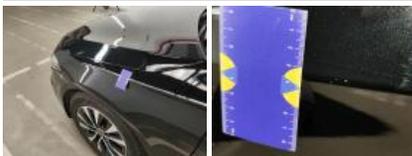

Alloy rim FL polished, Chemical polution, Polish




Mirror side repeater L, Scratch(es), Replace





Outside rear-view mirror housing L, Scratch(es), Acceptable



Door RL, Dent(s), Paintless dent repair

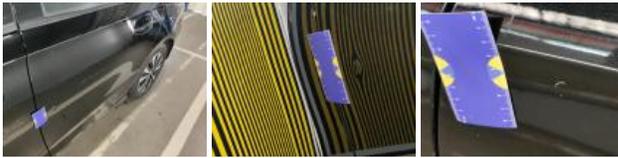


Door FL, Scratch(es), Acceptable

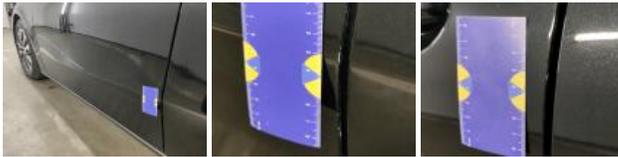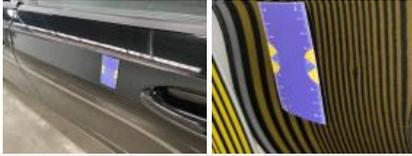


Outer door handle FL, Scratch(es), Acceptable




Wing RL, Dent(s), Acceptable

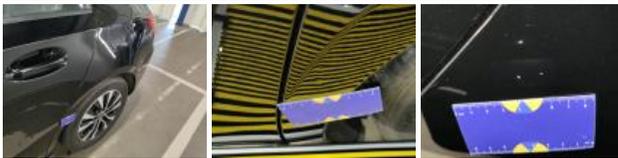

Rear window, Scratch(es), Acceptable

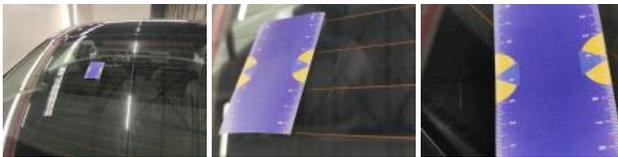

Bumper R, Scratch(es), Spot repair

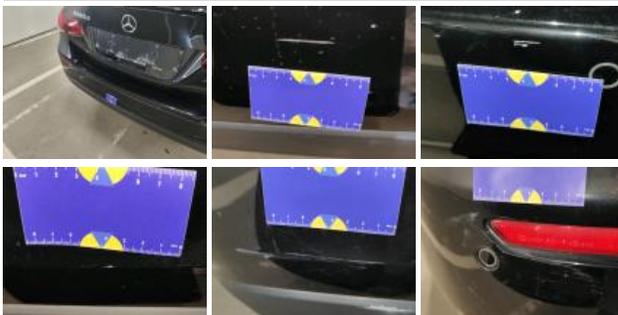

Alloy rim FR polished, Chemical pollution, Polish



Wing FR, Scratch(es), Acceptable




Outside rear-view mirror housing R, Scratch(es), Repair and paint (complete)




Roof pillar R, Scratch(es), Acceptable



Door FR, Scratch(es), Acceptable

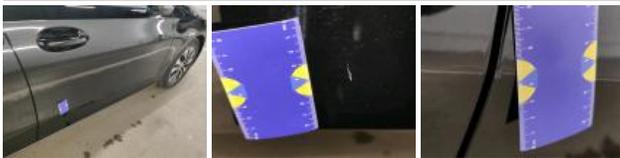

Door RR, Scratch(es), Acceptable

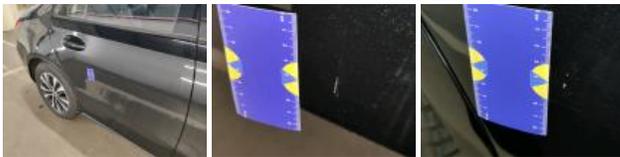


Alloy rim RR polished, Chemical polution, Polish



Bodywork, No damage, Acceptable



Roof, Scratch(es), Polish

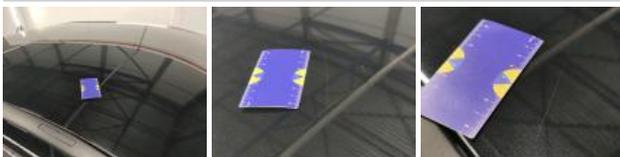

Fuel cap cover, Scratch(es), Polish

