


PEUGEOT 308 SW: 2CEW463

Vinnnummer:	VR3FCYHZTNY546315	Versionname:	308 SW 1.5 BlueHDi 130 S/S EAT8 Allure Pack
First Registratiedate:	28/06/2022	Fiscalpower:	96kW/130pk 5D/P Auto-8
Expertise Mileage:	90962	Power Kw:	
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	a114
Fueltype:	Diesel		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total:	2	Radio
Number keys remote:	2	Front parking sensors
GPS storage:	HD	Rear parking sensors
Windows electric F:		
Windows electric R:		
Cruise Control:		
Steering wheel multifunctional:		
Navigation with screen:		
Airco electronic:		
Rims alloy:		

Limited Technical Inspection

Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Clutch test:	OK
Exhaust gass:	OK	Transmission:	OK

Tyres

225/45/17/91 H				
Winter tyres:	Fr.L.	Vredestein: 4 mm	Fr.R.	Vredestein: 4 mm
	Re.L.	Vredestein: 5 mm	Re.R.	Vredestein: 5 mm
Tyre profile depth FL:				4.0
Tyre profile depth FR:				4.0
Tyre profile depth RL:				5.0
Tyre profile depth RR:				5.0
Tyre size FL:				225/45 R 17 91 H
Tyre size FR:				225/45 R 17 91 H
Tyre size RL:				225/45 R 17 91 H
Tyre size RR:				225/45 R 17 91 H
Tyre type FL:				Winter
Tyre type FR:				Winter
Tyre type RL:				Winter
Tyre type RR:				Winter
Tyre make FL:				2480
Tyre make FR:				2480
Tyre make RL:				2480
Tyre make RR:				2480

Assistance equipment

Number of charging cables (normal):	0	Compressor:	No
Number of charging cables (rapid charge):	0		

Instrument panel, complete, Repaired, Acceptable



Bonnet, Scratch(es), Polish



Bumper F, Scratch(es), Repair and paint (complete)



Alloy rim RL polished, Scratch(es), Repair and paint (complete)



Wing RL, Scratch(es), Spot repair



Door RL, Dent(s) and scratch(es), Spot repair



Door window RL, Scratch(es), Polish



Step L, Scratch(es), Acceptable



Door FL, Scratch(es), Spot repair



Outer door handle FL, Scratch(es), Acceptable



Alloy rim FL polished, Scratch(es), Repair and paint (complete)



Wing FL, Scratch(es), Polish



Compressor, Missing, Replace



Rear light L, Scratch(es), Polish



Bumper R, Dent(s) and scratch(es), Repair and paint (complete)



Bumper moulding R, Scratch(es), Replace



Alloy rim FR polished, Scratch(es), Repair and paint (complete)



Wing RR, Scratch(es), Acceptable



Mirror side repeater R, Scratch(es), Replace



Outside rear-view mirror housing R, Scratch(es), Repair and paint (complete)



Door window FR, Scratch(es), Polish




Door FR, Dent(s) and scratch(es), Repair and paint (complete)



Door RR, Scratch(es), Acceptable



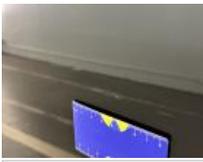


Step R, Dent(s) and scratch(es), Spot repair



Alloy rim RR polished, Scratch(es), Repair and paint (complete)



Wing RR, Dent(s), Spot repair

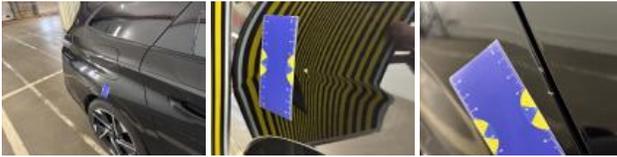

Roof pillar R, Dent(s), Acceptable



Bodywork, No damage, Acceptable



Interior covering A pillar L, Scratch(es), Smart repair



Door window FL, Scratch(es), Acceptable

