



PEUGEOT 3008: 2BFG510

Vinnumber:	VF3MRHNSMMS216610	Versionname:	3008 1.2 PureTech S/S Allure Pack 96kW/130pk 5D/P Man-6
First Registrationdate:	2/11/2021	Fiscalpower:	
Expertise Mileage:	65879	Power Kw:	96
Bodytype:		Body colour:	Blue
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	b210
Fueltype:	Petrol		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total:	2	Radio	
Number keys remote:	2	Lining leather	
GPS storage:	HD	Front parking sensors	
Windows electric F:		Rear parking sensors	
Windows electric R:			
Cruise Control:			
Steering wheel multifunctional:			
Seats F heated:			
Navigation with screen:			
Airco electronic:			
Rims alloy:			

Limited Technical Inspection

Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Clutch test:	OK
Exhaust gass:	OK	Transmission:	OK

Tyres

	225/55/18/102 V			
Summer tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm
Tyre profile depth FL				3.0
Tyre profile depth FR				3.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				225/55 R 18 102 V
Tyre size FR				225/55 R 18 102 V
Tyre size RL				225/55 R 18 102 V
Tyre size RR				225/55 R 18 102 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Repair kit:	Yes	Compressor:	Yes
Number of charging cables (normal):	0		


Number of charging cables (rapid charge)

0

Windscreen, Stone chip(s), Acceptable



Alloy rim RL polished, Scratch(es), Acceptable

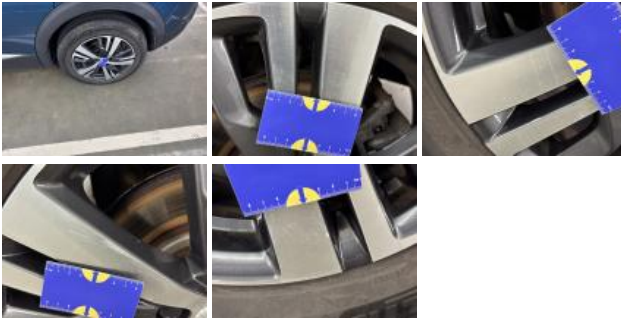

Wing RL, Scratch(es), Acceptable



Door RL, Scratch(es), Polish



Wing FL, Chemical pollution, Polish



Mirror side repeater L, Scratch(es), Replace



Rear window, Scratch(es), Polish



Rear light R, Scratch(es), Polish



Bumper R, Scratch(es), Polish



Rear light L, Scratch(es), Polish



Alloy rim FR polished, Scratch(es), Acceptable



Wing RR, Dent(s), Paintless dent repair



Door RR, Dent(s), Acceptable



Alloy rim RR polished, Scratch(es), Acceptable



Bodywork, No damage, Acceptable

