



MERCEDES A-Klasse: 1XNJ748			
Vinnumber:	W1K1770031N158157	Versionname:	A-Klasse A 180 d Business Solution 85kW/116pk
First Registrationdate:	19/02/2020	Fiscalpower:	5D/P Auto-7
Expertise Mileage:	110476	Power Kw:	
Bodytype:		Body colour	Grey
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:	Front	Parking lot	b305
Fueltype:	Diesel		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Clean		

Options			
Number of keys total	2	Radio	
Number keys remote	2	Front parking sensors	
GPS storage	HD	Rear parking sensors	
Windows electric F			
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Alarm			
Navigation with screen			
Airco electronic			
Rims alloy			

Limited Technical Inspection			
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres			
Summer tyres:	205/60/16/92 V		
	Fr.L.	Continental: 4 mm	Fr.R.
	Re.L.	Continental: 5 mm	Re.R.
Tyre profile depth FL			4.0
Tyre profile depth FR			4.0
Tyre profile depth RL			5.0
Tyre profile depth RR			5.0
Tyre size FL			205/60 R 16 92 V
Tyre size FR			205/60 R 16 92 V
Tyre size RL			205/60 R 16 92 V
Tyre size RR			205/60 R 16 92 V
Tyre type FL			Summer
Tyre type FR			Summer
Tyre type RL			Summer
Tyre type RR			Summer
Tyre make FL			256
Tyre make FR			256
Tyre make RL			256
Tyre make RR			256

Assistance equipment			
Repair kit	Yes	Compressor	Yes

Number of charging cables (normal)
Number of charging cables (rapid charge)

0
0

Bonnet, Scratch(es), Polish



Bumper F, Scratch(es), Spot repair



Bumper grille, Deformed / Strained, Acceptable



Alloy rim RL polished, Chemical polution, Repair and paint (complete)



Door RL, Scratch(es), Acceptable



Rear window, Scratch(es), Polish



Tailgate / Boot, Dent(s), Acceptable




Bumper R, Bad repair, Repair and paint (complete)



Alloy rim FR polished, Chemical polution, Acceptable



Door FR, Repaired, Acceptable

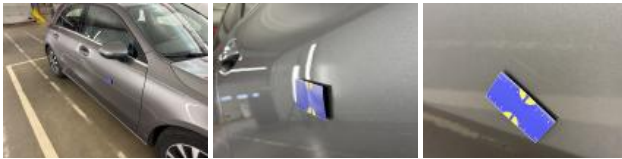

Door RR, Scratch(es), Polish



Wing RR, Bad repair, Repair and paint (complete)



Alloy rim RR polished, Chemical polution, Repair and paint (complete)



Roof pillar R, Dent(s), Acceptable



Bodywork, No damage, Acceptable

