



MERCEDES GLB: 2CGC132

Vinnnumber:	W1N2476841W196220	Versionname:	GLB GLB 180 Business Solution 100kW/136pk 5D/P
First Registrationdate:	11/07/2022	Fiscalpower:	Auto-7
Expertise Mileage:	81276	Power Kw:	
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	a103
Fueltype:	Petrol		
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total:	2	Radio:	
Number keys remote:	2	Sun Roof electric:	
Windows electric F:		Front parking sensors:	
Windows electric R:		Rear parking sensors:	
Cruise Control:			
Steering wheel multifunctional:			
Seats F heated:			
Alarm:			
Navigation with screen:			
Airco electronic:			
Rims alloy:			

Limited Technical Inspection

Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Clutch test:	OK
Exhaust gass:	OK	Transmission:	OK

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	235 / 50 / 19 / 99 / W / Aluminium	4,0 mm	Michelin	Summer
	Right	235 / 50 / 19 / 99 / W / Aluminium	4,0 mm	Michelin	Summer
Rear	Left	235 / 50 / 19 / 99 / W / Aluminium	5,0 mm	Pirelli	Summer
	Right	235 / 50 / 19 / 99 / W / Aluminium	5,0 mm	Pirelli	Summer

Assistance equipment

Repair kit:	Yes	Compressor:	Yes
Number of charging cables (normal):	0		
Number of charging cables (rapid charge):	0		


Instrument panel, complete, Repaired, Acceptable



Seat cover FR, Stain, Cleaning





Door panel RR, Scratch(es), Acceptable

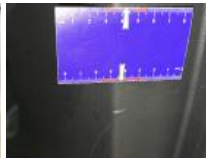


Instrument panel, complete, Not functioning (well), Check




Bumper F, Scratch(es), Acceptable

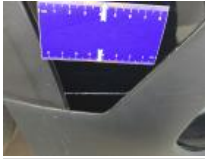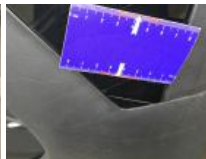


Bumper moulding F, Scratch(es), Replace

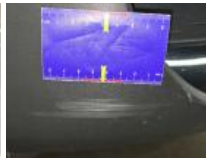

Bumper moulding F, Dent(s) and scratch(es), Replace

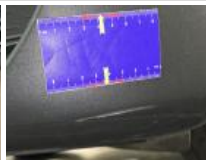

Wing FL, Dent(s), Paintless dent repair

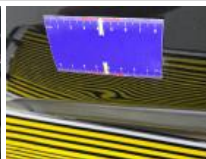

Central pillar L, Dent(s) and scratch(es), Spot repair




Door RL, Dent(s), Forfeit



Step L, Dent(s) and scratch(es), Spot repair



Wing RL, Dent(s), Forfeit

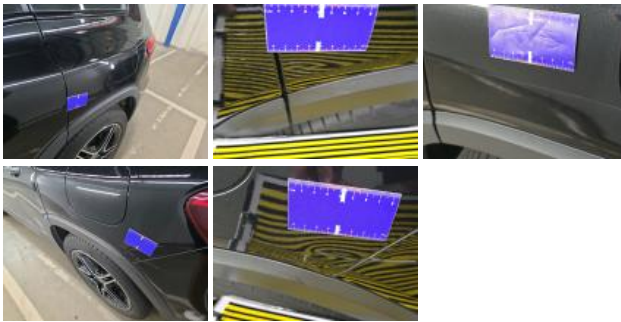


Boot lid covering R, Scratch(es), Acceptable



Tailgate / Boot, Scratch(es), Spot repair




Rear spoiler, Scratch(es), Acceptable

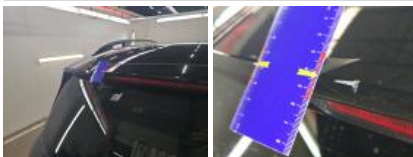

Bumper trim R, Scratch(es), Smart repair



Bumper R, Dent(s) and scratch(es), Repair and paint (complete)

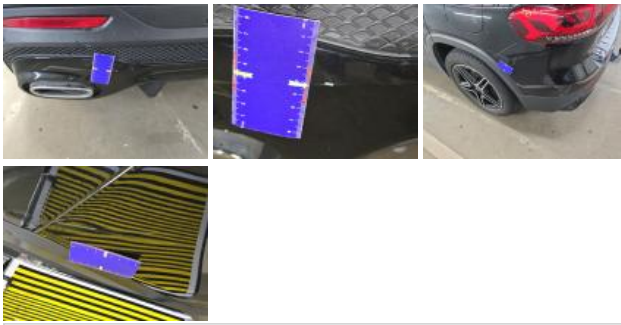

Alloy rim FR polished, Scratch(es), Acceptable



Door FR, Dent(s) and scratch(es), Spot repair



Central pillar R, Dent(s) and scratch(es), Spot repair



Door trim RR, Scratch(es), Replace



Door trim RR, Scratch(es), Acceptable



Step R, Dent(s) and scratch(es), Spot repair



Alloy rim RR polished, Scratch(es), Repair and paint (complete)



Bodywork, No damage, Acceptable

