



SEAT Arona: 2AQN625

Vinnumber:	VSSZZKJZMR181795	Versionname:	Arona 1.0 TSI DSG Move 81kW/110pk 5D/P Auto-7
First Registrationdate:	11/06/2021	Fiscalpower:	
Expertise Mileage:	159655	Power Kw:	81
Bodytype:		Body colour:	Grey
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	c217
Fueltype:	Petrol		
Number of doors:	2		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Dirty		

Options

Number of keys total	1	Radio
Number keys remote	1	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		Fog lights (front)
Cruise Control		
Steering wheel multifunctional		
Alarm		
Navigation with screen		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

205/60/16/92 H				
Winter tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 4 mm	Re.R.	Goodyear: 4 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				205/60 R 16 92 H
Tyre size FR				205/60 R 16 92 H
Tyre size RL				205/60 R 16 92 H
Tyre size RR				205/60 R 16 92 H
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				259
Tyre make FR				259
Tyre make RL				259
Tyre make RR				259

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Ignition key, Missing, Replace



Instrument panel, complete, Repaired, Acceptable



Seat cover FL, Worn, Acceptable



Gear shift lever knob, Worn, Acceptable



Seat cover R, Stain, Cleaning




Seat cover FR, Stain, Cleaning



Windscreen, Stone chip(s), Windscreen repair




Bonnet, Scratch(es), Repair and paint (complete)

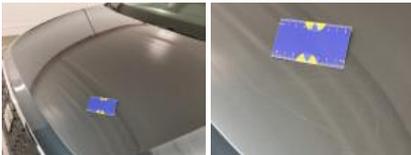

Bumper F, Scratch(es), Spot repair



Bumper grille, Broken, Replace

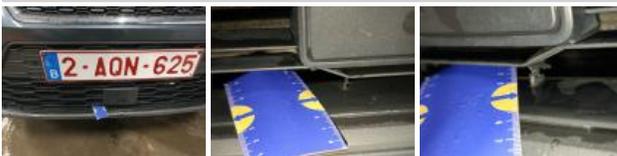

Door FL, Scratch(es), Spot repair



Door RL, Dent(s) and scratch(es), Spot repair



Wing RL, Dent(s), Paintless dent repair



Wing RL, Scratch(es), Acceptable



Roof pillar L, Scratch(es), Acceptable



Wing trim FL, Scratch(es), Replace



Wing FL, Dent(s) and scratch(es), Repair and paint (complete)



Wing trim FL, Scratch(es), Replace



Bumper trim R, Scratch(es), Replace



Bumper R, Scratch(es), Polish




Wiper arm rear, Incomplete, Replace



Tailgate / Boot, Scratch(es), Acceptable




Bumper trim R, Scratch(es), Acceptable

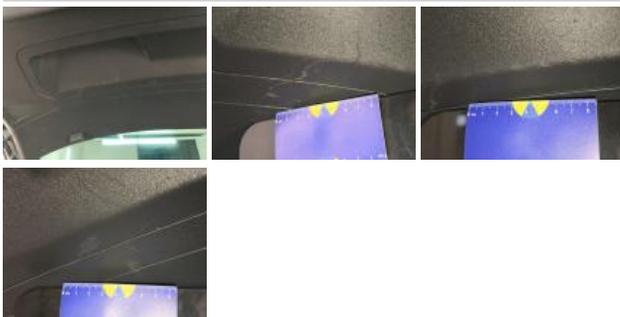


Rear light L, Scratch(es), Polish



Wing RR, Dent(s), Acceptable

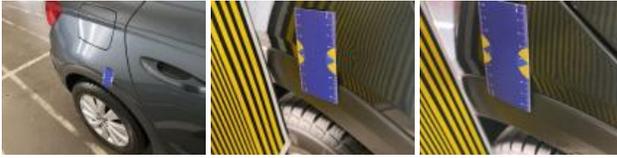

Door FR, Dent(s) and scratch(es), Spot repair

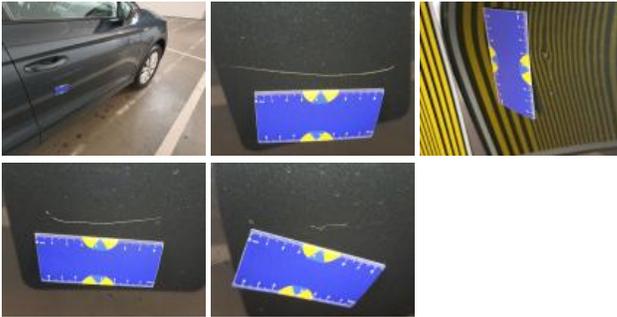

Roof pillar R, Dent(s), Paintless dent repair



Wing FR, Scratch(es), Acceptable



Outer door handle RR, Scratch(es), Acceptable



Outer door handle FR, Scratch(es), Acceptable



Bodywork, No damage, Check



Bodywork, No damage, Check

