



SKODA Octavia Combi: 1YGS260

Vinnnumber:	TMBJJ7NX0LY038687	Versionname:	Octavia Combi 2.0 CRTDI DSG7 Ambition
First Registrationdate:	26/08/2020	Fiscalpower:	110kW/150pk 5D/P Auto-7
Expertise Mileage:	133921	Power Kw:	
Bodytype:		Body colour:	Grey
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	c224
Fueltype:	Diesel		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total:	2	Radio	
Number keys remote:	2	Front parking sensors	
GPS storage:	HD	Rear parking sensors	
Windows electric F:		Fog lights (front)	
Windows electric R:			
Cruise Control:			
Steering wheel multifunctional:			
Seats F heated:			
Alarm:			
Navigation with screen:			
Airco electronic:			
Rims alloy:			

Limited Technical Inspection

Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Clutch test:	OK
Exhaust gass:	OK	Transmission:	OK

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	205 / 60 / 16 / 92 / H / Aluminium	4,0 mm	Firestone	Winter
	Right	205 / 60 / 16 / 92 / H / Aluminium	4,0 mm	Firestone	Winter
Rear	Left	205 / 60 / 16 / 92 / H / Aluminium	5,0 mm	Firestone	Winter
	Right	205 / 60 / 16 / 92 / H / Aluminium	5,0 mm	Firestone	Winter

Assistance equipment

Spare wheel:	Yes
Number of charging cables (normal):	0
Number of charging cables (rapid charge):	0

Instrument panel, complete, Repaired, Acceptable



Steering wheel, Worn, Acceptable



Door panel RL, Scratch(es), Acceptable



Seat cover FR, Stain, Cleaning



Seat cover RR, Stain, Cleaning



Windscreen, Stone chip(s), Acceptable



Bonnet, Dent(s), Forfeit



Bumper F, Scratch(es), Spot repair



Bumper moulding F, Scratch(es), Replace



Alloy rim RL, Scratch(es), Polish



Wing RL, Dent(s), Spot repair



Door RL, Dent(s) and scratch(es), Spot repair



Step L, Scratch(es), Polish



Door FL, Scratch(es), Acceptable




Wing FL, Scratch(es), Polish



Roof pillar L, Dent(s), Acceptable



Rear light R tailgate, Scratch(es), Acceptable

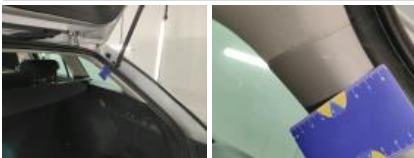

Internal boot lining L, Scratch(es), Acceptable



Boot lid covering R, Scratch(es), Acceptable



Rear light R, Scratch(es), Polish




Bumper R, Scratch(es), Polish



Alloy rim FR, Scratch(es), Repair and paint (complete)



Door FR, Scratch(es), Polish

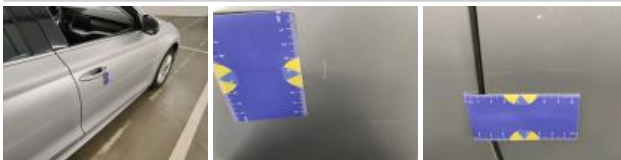

Step R, Scratch(es), Polish



Door RR, Scratch(es), Polish



Wing RR, Scratch(es), Polish



Bodywork, No damage, Check



Roof, Chemical polution, Polish



Bodywork, No damage, Acceptable

