



## SEAT Ibiza 5D: 2EDK328

Vinnnumber:	<b>VSSZZKJ2PR131099</b>	Versionname:	<b>Ibiza 5D 1.0 MPI S/S Move Full Link 59kW/80pk</b>
First Registrationdate:	<b>5/09/2023</b>	Fiscalpower:	<b>5D/P Man-5 (4 seizoenen Banden) - CO2 onvolledig</b>
Expertise Mileage:	<b>95985</b>	Power Kw:	
Bodytype:		Body colour:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Type of rims (mounted):	<b>Aluminium</b>
Transmission:	<b>Front</b>	Parking lot:	<b>b522</b>
Fueltype:	<b>Petrol</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Type of rims (mounted):	<b>Aluminium</b>		
Certificate of Conformity:	<b>Yes</b>		
Category:	<b>Passenger Car</b>		
Registration Certificate Car (BE):	<b>Yes</b>		
Bodywork:	<b>Clean</b>		
Interior:	<b>Clean</b>		

## Options

Number of keys total	<b>2</b>	Radio
Number keys remote	<b>2</b>	Rear parking sensors
Windows electric F		Fog lights (front)
Cruise Control		
Steering wheel multifunctional		
Navigation with screen		
Airco manual		
Rims alloy		

## Limited Technical Inspection

Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Transmission	<b>OK</b>

## Tyres

185/65/15/88 H				
Summer tyres:	Fr.L.	<b>Continental: 5 mm</b>	Fr.R.	<b>Continental: 5 mm</b>
	Re.L.	<b>Other: 3 mm</b>	Re.R.	<b>Other: 3 mm</b>
Tyre profile depth FL				<b>5.0</b>
Tyre profile depth FR				<b>5.0</b>
Tyre profile depth RL				<b>3.0</b>
Tyre profile depth RR				<b>3.0</b>
Tyre size FL				<b>185/65 R 15 88 H</b>
Tyre size FR				<b>185/65 R 15 88 H</b>
Tyre size RL				<b>185/65 R 15 88 H</b>
Tyre size RR				<b>185/65 R 15 88 H</b>
Tyre type FL				<b>All seasons</b>
Tyre type FR				<b>All Seasons</b>
Tyre type RL				<b>All seasons</b>
Tyre type RR				<b>All Seasons</b>
Tyre make FL				<b>256</b>
Tyre make FR				<b>256</b>
Tyre make RL				<b>263</b>
Tyre make RR				<b>263</b>

## Assistance equipment

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		



Bumper F, Scratch(es), Repair and paint (complete)



Wing FL, Scratch(es), Spot repair



Outer sill L, Dent(s) and scratch(es), Repair and paint (complete)



Step L, Scratch(es), Acceptable




Wing RL, Scratch(es), Acceptable



Tailgate / Boot, Dent(s) and scratch(es), Repair and paint (complete)



Rear window, Scratch(es), Polish

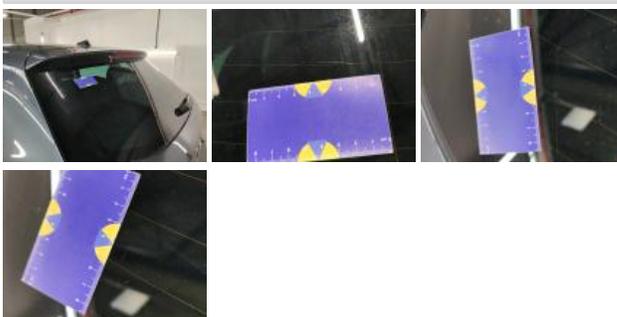

Bumper R, Dent(s) and scratch(es), Repair and paint (complete)




Bumper trim R, Scratch(es), Smart repair




Alloy rim FR, Scratch(es), Repair and paint (complete)



Step R, Dent(s) and scratch(es), Spot repair

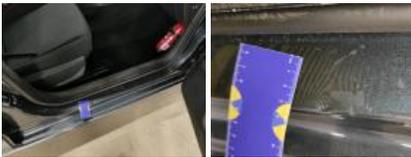

Door RR, Scratch(es), Polish

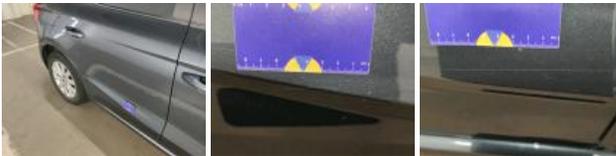


Door FR, Scratch(es), Polish



Step R, Scratch(es), Acceptable



Wing RR, Dent(s), Paintless dent repair

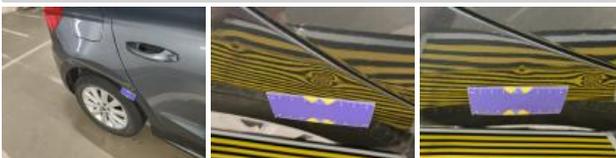

Bodywork, No damage, Acceptable



Roof, Scratch(es), Polish

