


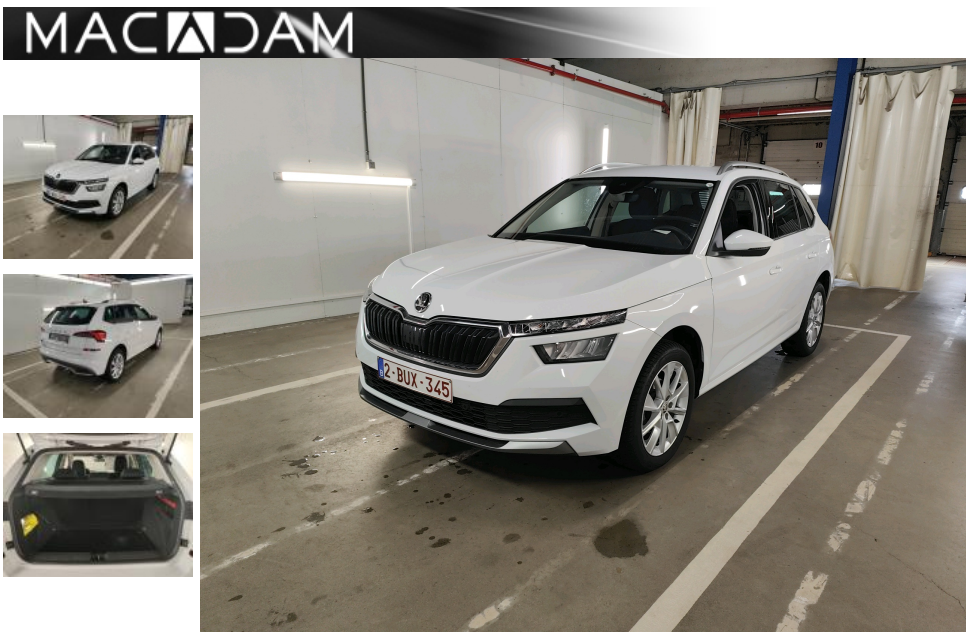

SKODA Kamiq: 2BUX345			
Vinnumber:	TMBGR6NW0N3080474	Versionname:	Kamiq 1.0 TSI DSG7 Clever 81kW/110pk 5D/P
First Registrationdate:	31/03/2022	Fiscalpower:	Auto-7
Expertise Mileage:	33759	Power Kw:	
Bodytype:		Body colour	White
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:	Front	Parking lot	b504
Fueltype:	Petrol		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Clean		

Options			
Number of keys total	2	Radio	
Number keys remote	2	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Alarm			
Navigation with screen			
Airco electronic			
Rims alloy			

Limited Technical Inspection			
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres				
	205/55/17/95 V			
Summer tyres:	Fr.L.	Goodyear: 6 mm	Fr.R.	Goodyear: 6 mm
	Re.L.	Goodyear: 6 mm	Re.R.	Goodyear: 6 mm
Tyre profile depth FL				6.0
Tyre profile depth FR				6.0
Tyre profile depth RL				6.0
Tyre profile depth RR				6.0
Tyre size FL				205/55 R 17 95 V
Tyre size FR				205/55 R 17 95 V
Tyre size RL				205/55 R 17 95 V
Tyre size RR				205/55 R 17 95 V
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				259
Tyre make FR				259
Tyre make RL				259
Tyre make RR				259

Assistance equipment			
Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		

Number of charging cables (rapid charge)

0

Seat cover FL, Worn, Acceptable



Instrument panel, complete, Repaired, Acceptable



Bumper moulding F, Scratch(es), Replace



Wing FL, Scratch(es), Spot repair




Alloy rim RL, Scratch(es), Acceptable



Bumper R, Scratch(es), Spot repair



Alloy rim RR, Scratch(es), Acceptable

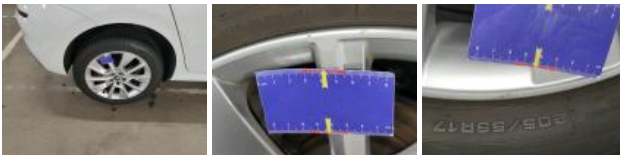

Alloy rim FR, Scratch(es), Repair and paint (complete)




Door FR, Dent(s), Paintless dent repair



Door RR, Dent(s) and scratch(es), Repair and paint (complete)



Outer door handle RR, Scratch(es), Repair and paint (complete)

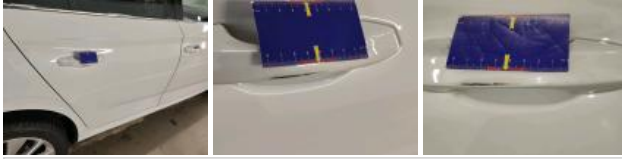

Wing RR, Scratch(es), Spot repair



Bodywork, No damage, Acceptable

