


**PEUGEOT 508 SW: 2BFX068**

Vinnnumber:	<b>VR3F4DGZTMY535119</b>	Versionname:	<b>508 SW 1.6 Hybrid 225 e-EAT8 Allure Pack (PHEV)</b>
First Registrationdate:	<b>9/11/2021</b>	Fiscalpower:	<b>165kW/225pk 5D/P Auto-8</b>
Expertise Mileage:	<b>67889</b>	Power Kw:	
Bodytype:		Body colour:	<b>Dark Grey</b>
Gearbox:	<b>Automatic</b>	Type of rims (mounted):	<b>Aluminium</b>
Transmission:	<b>Front</b>	Parking lot:	<b>d008</b>
Fueltype:	<b>Hybrid Petrol</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Type of rims (mounted):	<b>Aluminium</b>		
Certificate of Conformity:	<b>Yes</b>		
Category:	<b>Passenger Car</b>		
Registration Certificate Car (BE):	<b>Yes</b>		
Bodywork:	<b>Clean</b>		
Interior:	<b>Clean</b>		

**Options**

Number of keys total:	<b>2</b>	Radio
Number keys remote:	<b>2</b>	Front parking sensors
Windows electric F:		Rear parking sensors
Windows electric R:		
Cruise Control:		
Steering wheel multifunctional:		
Seats F heated:		
Navigation with screen:		
Airco electronic:		
Rims alloy:		

**Limited Technical Inspection**

Idle position:	<b>OK</b>	Sound engine:	<b>OK</b>
Engine startingtime:	<b>OK</b>	Clutch test:	<b>OK</b>
Exhaust gass:	<b>OK</b>	Transmission:	<b>OK</b>

**Tyres**

<b>215/55/17/98 W</b>				
Summer tyres:	Fr.L.	<b>Vredestein: 4 mm</b>	Fr.R.	<b>Vredestein: 4 mm</b>
	Re.L.	<b>Vredestein: 4 mm</b>	Re.R.	<b>Vredestein: 4 mm</b>
Tyre profile depth FL				<b>4.0</b>
Tyre profile depth FR				<b>4.0</b>
Tyre profile depth RL				<b>4.0</b>
Tyre profile depth RR				<b>4.0</b>
Tyre size FL				<b>215/55 R 17 98 W</b>
Tyre size FR				<b>215/55 R 17 98 W</b>
Tyre size RL				<b>215/55 R 17 98 W</b>
Tyre size RR				<b>215/55 R 17 98 W</b>
Tyre type FL				<b>All seasons</b>
Tyre type FR				<b>All Seasons</b>
Tyre type RL				<b>All seasons</b>
Tyre type RR				<b>All Seasons</b>
Tyre make FL				<b>2480</b>
Tyre make FR				<b>2480</b>
Tyre make RL				<b>2480</b>
Tyre make RR				<b>2480</b>

**Assistance equipment**

Repair kit:	<b>Yes</b>	Compressor:	<b>Yes</b>
Number of charging cables (normal):	<b>1</b>		
Number of charging cables (rapid charge):	<b>1</b>		


Instrument panel, complete, Repaired, Acceptable



Interior covering A pillar L, Scratch(es), Acceptable



Bonnet, Dent(s), Acceptable

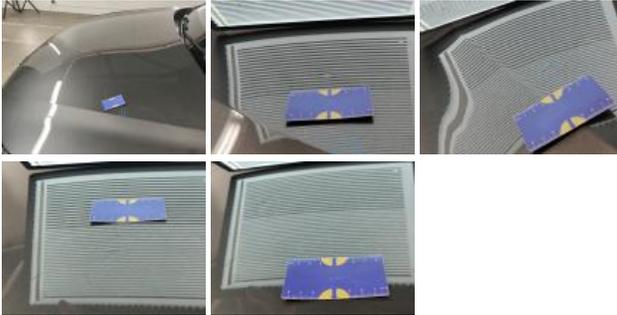

Bumper F, Scratch(es), Repair and paint (complete)



Alloy rim RL polished, Scratch(es), Acceptable




Wing RL, Dent(s), Acceptable




Door RL, Dent(s) and scratch(es), Repair and paint (complete)



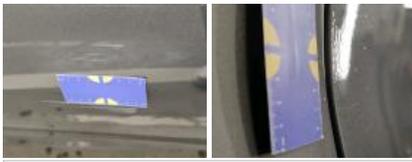



Door FL, Dent(s) and scratch(es), Repair and paint (complete)

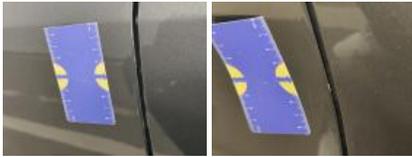

Outside rear-view mirror housing L, Scratch(es), Polish




Alloy rim FL polished, Scratch(es), Repair and paint (complete)

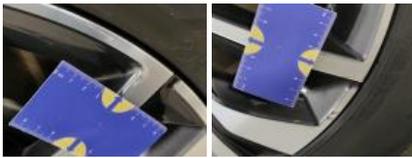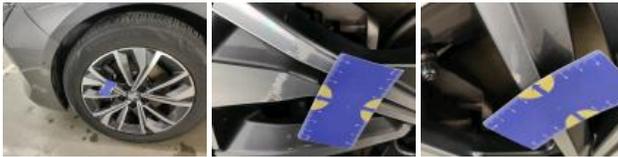

Wing FL, Dent(s), Acceptable




Outer door handle FL, Scratch(es), Acceptable

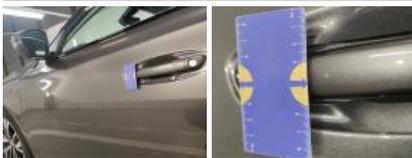

Outer sill L, Scratch(es), Repair and paint (complete)



Boot lid covering R, Scratch(es), Acceptable

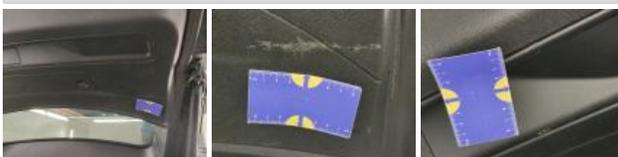

Bumper R, Scratch(es), Spot repair



Rear light L, Scratch(es), Polish



Alloy rim FR polished, Scratch(es), Acceptable



Door FR, Dent(s) and scratch(es), Acceptable



Door RR, Scratch(es), Repair and paint (complete)



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)



Alloy rim RR polished, Scratch(es), Acceptable



Outer sill R, Dent(s), Paintless dent repair



Wing FR, Dent(s), Acceptable



Roof, Hail damage, Repair and paint (complete)



Bodywork, No damage, Acceptable

