



MERCEDES CLA Shooting Brake: 2CDQ811

Vinnnumber:	W1K1186101N313407	Versionname:	CLA Shooting Brake CLA 180 d Business Solution
First Registrationdate:	15/06/2022	Fiscalpower:	Essential 85kW/116pk 5D/P AUT
Expertise Mileage:	117803	Power Kw:	
Bodytype:		Body colour	Grey
Gearbox:	MAN 6 VIT	Type of rims (mounted)	Aluminium
Transmission:	Front	Parking lot	d213
Fueltype:	Diesel		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Dirty		

Options

Number of keys total	2	Radio	
Number keys remote	2	Sun Roof electric	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Alarm			
Navigation with screen			
Airco electronic			
Rims alloy			

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK


Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	225 / 60 / 16 / 92 / V / Aluminium	3,0 mm	BF Goodrich	Summer
	Right	225 / 60 / 16 / 92 / V / Aluminium	3,0 mm	BF Goodrich	Summer
Rear	Left	225 / 60 / 16 / 92 / V / Aluminium	4,0 mm	Continental	Summer
	Right	225 / 60 / 16 / 92 / V / Aluminium	4,0 mm	Continental	Summer

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		


Interior covering A pillar L, Scratch(es), Smart repair

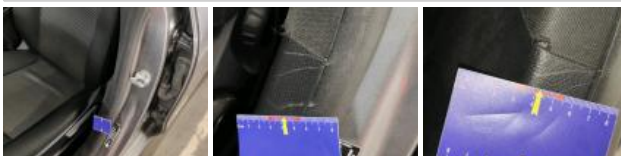


Instrument panel, complete, Repaired, Acceptable




Bumper F, Scratch(es), Spot repair

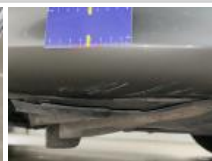

Door FL, Dent(s) and scratch(es), Spot repair

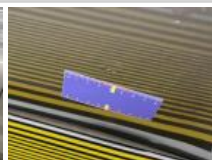

Step L, Dent(s) and scratch(es), Spot repair

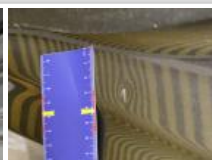


Roof pillar L, Dent(s), Paintless dent repair





Boot lid covering R, Scratch(es), Acceptable



Internal boot lining R, Hole, Smart repair

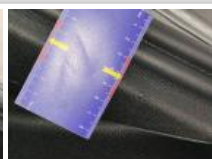


Step R, Dent(s) and scratch(es), Spot repair

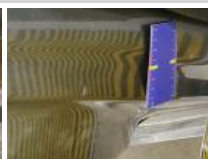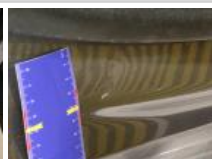

Wing RR, Dent(s), Paintless dent repair




Door RR, Dent(s), Paintless dent repair

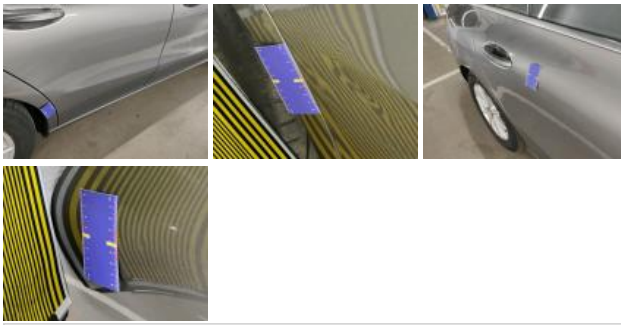

Door FR, Scratch(es), Acceptable



Roof pillar R, Dent(s), Paintless dent repair

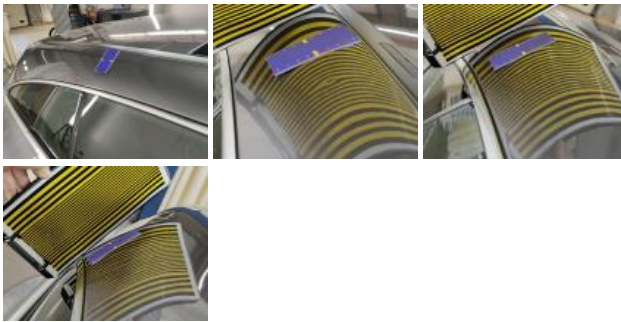

Door FR, Dent(s), Acceptable



Bodywork, No damage, Acceptable

