



MERCEDES A-Klasse: 2CBV402

Vinnumber:	W1K1770841J368076	Versionname:	A-Klasse A 180 Business Solution 100kW/136pk 5D/P Man-6
First Registrationdate:	25/05/2022	Fiscalpower:	
Expertise Mileage:	54793	Power Kw:	
Bodytype:		Body colour:	Grey
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	c410
Fueltype:	Petrol		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total	2	Radio	
Number keys remote	2	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Alarm			
Navigation with screen			
Airco electronic			
Rims alloy			

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK



Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	205 / 60 / 16 / 92 / V / Aluminium	4,0 mm	Continental	Summer
	Right	205 / 60 / 16 / 92 / V / Aluminium	4,0 mm	Continental	Summer
Rear	Left	205 / 60 / 16 / 92 / V / Aluminium	4,0 mm	Continental	Summer
	Right	205 / 60 / 16 / 92 / V / Aluminium	4,0 mm	Continental	Summer

Assistance equipment



Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Bumper F, Scratch(es), Spot repair

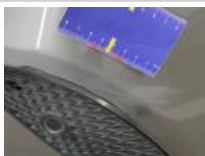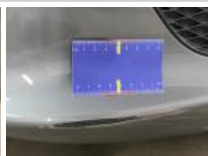





Mirror side repeater L, Scratch(es), Polish

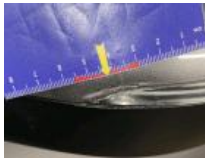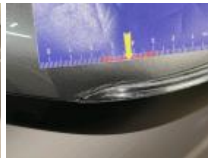

Door FL, Scratch(es), Acceptable

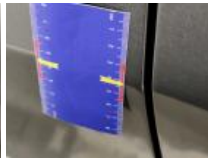


Step L, Dent(s), Acceptable

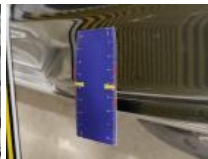


Central pillar L, Scratch(es), Acceptable




Outside rear-view mirror housing L, Scratch(es), Repair and paint (complete)

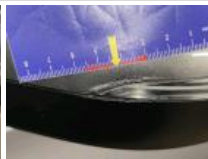



Door RL, Repaired, Acceptable

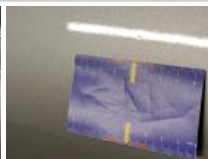


Door seal FL, Broken, Replace

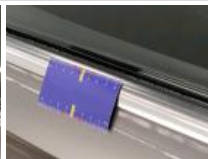


Outer sill L, Crack, Replace and paint

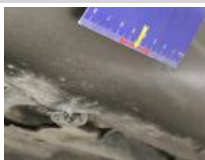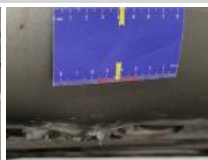

Bumper R, Deformed / Strained, Repair and paint (complete)

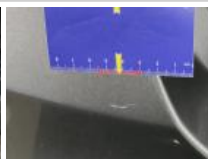

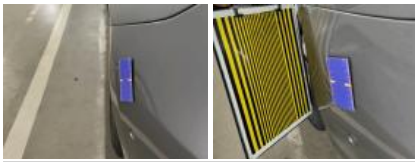

Rear light R, Scratch(es), Acceptable



Rear spoiler, Scratch(es), Polish




Door FR, Scratch(es), Acceptable




Wing FR, Scratch(es), Acceptable



Step R, Dent(s), Acceptable

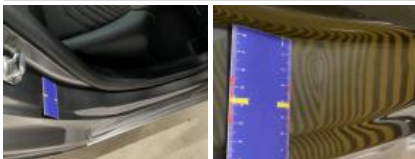

Outer sill R, Dent(s), Paintless dent repair

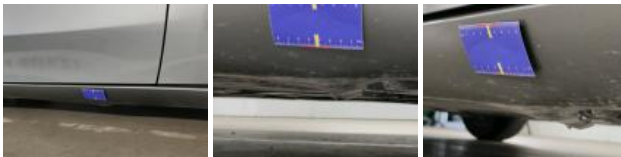

Bodywork, No damage, Check

