



PEUGEOT 3008: 2BGS592

Vinnumber:	VF3MRHNSMMS216613	Versionname:	3008 1.2 PureTech S/S Allure Pack 96kW/130pk
First Registrationdate:	18/11/2021	Fiscalpower:	5D/P Man-6
Expertise Mileage:	101876	Power Kw:	
Bodytype:		Body colour	Black
Gearbox:	MAN 6 VIT	Type of rims (mounted)	Aluminium
Transmission:	Front	Parking lot	c123
Fueltype:	Petrol		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Clean		

Options

Number of keys total	2	Radio	
Number keys remote	2	Lining leather	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Navigation with screen			
Airco electronic			
Rims alloy			

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK


Tyres

225/55/18/102 V				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm
Tyre profile depth FL				4
Tyre profile depth FR				4
Tyre profile depth RL				5
Tyre profile depth RR				5
Tyre size FL				225/55 R 18 102
Tyre size FR				225/55 R 18 102
Tyre size RL				225/55 R 18 102
Tyre size RR				225/55 R 18 102
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Bonnet, Scratch(es), Polish

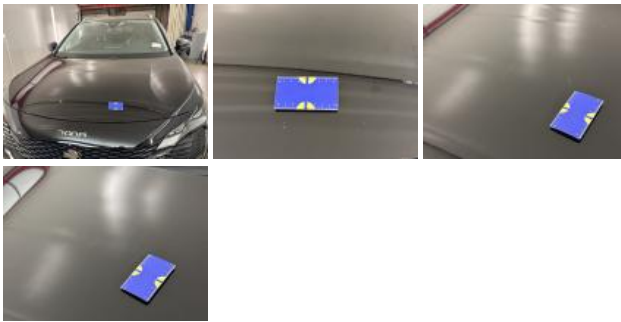


Bumper F, Scratch(es), Acceptable



Wing RL, Scratch(es), Acceptable



Door RL, Scratch(es), Polish

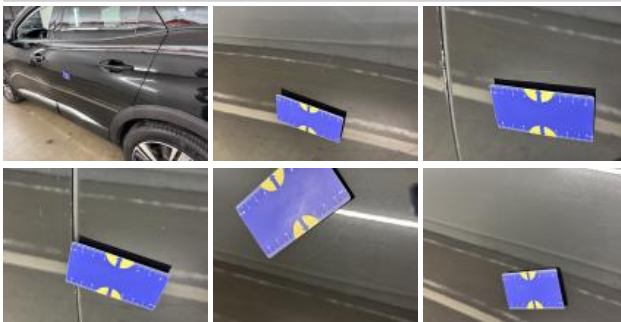


Door FL, Scratch(es), Polish



Wing FL, Scratch(es), Polish




Bumper R, Dent(s) and scratch(es), Spot repair

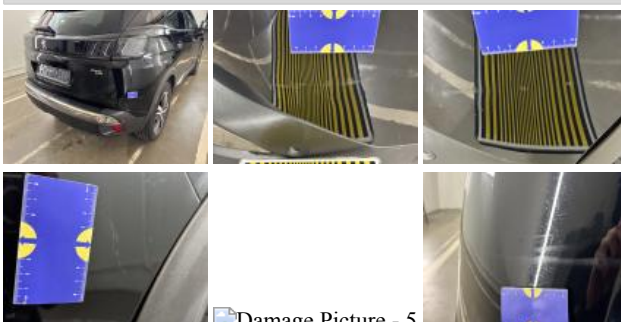




Bumper trim R, Scratch(es), Acceptable

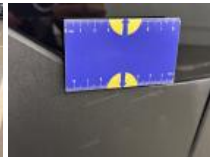

Tailgate / Boot, Scratch(es), Acceptable



Wing RR, Dent(s), Spot repair

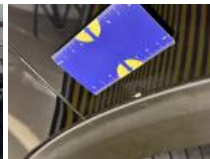

Wing trim RR, Deformed / Strained, Acceptable



Alloy rim RR polished, Scratch(es), Acceptable





Step R, Dent(s) and scratch(es), Spot repair




Door FR, Scratch(es), Spot repair




Door RR, Scratch(es), Polish

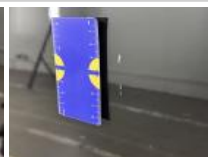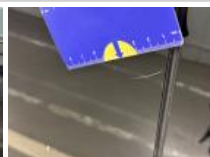

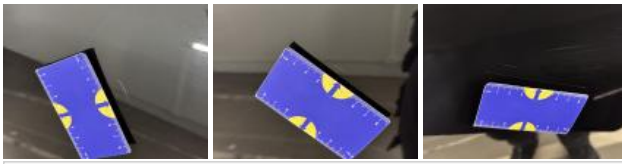

Roof, Chemical polution, Polish

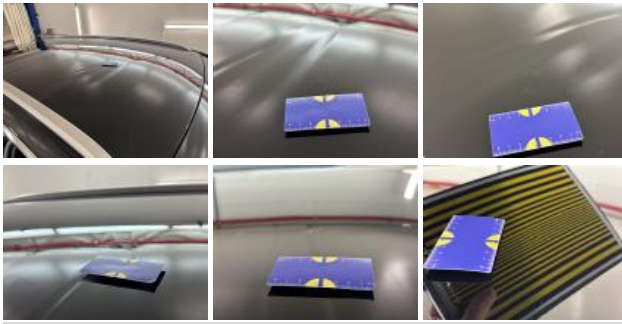

Bodywork, No damage, Acceptable

