


MERCEDES GLC: 2AHH767

Vinnumber:	W1N2539161V298744	Versionname:	GLC GLC 200 d Business Solution 4MATIC
First Registrationdate:	2/04/2021	Fiscalpower:	120kW/163pk 5D/P Auto-9
Expertise Mileage:	220733	Power Kw:	120
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	4 Wheel-drive	Parking lot:	d332
Fueltype:	Diesel		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Very dirty		

Options

Number of keys total	2	Radio
Number keys remote	2	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Alarm		
Navigation with screen		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

235/55/19/105 V				
Winter tyres:	Fr.L.	Goodyear: 5 mm	Fr.R.	Goodyear: 5 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				235/55 R 19 105 V
Tyre size FR				235/55 R 19 105 V
Tyre size RL				235/55 R 19 105 V
Tyre size RR				235/55 R 19 105 V
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				259
Tyre make FR				259
Tyre make RL				259
Tyre make RR				259

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		

Instrument panel, complete, Repaired, Acceptable



Interior, Dirty, Chemical cleaning



Interior, Stain, Cleaning



Backrest cover FL, Hole, Smart repair



Door panel FL, Scratch(es), Acceptable



Interior, Smell, Ozone treatment



Floor covering FL, Worn, Acceptable




Bumper grille, Scratch(es), Replace




Bumper spoiler F, Scratch(es), Spot repair



Bumper F, Scratch(es), Polish

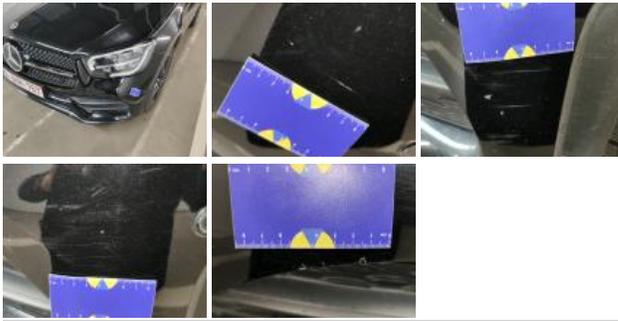

Bonnet, Dent(s), Paintless dent repair

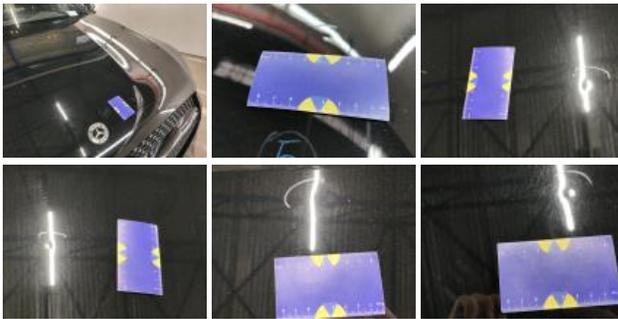

Windscreen moulding, Damaged, Replace



Alloy rim FL polished, Scratch(es), Repair and paint (complete)




Mirror side repeater L, Scratch(es), Polish



Roof pillar L, Dent(s), Paintless dent repair



Door FL, Dent(s) and scratch(es), Spot repair

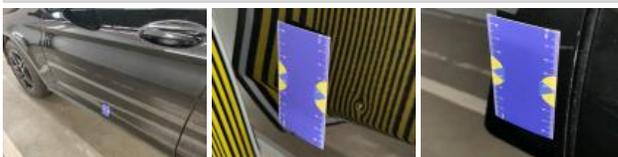


Central pillar L, Dent(s), Paintless dent repair



Door RL, Scratch(es), Polish



Wing RL, Dent(s), Paintless dent repair

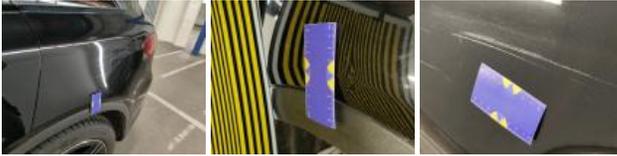


Step L, Dent(s) and scratch(es), Spot repair



Wing trim RL, Scratch(es), Replace



Alloy rim RL polished, Scratch(es), Repair and paint (complete)

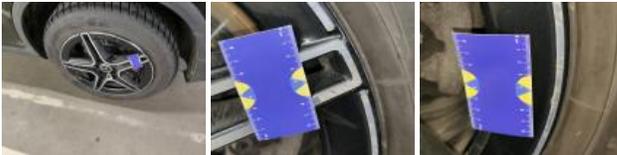

Side window trim FL, Chemical polution, Replace



Side window trim RL, Chemical polution, Replace



Side window trim RL, Chemical polution, Replace



Side window trim RL, Chemical polution, Replace



Side window trim FL, Chemical polution, Replace




Luggage compartment cover, Damaged, Smart repair




Shutter / cover R, Missing, Replace




Internal boot lining R, Scratch(es), Acceptable

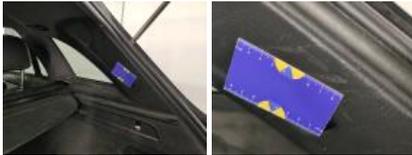

Boot lid covering R, Scratch(es), Smart repair

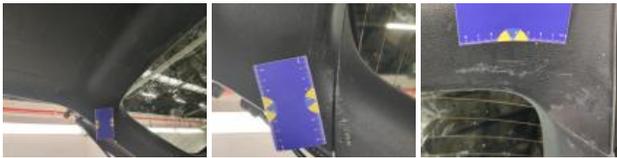


Bumper R, Scratch(es), Polish

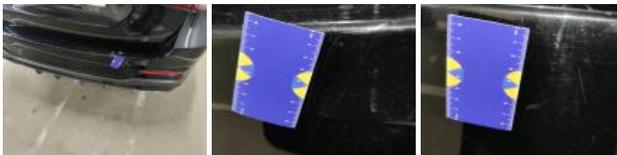

Rear light R, Scratch(es), Polish



Tailgate / Boot, Dent(s), Paintless dent repair

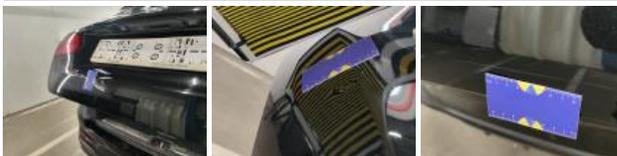

Alloy rim FR polished, Scratch(es), Repair and paint (complete)




Wing FR, Scratch(es), Polish



Outside rear-view mirror housing R, Scratch(es), Repair and paint (complete)



Mirror side repeater R, Crack, Replace

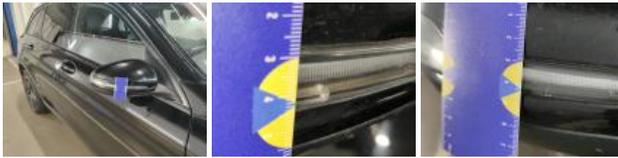

Outside rear-view mirror base R, Scratch(es), Smart repair




Roof pillar R, Dent(s), Paintless dent repair



Door FR, Scratch(es), Polish



Door RR, Scratch(es), Polish

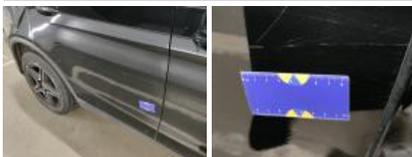

Wing RR, Scratch(es), Polish



Alloy rim RR polished, Scratch(es), Repair and paint (complete)



Wing trim RR, Scratch(es), Acceptable



Side window trim FR, Chemical polution, Replace



Side window trim FR, Chemical polution, Replace



Side window trim RR, Chemical polution, Replace



Side window trim RR, Chemical polution, Replace



Side window trim RR, Chemical polution, Replace



Bodywork, No damage, Acceptable



Roof, Dent(s), Acceptable

