



PEUGEOT 2008: 2DEP928

Vinnumber:	VR3USHNSSPJ538884	Versionname:	2008 1.2 Puretech S/S EAT8 GT 96kW/130pk 5D/P
First Registrationdate:	23/02/2023	Fiscalpower:	Auto-8 - CO2 indicatief
Expertise Mileage:	54040	Power Kw:	
Bodytype:		Body colour	Grey
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:	Front	Parking lot	c601
Fueltype:	Petrol		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Clean		

Options

Number of keys total	2	Radio
Number keys remote	2	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Navigation with screen		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	215 / 60 / 17 / 96 / H / Aluminium	5,0 mm	Fulda	Winter
	Right	215 / 60 / 17 / 96 / H / Aluminium	5,0 mm	Fulda	Winter
Rear	Left	215 / 60 / 17 / 96 / H / Aluminium	5,0 mm	Fulda	Winter
	Right	215 / 60 / 17 / 96 / H / Aluminium	5,0 mm	Fulda	Winter

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Instrument panel, complete, Repaired, Acceptable



Instrument panel, complete, Not functioning (well), Check



Interior, Dirty, Chemical cleaning



Bumper spoiler F, Broken, Replace




Bonnet, Scratch(es), Polish



Door RL, Scratch(es), Polish




Wing trim RL, Scratch(es), Acceptable

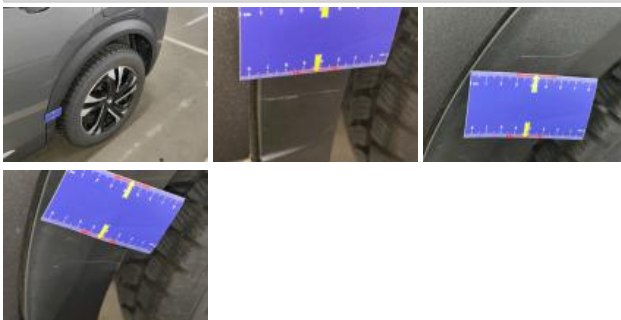

Wing trim FL, Deformed / Strained, Replace



Alloy rim FL polished, Scratch(es), Acceptable

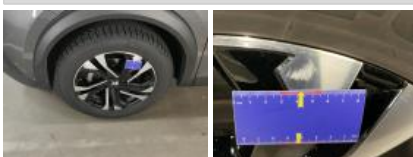

Outside rear-view mirror housing L, Scratch(es), Acceptable



Door FL, Dent(s), Acceptable




Step L, Dent(s), Acceptable



Tailgate / Boot, Scratch(es), Acceptable



Boot moulding, Scratch(es), Acceptable

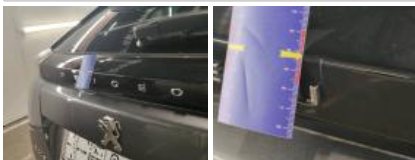

Outside rear-view mirror housing R, Scratch(es), Polish



Bodywork, Not original part, Remove lettering



Bodywork, No damage, Acceptable



Roof, Chemical pollution, Polish

