



MERCEDES A-Klasse Limousine: 1YMB314

Vinnumber:	W1K1771861J250223	Versionname:	A-Klasse Limousine A 250e Business Solution
First Registrationdate:	5/10/2020	Fiscalpower:	160kW/218pk 4D/P Auto-8
Expertise Mileage:	73261	Power Kw:	
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:	Front	Parking lot:	b518
Fueltype:	Hybrid Petrol		
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Bodywork:	Clean		
Interior:	Clean		

Options

Number of keys total:	2	Radio:	
Number keys remote:	2	Sun Roof electric:	
Windows electric F:		Front parking sensors:	
Windows electric R:		Rear parking sensors:	
Cruise Control:			
Steering wheel multifunctional:			
Seats F heated:			
Alarm:			
Navigation with screen:			
Airco electronic:			
Rims alloy:			

Limited Technical Inspection

Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Clutch test:	OK
Exhaust gass:	OK	Transmission:	OK


Tyres

225/45/18/95 Y				
Summer tyres:	Fr.L.	Firestone: 4 mm	Fr.R.	Firestone: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				225/45 R 18 95 Y
Tyre size FR				225/45 R 18 95 Y
Tyre size RL				225/45 R 18 95 Y
Tyre size RR				225/45 R 18 95 Y
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				258
Tyre make FR				258
Tyre make RL				261
Tyre make RR				261


Assistance equipment

Repair kit:	Yes	Compressor:	Yes
Number of charging cables (normal):	1		

Bumper F, Scratch(es), Repair and paint (complete)

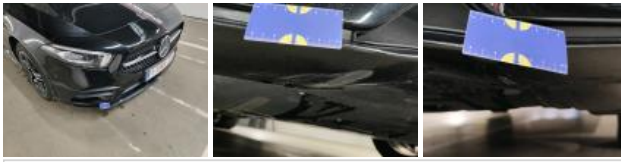

Bonnet, Stone chip(s), Acceptable

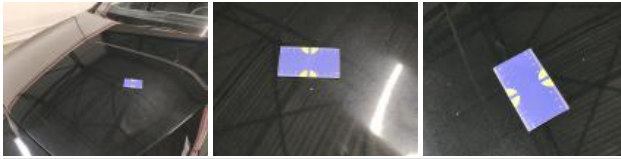

Door FL, Dent(s) and scratch(es), Acceptable




Outside rear-view mirror housing L, Scratch(es), Polish



Door RL, Scratch(es), Acceptable



Bumper R, Scratch(es), Polish

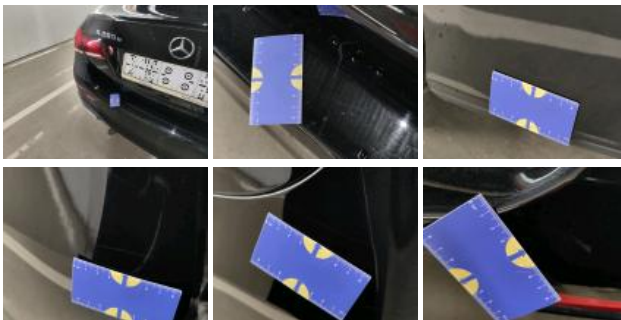


Rear light L, Scratch(es), Polish



Alloy rim RR polished, Scratch(es), Repair and paint (complete)




Alloy rim FR polished, Scratch(es), Repair and paint (complete)

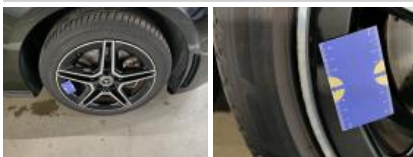

Door FR, Dent(s), Acceptable



Roof pillar R, Scratch(es), Acceptable

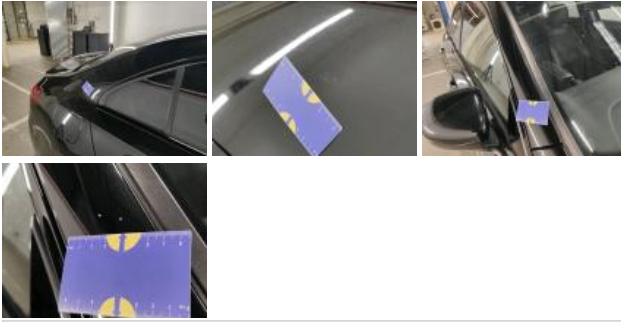

Door seal RR, Broken, Replace



Bodywork, No damage, Check

